CITY OF PORTLAND FIRE PREVENTION BUREAU

380 Congress Street, Portland, Maine 04101 fireprevention@portlandmaine.gov (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

January 17, 2018

Victoria Lambert 61 St Lawrence St #3 Portland ME 04101

Location	CBL	Inspection Date
61 ST LAWRENCE ST	016 E015001	12/5/2017
Inspector	Inspection Type	Status
Justin Bragdon	FP Routine Inspection	Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 2/15/2018.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. The apartment numbers need to be added and visible on all doors both front and rear stairwell	//
NFPA 101-31.3.2.1 AND 31.3.2.1.1 PROTECTION OF HAZARDOUS AREAS NOT PROVIDED; Any hazardous area shall be protected in accordance with Section 8.7. The areas described in Table 31.3.2.1.1 shall be protected as indicated. There is an artist studio in the rear on the 2nd level. There are abundant paints and equipment and a hotplate used for work. Contact Fire Prevention (207) 874-8400 for follow-up consultation.	//
NFPA 101- 7.2.1.8.1 FIRE DOORS MUST BE SELF- OR AUTO-CLOSING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. All apartment fire doors must be self closing. They are equipped with the hardware just not functioning.	//
NFPA 101- 31.3.3.2 INTERIOR FINISH; Interior wall and ceiling finish materials complying with 10.2 shall be permitted as follows: (1) Exit enclosures- Class A or B (2) Lobbies and corridors- Class A or B (3) Other Spaces- Class A, B, or C. Wood wainscoating on the interior rear stairwell must be treated with "intumescent paint" or removed.	//

Violation	Proposed Date of Completion
NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED ; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements.	required. Your signature below indicates that temporary alarms have
2nd/3rd floor apartments need a hardwired photoelectric smoke alarm with battery backup for rooms directly off the kitchen	already been installed.
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load.	/ /
Both front and rear stairwells have excessive art/décor on the walls and floor. Additional storage is neat in nature but excessive for the space. Must reduce the fire load.	
NFPA 70- 590.6 EXTENSION CORDS ; Ground-fault protection for personnel for all temporary wiring installations shall be provided to comply with 590.6(A) and (B). This section shall apply only to temporary wiring installations used to supply temporary power to equipment used by personnel during construction, remodeling, maintenance, repair, or demolition of buildings, structures, equipment, or similar activities.	//
Basement woodshop, there is a power strip in ceiling that is being used for permanent wiring.	
NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY; NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OROTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FTOF ANY STRUCTURE	//
Remove the grill from the 2nd floor deck.	
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED ; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour.	//
There needs to be a self-closing 60 minute rated fire door to the basement.	
FINAL DATE OF COMPLETED VIOLATION(S)	//
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	//

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau <u>prior to the deadline</u> to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

Date	Responsible Party
Date	Responsible Party
SEEN AND AGREED	
Date	Fire Prevention Bureau