

## City of Portland Fire Department Inspection Violations

Case Number: Inspection Date: Inspector:	RR1800022 04/13/2018 Alan Greene	Case Module: Inspection Status: Inspection Type:	Permit Management In Violation FP Routine Fire Inspection
Job Address:	18 Anderson St Portland, ME 04101	Parcel Number:	022 L012001
Reinspection Date:	Tuesday, June 26, 2018	Time: 10:00am	

Please contact the Fire Prevention Bureau at 874-8400 if you have questions about your reinspection. If the violations are not correct at the time of reinspection, you will be charged a \$150 failed reinspection fee.

Noncompliance		
Code Name	Comments	Deadline
NFPA 101-4.5.3.2, 7.1.10.1	IMMEDIATELY remove all obstructions to the means	06/25/2018
Obstructed Egress	of egress	
The means of egress shall remain free and unobstructed.		
NFPA 101-8.3.3.3	Rear basement door	06/25/2018
Fire Doors Must Be Self- Or Auto-Closing		
Fire doors must be self- or auto-closing.		
NFPA101-31.3.3	Hallway walls have been covered with luan	06/25/2018
Interior Finish Noncompliant		
Wall, floor, and ceiling finish must meet approved class rating.		
NFPA 101-31.3.2	Boiler protection required in basement over gas	06/25/2018
Boiler or Fuel-Fired Heater Protection	heaters	
Boiler and fuel-fired heaters serving more than one dwelling unit must have 1-hour separation or sprinkler protection.		
NFPA 101-Ch. 8	Ceiling on 3rd floor stairway needs repair	06/25/2018
Fire Barrier Requires Maintenance		
The fire barrier, including walls, ceilings, floors, etc. must be maintained with the minimum required fire rating.		
NFPA 101-31.3.4.5; City Code 10-3(i)	IMMEDIATELY install temporary alarms where required. Fully compliant, permanent alarms must be	06/25/2018
Smoke Alarms Required (3-11 units)		
Photoelectric, hardwired with battery backup smoke alarms must be provided in every sleeping room, outside every sleeping area, and on every level, including the basement.	installed by the date given. 2nd floor hall does not work, 3rd floor hall missing. 2nd floor bedroom missing. Batteries in existing detectors in hallway are missing.	