

Project:	Pearl Place II		
Location:	184 Pearl Street, Portland, ME		
Becker Job No:	2419		

OBSERVATION REPORT	
Cast in Place Concrete	

Date:	2/14/12
Time:	10:30AM
Temp:	30
Weather:	Sunny

Observation Location: Pile Cap/Grade Beam Reinf Line F between 3 and 5 Line G between 4 and 4.5 Line H and J between 4.5 and 5.5 Elevator mat

	Satisfactory	Un-Satisfactory	Not Completed	Not Applicable	Comments
Reinforcement Size	\boxtimes				
Quantity		\boxtimes			(1) #8 top bar missing @ elevator mat.
Condition	\boxtimes				· ·
Placement					GB @ F-3->F-4: Insufficient bot & side cover @ joint. GB @ F-5: Insufficient side cover. G-5: Mat reinforcement to be shifted over piles. H-5: Insufficient cover at corner pile. mat reinforcement to be lifted to provide adequate cover.
Embed/Anchors					Anchor bolts @ G-4, G-5 & F-5 not yet in place. 1 1/2" dia. anchor bolts @ J-4 have incorrect spacing, concrete already placed. Base plate to be revised.
Lap Splices					
Hot Weather				\boxtimes	
Cold Weather					
Bond Beams					
Additional Items					
Additional Items					

Notes:

All items discussed and pointed out in field with G.C.. G.C. assured all items to be addressed prior to placement.

Signed: Ben Van Deventer, E.I.