

STRUCTURAL TEST AND INSPECTIONS REPORT

FIELD REPORT NO: 11

Project: **53 Danforth Street**
Portland, ME 04101

Contractor: **Wright-Ryan Construction**
10 Danforth Street
Portland, ME 04101

Client: **Archetype**
48 Union Wharf
Portland, ME 04101

Date: **02/03/09**
Temperature/ Weather: **Sunny, 25F**

Present At Site: Larry Ross - Wright Ryan Construction
Kevin Gough - Archetype

Work in Progress / Observations:

11.6 Inspection of CMU grouting operations on level 1 first grout lift, this work was approved.

Action Required / Items to Verify

- 11.1 All hold down brackets require 2-2x6 double studs, add double 2 x stud as needed.
- 11.2 Add shim under holddown.
- 11.3 May require holddown (review)
- 11.4 Add squash blocking at all holddown strapping locations (inside floor cavity) remove kink by nailing strap to blocking (also known as compression blocks).
- 11.5 Make sure all bolts are tightened on holddown (holddown bracket remains to be installed at 2 locations).
- 11.7 Examined the condition of the drop beam below the first level slab.
- 11.8 Three windows at the second level rear/left elevation, require four jack studs. However only one jack stud exists (review).

N/A = No Access to the area-see plan.

Blair Budka

FIELD REPRESENTATIVE

Linas J. Dabrila

REVIEWED BY

