CITY OF PORTLAND

FIRE PREVENTION BUREAU

380 Congress Street, Portland, Maine 04101 fireprevention@portlandmaine.gov (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

December 8, 2017

Responsible Party 1:			
ROBBINS GARY			
5 EVERGREEN RD			
RAYMOND, ME 04071			
Location	CBL	Inspection Date	
9 DOW ST	055 D014001	11/14/2017	
Inspector	Inspection Type	Status	
Robert Mcpartlan	FP Routine Inspection	Failed	

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 12/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. All doors that enter an apartment from a common area must be labled with the apartment number.	//
NFPA 101- 7.2.8.6.2 FIRE ESCAPE REQUIRES REPAIR ; The authority having jurisdiction shall be permitted to approve any existing fire escape stair that has been shown by load test or other satisfactory evidence to have adequate strength. Fire Escape needs to end at ground level. Currently ends on a roof overhang. Contact fire prevention for an appt to meet and discuss this set up in person.	//
NFPA 720- 5.5.6.1 CO ALARMS REQUIRED ; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. Need CO detectors in units 1,3,5,and 6	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED ; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. small bedroom in unit 3	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.

Violation	Proposed Date of Completion
NFPA 70- ARTICLE 110.12 B EXPOSED WIRING CONNECTIONS ; Internal parts of electrical equipment, including busbars, wiring terminals, insulators, and other surfaces, shall not be damaged or contaminated by foreign materials such as paint, plaster, cleaners, abrasives, or corrosive residues. There shall be no damaged parts that may adversely affect safe operation or mechanical strength of the equipment such as parts that are broken; bent; cut; or deteriorated by corrosion, chemical reaction, or overheating. Basement 3 lights all next to each other need to be reattached to their junction boxes	//
NFPA 70 MISSING BOX COVERS ; Refer to NFPA 70, National Electrical Code, on standards for missing box covers. electrical outlet located in basement, located below the CO detector. Missing cover.	//
NFPA 70 MISSING COVER ON PANEL ; Refer to NFPA 70, National Electrical Code, on requirements of missing cover on electrical panel. Breaker panel in basement had no cover, found on the floor	//
NFPA 70 MISSING BREAKER IN PANEL ; Refer to NFPA 70, National Electrical Code, for information on missing breakers in an electrical panel. Unit 3 just inside entryway, need cover for a missing breaker	//
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED ; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) over gas powered water heater in the basement.	//
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED ; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Fire door needed for the laundry room located on the first floor rear staircase	//
FINAL DATE OF COMPLETED VIOLATION(S)	/ /
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	//

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau <u>prior to the deadline</u> to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

Date	Responsible Party	
Date	Responsible Party	
SEEN AND AGREED		
Date	Fire Prevention Bureau	