CITY OF PORTLAND FIRE PREVENTION BUREAU

380 Congress Street, Portland, Maine 04101 fireprevention@portlandmaine.gov (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

June 23, 2017

| Responsible Party 1: | | |
|---------------------------------|---------------------------|-----------------------------|
| SHOEBOTTOM BRUCE | | |
| 40 WOODFIELD DR | | |
| SCARBOROUGH , ME 04074 | | |
| | | |
| Location | CBL | Inspection Date |
| Location 10 GILMAN ST | CBL 064 E021001 | Inspection Date 6/8/2017 |
| | | - |

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 7/15/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

| Violation | Proposed Date of Completion |
|--|--|
| PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. All Apartment front and rear entry doors must have their appropriate number on the doors. | // |
| NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE; Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. Patch the hole in the front stairwell between floors 1 and 2. | // |
| NFPA 101- 31.3.7 FLOOR/ CEILINGS ASSEMBLY NOT SMOKE-TIGHT; In buildings other than those meeting the requirements of 31.3.7.1, 31.3.7.2, 31.3.7.3, 31.3.7.4, or 31.3.7.5, in addition to the following criteria to be met. Patch the hole in the ceiling: 2nd floor landing outside apartment 4 entry door. | // |
| NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. Basement combination smoke/carbon monoxide alarm needs a new connection for the detector (shows evidence of burning). | IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed. |

| Violation | Proposed Date of Completion |
|--|--|
| NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. Unit 1: Needs a combo smoke/CO photoelectric alarm installed outside the bedroom. Unit 2: Add a hardwired photoelectric smoke alarm outside the bedroom. Unit 3: Remove both of the non-working smoke detectors completely or replace with hardwired photoelectric smoke alarms. Unit 4: Add a hardwired photoelectric smoke alarm to the fron room being used for sleeping. | IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed. |
| NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Sprinkler heads required above each of the gas water heaters (2) in the basement. | // |
| NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Basement Door needs to be a fire door with self-closing hardware. | // |
| FINAL DATE OF COMPLETED VIOLATION(S) | // |
| FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S) | // |

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau <u>prior to the deadline</u> to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

| Date | Responsible Party |
|-----------------|------------------------|
| Date | Responsible Party |
| SEEN AND AGREED | |
| Date. | Fire Prevention Rureau |