

CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

March 15, 2018

IDA CARSON
 32 FREDERIC ST
 PORTLAND ME 04102

Location 30 FREDERIC ST	CBL 076 A012001	Inspection Date 2/9/2018
Inspector David Crowley	Inspection Type FP Routine Inspection	Status Follow up Required

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 3/30/2018.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Water heater needs a domestic sprinkler head installed above it for protection	
NFPA 1- 19.1.2 INSIDE STORAGE NOT ORDERLY; Persons owning or having control of any property shall not allow any combustible waste material to accumulate in any area or in any manner that creates a fire hazard to life or property. 2nd floor excessive storage impedes reasonable passage through unit	
NFPA 70- ARTICLE 590.6 EXT. CORD USED FOR PERMENANT WIRING; Ground-fault protection for personnel for all TEMPORARY wiring installations shall be provided to comply with 590.6 (A) and (B). This section shall apply only to temporary wiring installations used to supply temporary power to equipment used by personnel during construction, remodeling, maintenance, repair, or demolition of buildings, structures, equipment or similar activities. First floor & Basement	
NFPA 101- 8.3.5 HOLE IN WALL NEEDS REPAIR; The provisions of 8.3.5 shall govern the materials and methods of construction used to protect through-penetrations and membrane penetrations in fire walls, fire barrier walls, and fire resistance-rated horizontal assemblies. The provisions of 8.3.5 shall not apply to approved existing materials and methods of construction used to protect existing through-penetrations and existing membrane penetrations in fire walls, fire barrier walls, or fire resistance-rated horizontal assemblies, unless otherwise required by chapters 11 though 43. Second floor stair way front hole penetration would infringe on exit from first floor apt front exit	

Violation	Proposed Date of Completion
<p>N.F.P.A. 101 CHP. 31.3.3.2 HOLE IN CEILING NEEDS REPAIR; InteriorWall and Ceiling Finish Interior walls and ceiling finish materials complying with 10.2 shall be permitted as follows: 1) Exit enclosures -- Class A or class B 2) Lobbies and corridors--Class A or Class B 3) Other spaces Class A, orClass B, or Class C Second floor kitchen celing</p>	
<p>NFPA 101-7.2.2.3.1.1 STAIRS MUST BE MAINTAINED SOLID; All stairs serving as required means of egress shall be of permanent fixed construction, unless they are stairs serving seating that is designed to be repositioned in accordance with Chapter 12 and 13. Stairs front & rear are in need of repair. Contact Code Enforcement (207) 874-8703 for a permit to repair!</p>	
<p>NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. Co detectors not found within units. A hardwired photoelectric Carbon Monoxide alarm is required to be installed within each living unit.</p>	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
<p>NFPA 101- 7.2.2.4.2 HANDRAILS ARE NOT CONTINOUS; Required guards and handrails shall continue for the full length of each flight of stairs. At turns of new stairs, inside handrails shall be continuous between flights at landings. Hand rails do not return into walls</p>	
<p>NFPA 70- ARTICLE 314.28 OPEN ELECTRICAL JUNCTION BOX; Boxes and conduit bodies used as pull or junction boxes shall comply with 314.28 (A) through (D). Knockouts on electrical panel not blocked</p>	
<p>FINAL DATE OF COMPLETED VIOLATION(S)</p>	<p>___/___/___</p>
<p>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</p>	<p>___/___/___</p>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

Date

Responsible Party

Date

Responsible Party

SEEN AND AGREED

Date

Fire Prevention Bureau