CITY OF PORTLAND FIRE PREVENTION BUREAU

380 Congress Street, Portland, Maine 04101 fireprevention@portlandmaine.gov (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

January 4, 2017

Responsible Party 1:	Responsible Party 2:	
Evans Robert	Aquarius Property Management LLC	
111 Serpentine Rd	780 Broadway	
Tenafly, NJ 07670	South Portland, ME 04106	
Location	CBL	Inspection Date
546 STEVENS AVE	135 D014001	12/28/2016
Inspector	Inspection Type	Status
John Brennan	FP Routine Inspection	Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must complete the proposed date of completion column by proposing a reasonable timeframe to remedy each violation. This form must be received by the Fire Prevention Bureau no later than 1/30/2017. The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

YOUR FAILURE TO SUBMIT A PLAN OF ACTION BY THE DATE PROVIDED, OR TO CORRECT ANY VIOLATION WITHIN THE APPLICABLE TIME FRAME, MAY RESULT IN LEGAL ACTION AGAINST YOU, THE IMPOSITION OF CIVIL PENALTIES, AND THE PURSUIT OF OTHER LEGAL REMEDIES.

Violation	Proposed Date of Completion
NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE; Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. Patch all holes in the stairwells (front and rear). Repair the ceiling above the stairs that Apartment 1 uses to enter the basement from their apartment.	//
NFPA 101- 31.2.2.1.2 EXIT STAIR REQ 60-MIN FIRE DOORS - NON-HIGH-RISE; In buildings using Option 4, exit enclosures shall have a minimum 1-hour fire resistance rating, and doors shall have a minimum 1-hour fire protection rating. 3rd floor rear stairwell storage room / woodworking shop.	//
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. Remove the storage in the hallways on the third floor in both the front and rear stairwells.	//
NFPA 70- 4.10.8 BROKEN LIGHT FIXTURE; Luminaries shall be installed such that the connections between the luminaire conductors and circuit conductors can be inspected without requiring the disconnection of any part of the wiring unless the luminaries are connected by attachment plugs and receptacles. All light fixtures in the basement must have a bulb in them to prevent elctrical shock.	//

Violation		Proposed Date of Completion
equipment, including busbars, wiring te damaged or contaminated by foreign m corrosive residues. There shall be no d	<u> </u>	//
NFPA 70 MISSING BOX COVERS; Refor missing box covers.	fer to NFPA 70, National Electrical Code, on standards	
	roughout the common areas and the basement that	
NFPA 70 MISSING BREAKER IN PAN information on missing breakers in an e There is an open circuit in the panel. A	•	//
FIRED GRILL, CHARCOAL GRILL, OF HEATING, OROTHER PURPOSE, SH	CHI OR GRILL ON BALCONY; NO HIBACHI, GAS- R OTHER SIMILAR DEVICES USED FOR COOKING, ALL BE USED OR KINDLED ON ANY BALCONY OR DR WITHIN 10 FTOF ANY STRUCTURE	//
	d within the timeframes provided. If I require addit	
understand that I must contact the Fi entirely within the Bureau's discretion	re Prevention Bureau <u>prior to the deadline</u> to request on to grant or deny.	st an extension, which is
	ponsibility to schedule a reinspection of my propertillure to schedule a reinspection shall be deemed an	
	nt, I understand that I am liable for penalties pursuants and 10-25, and 30-A M.R.S. § 4452 and may be so	
Date	Responsible Party	
Date	Responsible Party	
SEEN AND AGREED		
Date	Fire Prevention Bureau	