

FIELD OBSERVATION – FOURTH FLOOR IN-WALL AND CEILING ELECTRICAL REPORT 08-02-2016

Report Date: 08/02/2016

Observation Date/Time: 08/01/2016 8:45AM to 9:45 AM

AEI Project Number and Name: 14018 – The Park Danforth

Report by: Stephen Markiewicz

Contractor: PC Construction

N:\Projects\2014\14018 – Park Danforth\40 Construction\Field Reports\2016-07-11 second floor ceiling elec FIELD REPORT.docx

Work In Progress:

Electrical rough-in above ceilings and within walls is substantially complete on the fourth floor. The quality of the workmanship is high, and the installation appears to be consistent with code requirements and the Contract Documents except as noted below.

Observations/Action items:

General

1. Temporary wiring and lighting fixtures are in place throughout the project. These shall be removed when no longer needed.
2. Cables are not yet terminated at the load centers in units 1400 through 1403.
3. Sprinkler system devices at stair landings are not yet roughed in for connection to fire alarm.




Unit 1403

1. Cables are not yet terminated at the lighting outlet box in the corridor.



Unit 1404

1. A main-lug termination in the load center has bent the load center main bus. Replace load center interior.

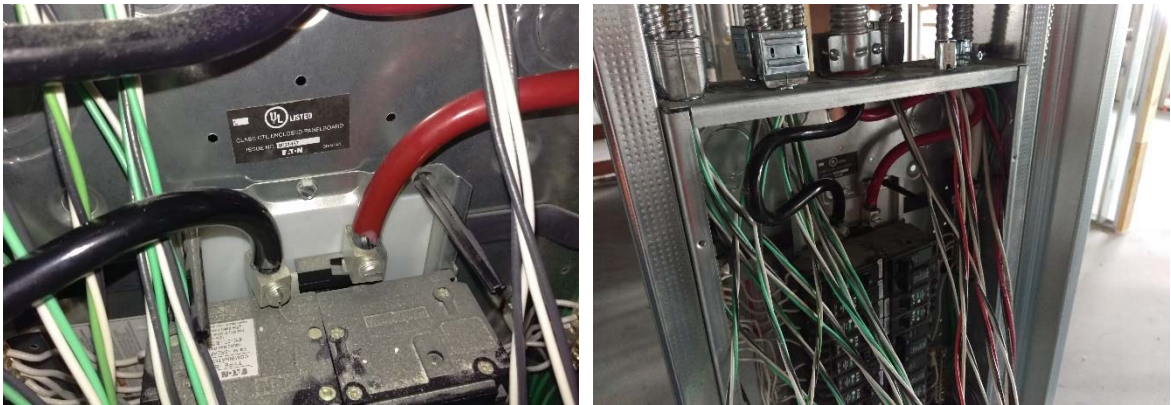

Unit 1407

1. Install plaster ring on Living Room telephone outlet box.



Unit 1408

1. Install plaster ring on Living Room telephone outlet box.



Units 1411 and 1412

1. The range cables are not properly secured.



(Unit 1412 pictured)

Elec 4002

1. Feeder cables are not yet run into the room. Firestop the cables when their installation is complete.



Group Room 4004

1. Rough-in of exterior wall is generally not complete.



END OF FIELD OBSERVATION