

FIELD OBSERVATION – FIFTH FLOOR WEST IN-WALL AND CEILING ELECTRICAL REPORT 09-13-2016

Report Date: 09/13/2016

Observation Date/Time: 09/13/2016 9:30 AM

AEI Project Number and Name: 14018 – The Park Danforth

Report by: Stephen Markiewicz

Contractor: PC Construction

N:\Projects\2014\14018 - Park Danforth\40 Construction\Field Reports\2016-09-13 fifth floor west in-wall and ceiling elec FIELD REPORT.docx

Work In Progress:

Electrical rough-in above ceilings and within walls is nearly complete on the west end of the fifth floor, from column Line 7 to the exterior wall. The quality of the installed work is high, and the installation appears to be consistent with code requirements and the Contract Documents except as noted below.

Observations/Action items:

General

- Except as noted below, most electrical penetrations that occur above ceilings are firestopped, but those below ceilings are not.

Elevator Lobby 5003

- Firestop MC penetration through wall into Corridor 5011.

Anteroom 5009

- Firestop MC penetration into Elevator Lobby 5003.

Community Room 5004


- Electrical rough-in is generally incomplete in this room.

Toilet 5005, Anteroom 5006, and Toilet 5007

- The receptacle outlets are not yet roughed in.

Electric Room 5002

- Firestop cable penetrations through floor.
- Feeder cables are not yet extended into room ~ Firestop penetrations when cables are installed into room.

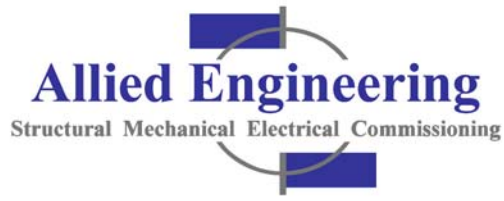

Unit 1505

- Complete rough-in of corridor wall light.
- Firestop cable penetrations above door.
- Complete rough-in of corridor receptacle.

Unit 1506

- Complete rough-in of corridor wall light.

Unit 1500

- Cables are not yet terminated at load center.
- Secure cables above load center.

Unit 1501

- Cables are not yet terminated at load center.
- Secure cables above load center.
- Firestop cable penetration through floor near unit entrance.
- Firestop cable penetration through floor in bathroom.

Unit 1502

- Cables are not yet terminated at load center.
- Secure cables above load center.
- Secure cable that enters from balcony.

Unit 1504

- Cables are not yet terminated at load center.
- Secure cables above load center.

Stair A

- Secure cables for receptacle outlet.

END OF FIELD OBSERVATION