

COMMENTS

5/4/00 - Precor on site - setbacks - OK - told them not to pour tubes until they are at least 4' down. OK

7/12/00 ok to Close new 6x7 addition on end of existing porch -

Issues on new deck -

OK PS# 1116LE 2305.2  
 1) Vertical 6x6's do not have fasteners to top side - substitute L Brackets on 2 sides of Ea Post -

2) Bottom Rail of new deck at 4 1/4 spacing - must be less than 4"

OK BOCA 2406.2

3) ~~Handrails~~ <sup>Handrails</sup> ~~must be 1 1/4" x 38" w/ smooth-rounded edges~~ - 1 1/4" x 38" w/ smooth-rounded edges

Need handrails both sides of stairs to grade - (stairs were existing -

any treads & risers replaced - Treads 9 1/2" net (except top is 9")

Risers 7 3/4" (except top is 9" - bottom will be built up to 7 3/4")

7/17/00 Copy of 2403.5 & 2406.2 given to contractor on site. (P)

7/28 - 1st Insp by Mullitt - confirmed that existing stairs will require 2x4 handrails (P)

8/22 All correction made Final Inspection OK to close perm. (P)

158-A-10  
 000336

Inspection Record

Type	Date
Foundation: _____	_____
Framing: _____	_____
Plumbing: _____	_____
Final: _____	_____
Other: _____	_____