

## Observation Report 021 Structural Steel

Date:	10/6/2004	
Time:	10:00 AM	
Temp:	70 F	
Weather:	Sunny	

Project:	Portland Jetport - Baggage Claim Exp	<u>φ</u>			
	Portland, ME	_			
Job #:	826				
Location:	Steel erected from line 38 to line 51.9 be	petween lines S and X			
			_		
	Satisfactory Unsatisfactory Not Completed N/A	Satisfactory Unsatisfactory Not Completed N/A			
	Bolt Condition	Doubler Plates			
	Weld Condition   X AB's, Nuts & Wash		_		
	x Grout/Level PLs		_		
	x Plumbness/Fitup				
	x Mtl Deck Welds x Pour Stops		_		
	x Bracing				
	Bracing		_		
Notes:	Beams between line 38 and 41 were tor	orched to remove 1" due to building being short. This was			
	not approved by E.O.R. The bolt holes were also torched which is not allowed by specification				
	Connection will need to be modified. Stiffners slotted to get E/W steel at roof in place and				
	attached to web of columns. Couplers installed to extend A.B.s at X/41 & 44, plate washers and				
	shims not installed at this time.				
			_		
Signed:	Todd M. Neal, P.E.	Date:10/6/2004_			