

Feb. 21, 2001

To: Tony Vance

From: Steve Wentworth,  
Code Enforcement, Portland, Me. 874-8709

Reference: Lot #12, Copley Woods (413-B-012)

- 1.) Stair stringers exceed  $7 \frac{3}{4}$  rise, actually measured at  $1/16$  over all steps
- 2.) Plans need to be amended to represent the cantilevered dormer change
- 3.) Data on floor girders needed & are but joints allowed?
- 4.) Are diagonal braces needed for interior of roof trusses?
- 5.) Data needed on laminated beams used @ dormers.
- 6.) 2<sup>nd</sup>. floor egress windows need to be remeasured.
- 7.) Pressure test on drain lines needed
- 8.)  $1 \frac{1}{4}$  rule for electrical conductors
- 9.) Framing not visible for skuttle to overhead.
- 10.) Kinked NMC to basement light fixture.
- 11.) No header at base of cellar stairs
- 12.) Floor girders not doubled as shown on plans adjacent to chimney
- 13.) Grounding conductor not clamped to ground rod.

Do Not Proceed with construction of this project until the above listed discrepancies are corrected.