


- CLAD WOOD WINDOW UNIT

---- 2X CONTINUOUS WD. BLKG.


- IX PTD. WOOD WINDOW SILL


- SEALANT ALL AROUND WINDOW

- MD. BLOCKING, SET IN SEALANT

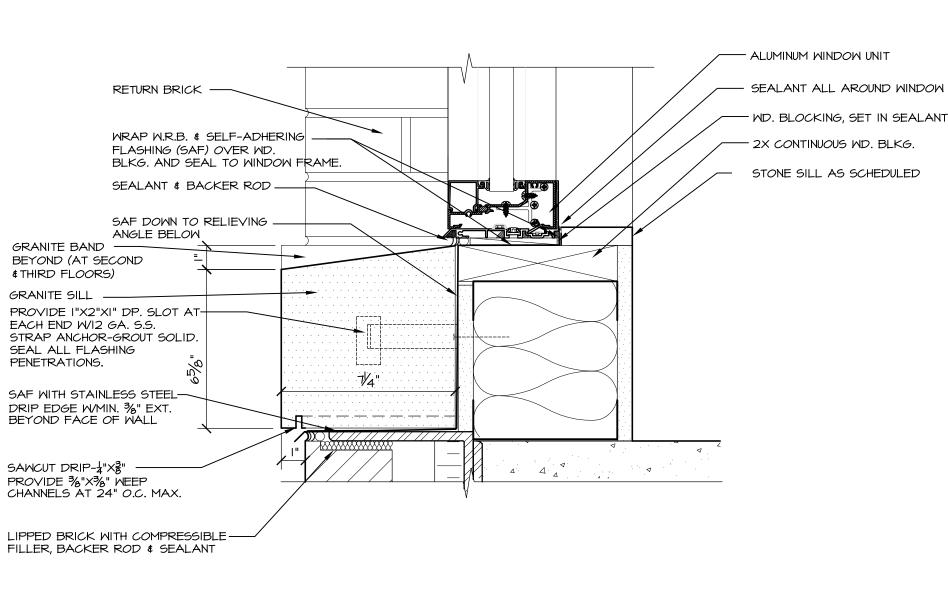




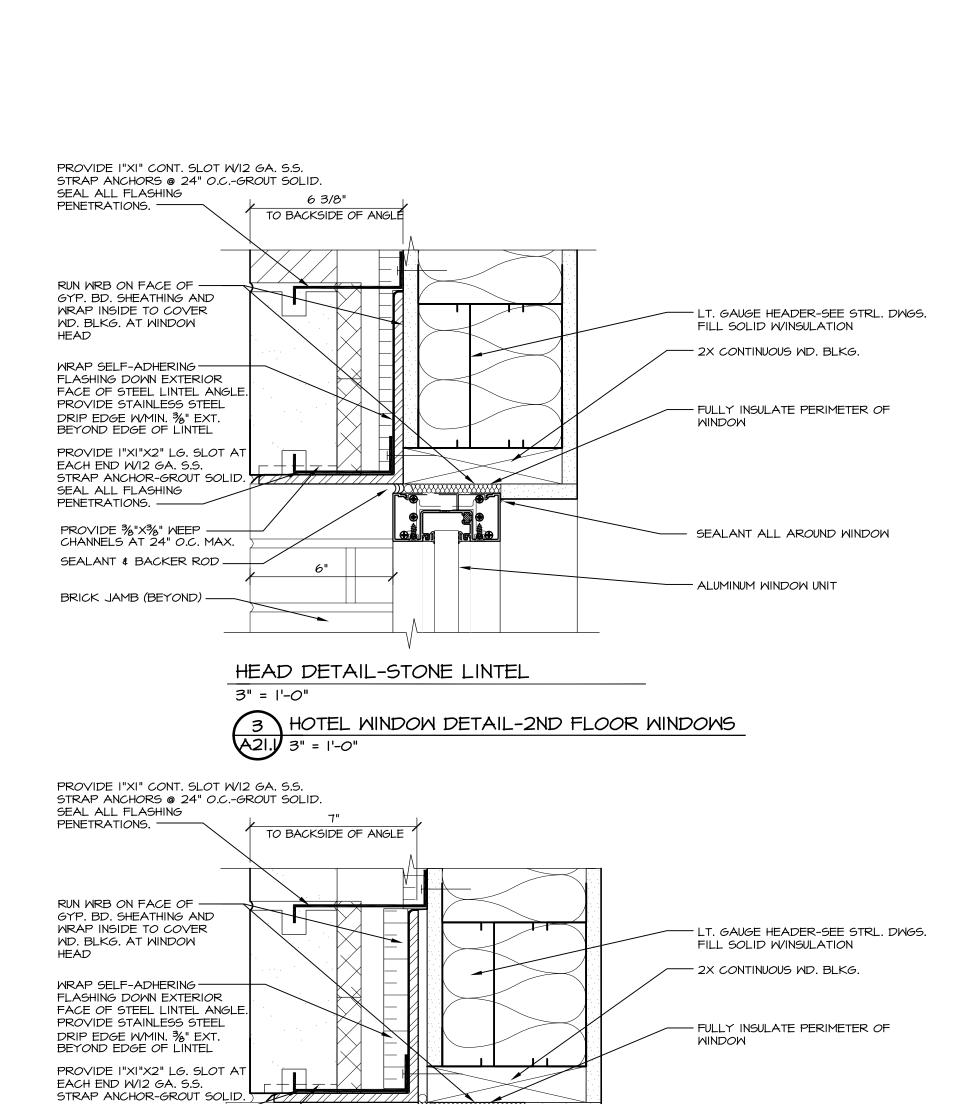

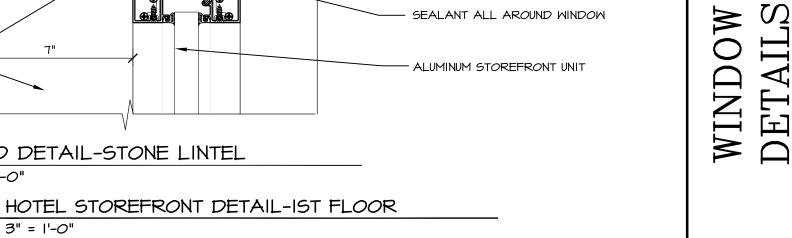

- SEALANT ALL AROUND WINDOW

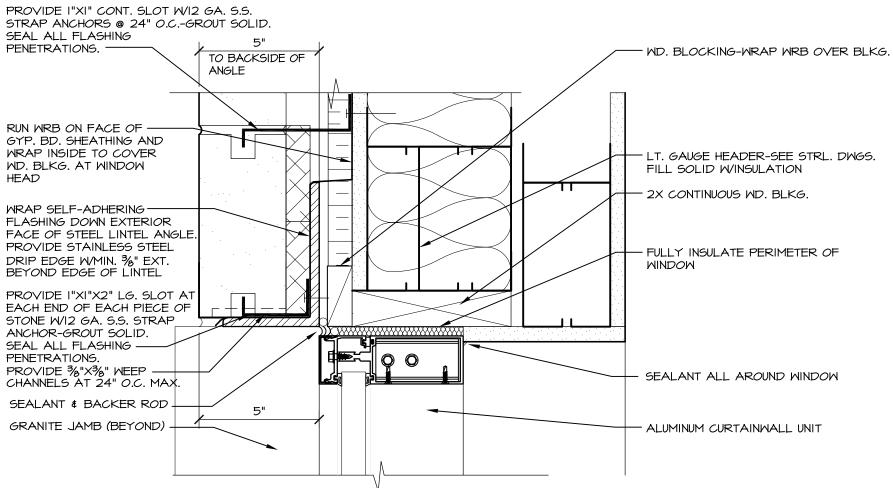

HEAD DETAIL-STONE LINTEL 3" = I'-0"

HEAD DETAIL-STONE LINTEL

3" = I'-0"

3" = I'-0"


SEAL ALL FLASHING

SEALANT & BACKER ROD.

GRANITE JAMB (BEYOND) -

PENETRATIONS. —

5 HOTEL CURTAIN WALL DETAIL-2 STORY CURTAIN WA

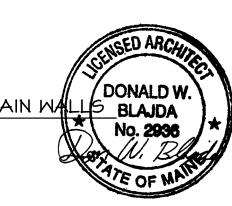

COMMERCI **DATE:** 05-09-13 SCALE: SEE PLAN DRAWN BY: KPH

STREET

DEVELOPMENT

OSE

MIXED

RESIDENCE WINDOW DETAILS

3" = I'-0"

WINDOW SILL DETAIL-6TH FLOOR

RETURN BRICK .

BELOW

BEYOND

GRANITE SILL -

PROVIDE I"X2"XI" DP. SLOT AT-

EACH END W/12 GA. S.S. STRAP ANCHOR-GROUT SOLID.

SEAL ALL FLASHING

SAMCUT DRIP-1/4"X1/4"

PENETRATIONS.

WRAP W.R.B. & SELF-ADHERING

BLKG. AND SEAL TO WINDOW FRAME.

FLASHING (SAF) OVER WD.

SEALANT & BACKER ROD -

GRANITE BAND

SAF DOWN TO LINTEL ANGLE -