

SHEET TITLE:



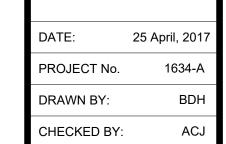



AS NOTED SCALE:


**DETAILS** 

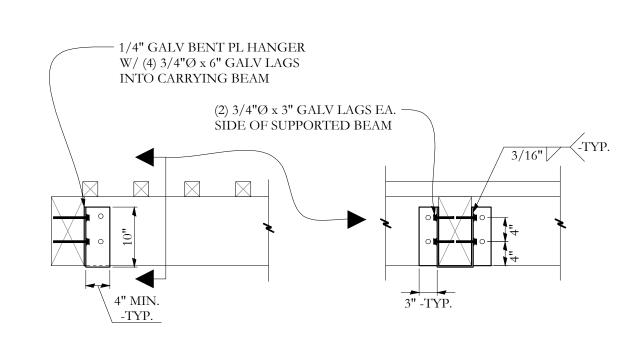




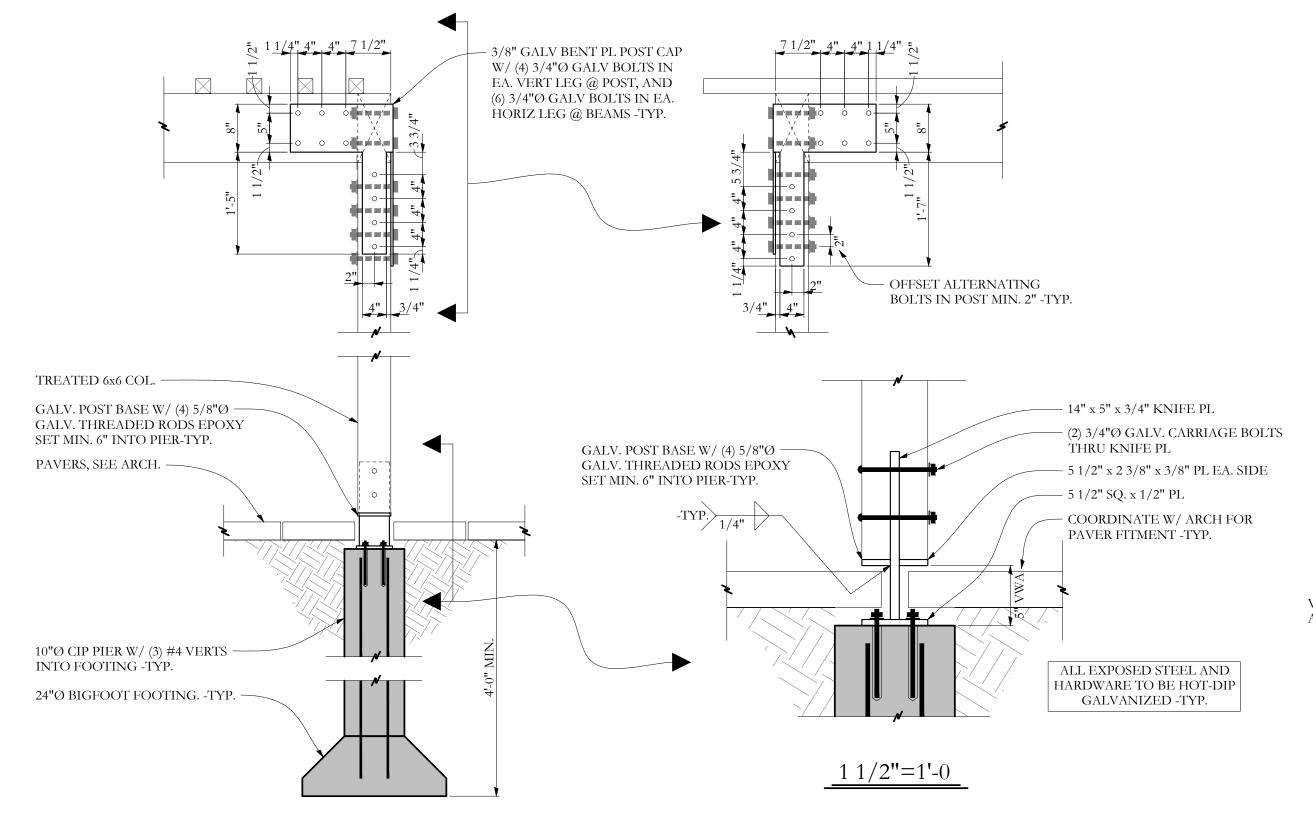

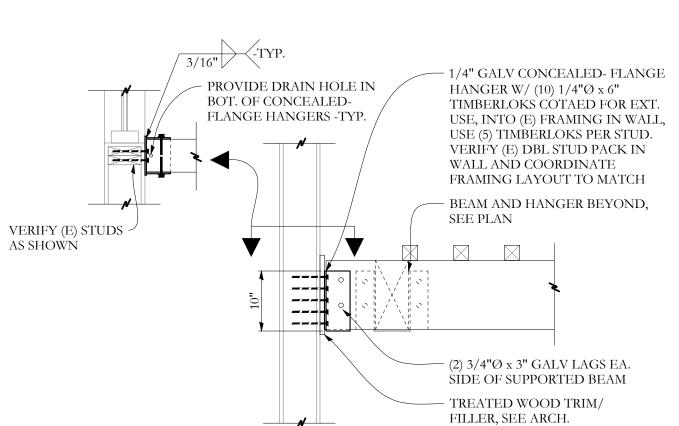



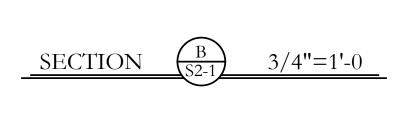



77 Oak Street

f. 866-793-7835

VERIFY (E) STUDS AS SHOWN

- GALV 1/4" PL CONCEALED-FLANGE

TIMBERLOKS COATED FOR EXT.

USE, FASTENED INTO (E) DBL STUD

PACK IN WALL (2 PER STUD). VERIFY

(E) FRAMING CONDITION. ALIGN W/

(2) 1/4"Ø TIMBERLOKS COATED FOR

EXT. USE, FASTENED INTO (E) DBL

STUD PACK IN WALL (1 PER STUD) @

BOTH LOCATIONS SHOWN. VERIFY

– 3x4 VERT @ EA. DIAGONAL -TYP.

TREATED WOOD TRIM/ FILLER,

(E) FRAMING CONDITION.

– PROVIDE DRAIN HOLE IN

BOT. OF CONCEALED-

MIN.

FLANGE HANGERS -TYP.

HANGER W/ (4) 1/4"Ø x 6"

(E) STUDS.

SEE ARCH.

(1) 1/2"Ø x 3 1/2" GALV LAG ——

L2x2x1/4 x 5" GALV ANGLE —

10" x 2 1/2" x 1/4" GALV PL, (1) —

4x4 DIAGONAL, SEE PLAN -

1" BEARING SEAT TOP AND -

BOT. OF DIAGONAL -TYP.

INTO DIAGONAL.

(2) 1/4"Ø TIMBERLOKS, COATED — FOR EXT. USE, COUNTERSUNK

SIDE OF DIAGONAL W/ (4)

1/2"Ø x 3" GALV LAGS THRU

BOLTS -TYP. EA. DIAGONAL

W/ (2) 1/4"Ø TIMBERLOKS

TREATED FOR EXT. USE,

PER ANGLE LEG (4 TOTAL)

INTO EA. SIDE OF 4x6.

ALTERNATE HOLES TO

AVOID LAG CONFLICT