

GENERAL CONDITION RESTORATION NOTES: 1. STRIP PTD ON BRICKS FOR REPOINTING (TYP ALL SIDES)

(W2) REMOVE EXISTING WOOD GUTTER AND REPLACE WITH NEW METAL GUTTER

DETAIL 2/A22 . REPLACE WITH NEW METAL GUTTER AND WOOD TRIM TO

(W6) NEW MAHOGANY THRESHOLD TO MATCH EXISTING PRETREAT ALL SIDES.

NEW PAINT AND HARDWARE. CLEAN AND REINSTALL VERTICAL DEADBOLTS.

REINSTALLATION. INSPECT CONDITION RESTORE AND REINSTALL AFTER ROOF FLASHING: HAS BEEN INSTALLED.


(GI) REMOVE ASPHALT SHINGLE ROOFING AND LEAD STEP FLASHING AT ENTRY

(G2) REMOVE EXISTING SPOT LIGHTS AND MOUNTING BRACKETS AT BELFRY AS REQUIRED. INSTALL NEW SPOTLIGHTS AS PRESCRIBED IN ELECTRICAL,


EXISTING CONDITION - WEST ELEVATION

SCALE: 1/4" = 1'-0"

4'-Ø"

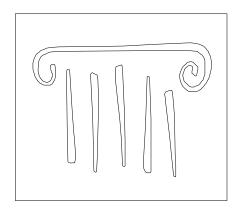

65 NEWBURY STREET PORTLAND, ME 04101 207.761.9000 info@portcityarch.com WWW.PORTCITYARCH.COM

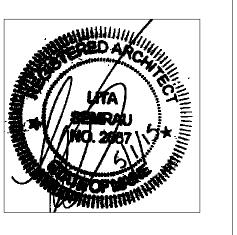





PERMIT SET

REVISIONS		
No.	Description	Date
-	-	-

UNIVERSITY OF NEW ENGLAND

PORTLAND, MAINE

ALUMNI HALL RENOVATION

RESTORATION ELEVATION

Project Number May 01, 2015 JP TS SM AR Drawn by Checked by

RE1.2

Scale AS NOTED