NOTES:
-EXISTING SPRINKLER
(ALL HEADS TO BE TESTED)
-NO CHANGE OF USE
-NEW EMERGENCY LIGHTING
-NEW EXIT LIGHTS
-CONTRACTOR TO VERIFY
THAT EXISTING EMERGENCY LIGHTING AND EXIT FIXTURES ARE FUNCTIONING AND IN CORRECT LOCATIONS.

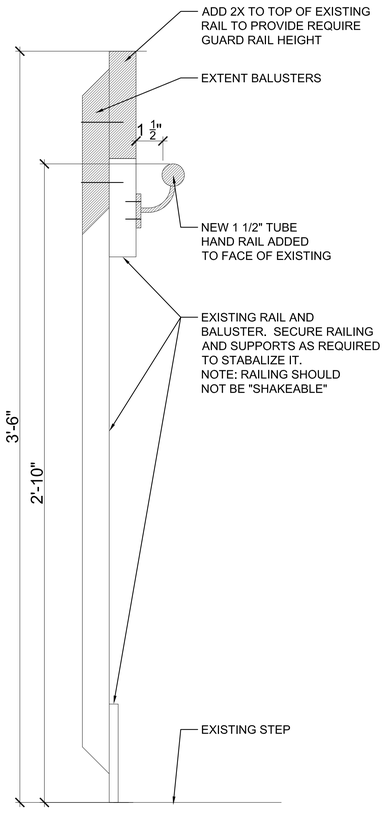


3 | GUARD/HAND RAIL DETAIL
2"=1'-0"

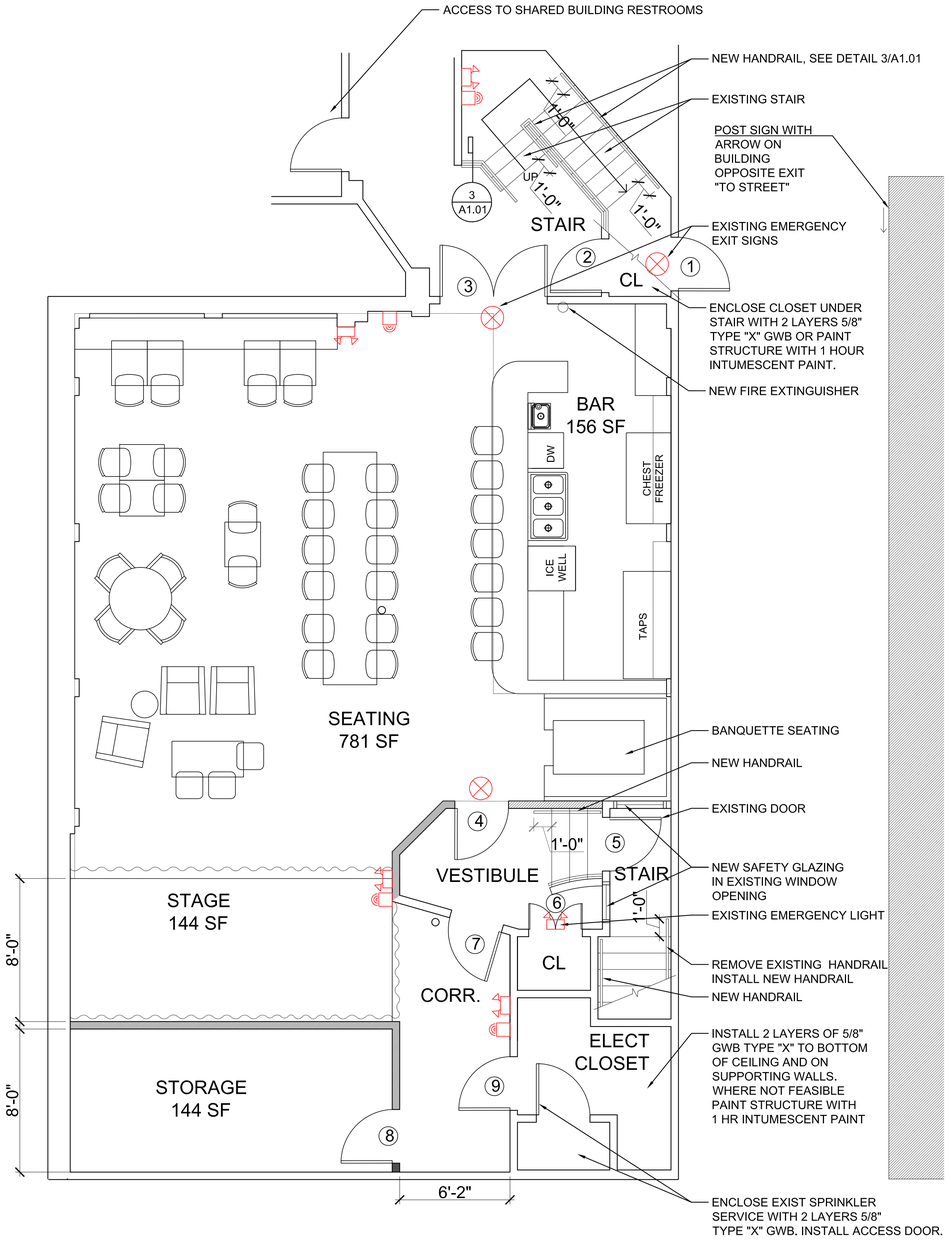


2 | FLOOR PLAN
1/4"=1'-0"

## LEGEND

EXISTING WALL TO REMAIN

NEW WALL

EXIT SIGN

EMERGENCY LIGHTING

FIRE STROBE

## DOOR SCHEDULE

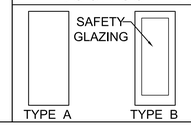


## DOOR SCHEDULE

| # | LOCATION | SIZE | HARDWARE | TYPE | MATERIAL | NOTES |
|---|---|---|---|---|---|---|
| 1 | STAIR | EXIST. | EXIST. | | | |
| 2 | CLOSET | EXIST. | EXIST. | | | |
| 3 | STAIR | EXIST. | ADD PANIC HARDWARE | | | |
| 4 | VESTIBULE | 3'-0" x 7'-0" x 1.75" | PASSAGE W/ DEADBOLT | B | SOLID CORE WOOD | 1 HR * |
| 5 | STAIR | EXIST. | EXIST. | | | |
| 6 | CLOSET | EXIST. | EXIST | | | 1 HR |
| 7 | CORR. | EXIST. | EXIST | | | |
| 8 | STORAGE | 3'-0" x 7'-0" x 1.75" | STORE RM | A | SOLID CORE WOOD | |
| 9 | ELECT. CL. | EXIST. | EXIST. | | | |

* ADD NOTE TO DOOR " DO NOT LOCK WHEN BUSINESS IS IN OPERATION"

## CODE REVIEW

NFPA 101 2009

| | |
|---|---|
| NFPA 101 | |
| OCCUPANT LOAD | 7.3.1.2 |
| SEATING AREA | 781SF / 15 = 52 |
| MISC BAR SEATING | = 7 |
| TOTAL OCCUPANTS | =58 |
| FIRE ALARM NOT REQUIRED AS LESS THAN 300 | 12.3.4.1.1 |
| EMERGENCY LIGHTING REQUIRED | 12.2.9.1 |
| FULLY SPRINKLED | 12.3.5.1 |

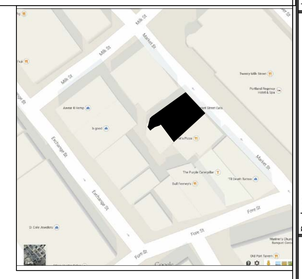

KEY PLAN
NTS

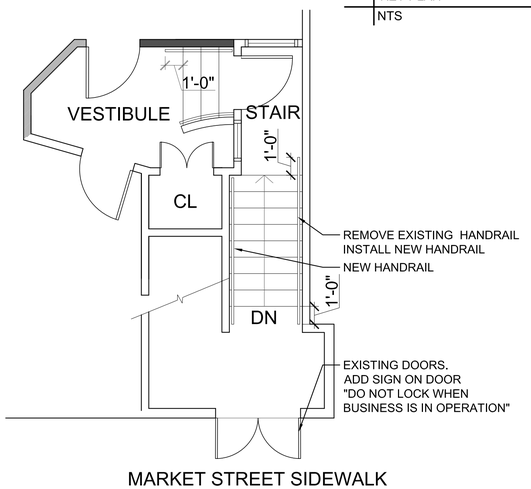


MARKET STREET SIDEWALK

1 | ENTRY LEVEL FLOOR PLAN
1/4"=1'-0"

Prepared For: MARK OHLSON

Consulting Engineer:

Architect: ARCHETYPE architects
48 Union Wharf Portland, Maine 04101
(207) 772-6022 Fax (207) 772-4056

Project: LINCOLN
36 MARKET ST
PORTLAND, MAINE

Revisions:

AS NOTED

December 3, 2014

LINCOLN'S FLOOR PLAN

A1.01