


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

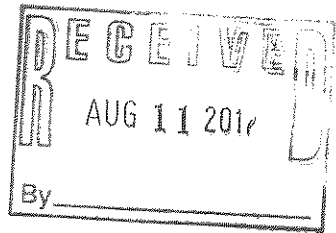

NOTICE OF VIOLATION AND ORDER TO CORRECT

July 31, 2017

Responsible Party 1: HALEY JULIA 32 MORNING ST PORTLAND, ME 04101		
Location 4 MONUMENT ST	CBL 016 B001001	Inspection Date 7/10/2017
Inspector John Brennan	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 8/15/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101- 7.2.1.15.8 FIRE DOOR ASSEMBLY REQ REPAIR; Door openings not in proper operating condition shall be repaired or replaced without delay. Adjust the hinges for the basement fire door which separates the 2 sections of basement. Door must self close.	9/10/2017
NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. Combo CO/smoke detector in Apartment 8 (outside bedroom) did not operate when tested.	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. 1) All 2 bedroom units must have a smoke alarm directly outside each of the bedrooms. Currently, only one of the bedrooms in each apartment have an smoke alarm outside the room. 2) The smoke detector in the bedroom for apartment 7 was missing.	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 70 MISSING COVER ON PANEL; Refer to NFPA 70, National Electrical Code, on requirements of missing cover on electrical panel. All apartment electrical panels are missing the front panel covers.	9/10/2017

Violation	Proposed Date of Completion
NFPA 70- 4.10.8 DEFECTIVE LIGHT FIXTURE; Luminaries shall be installed such that the connections between the luminaire conductors and the circuit conductors can be inspected without requiring the disconnection of any part of the wiring unless the luminaries are connected by attachment plugs and receptacles. Shop light in basement (B/C Corner) plugged into a 3-1 plug. Must have its own dedicated outlet.	9/10/2017
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) All 8 gas fired furnaces/water heaters in the basement require sprinkler protection.	8/28/2017 DONE
FINAL DATE OF COMPLETED VIOLATION(S)	_/_/_
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	_/_/_

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

8/9/2017 _____
Date Responsible Party
Julius Halcyon

Date Responsible Party

SEEN AND AGREED

8/14/2017 _____
Date Fire Prevention Bureau
CAPT. JB # 17