




SHEAR WALL ELEVATION

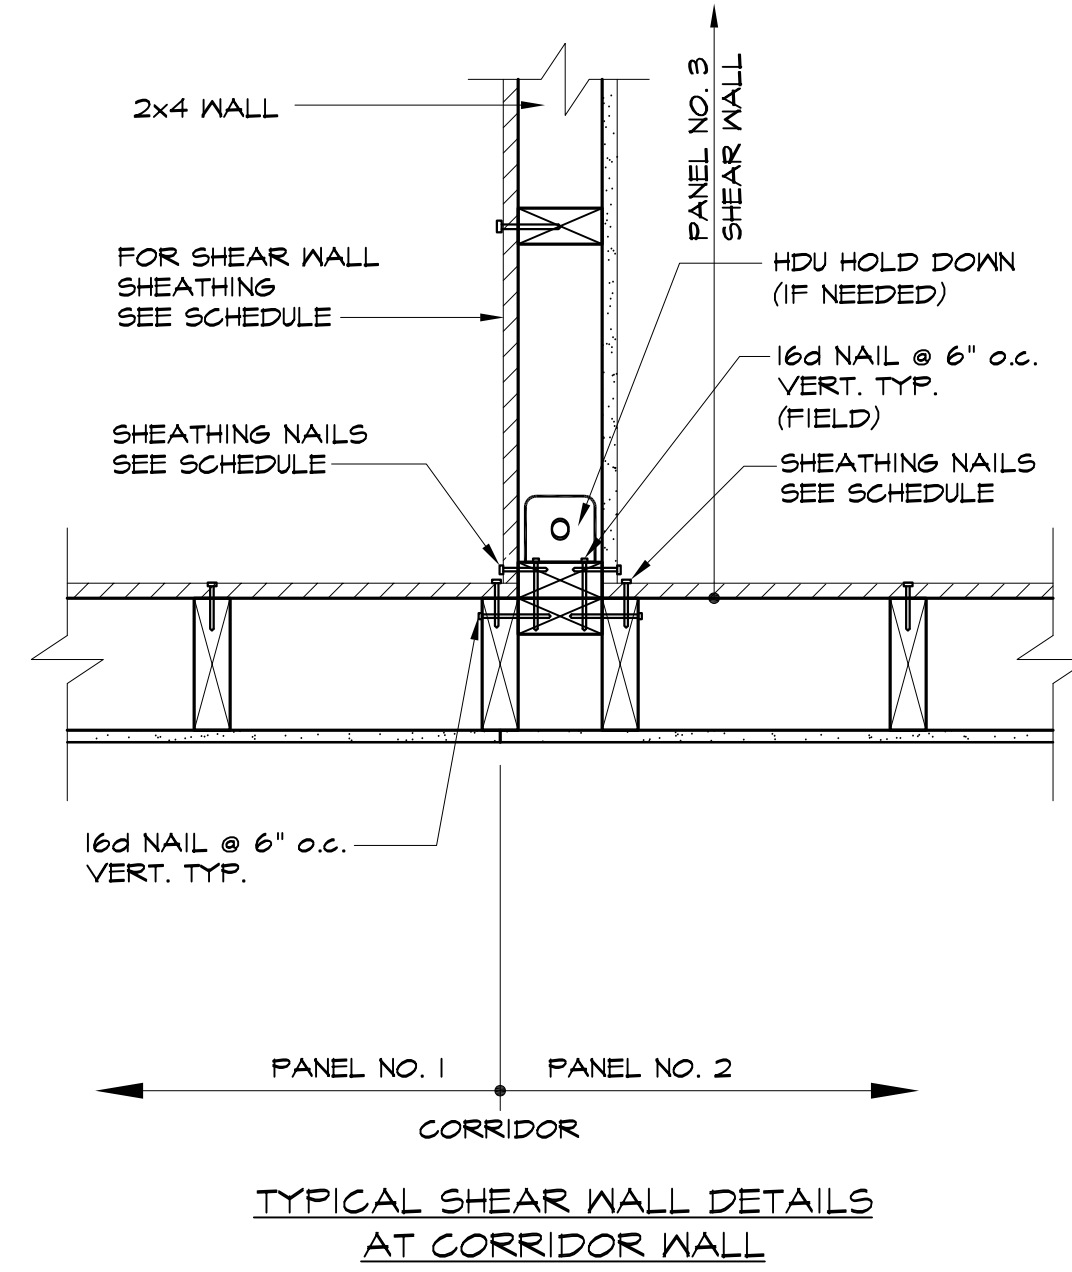


TYPICAL SHEAR WALL DETAILS AT CORRIDOR WALL

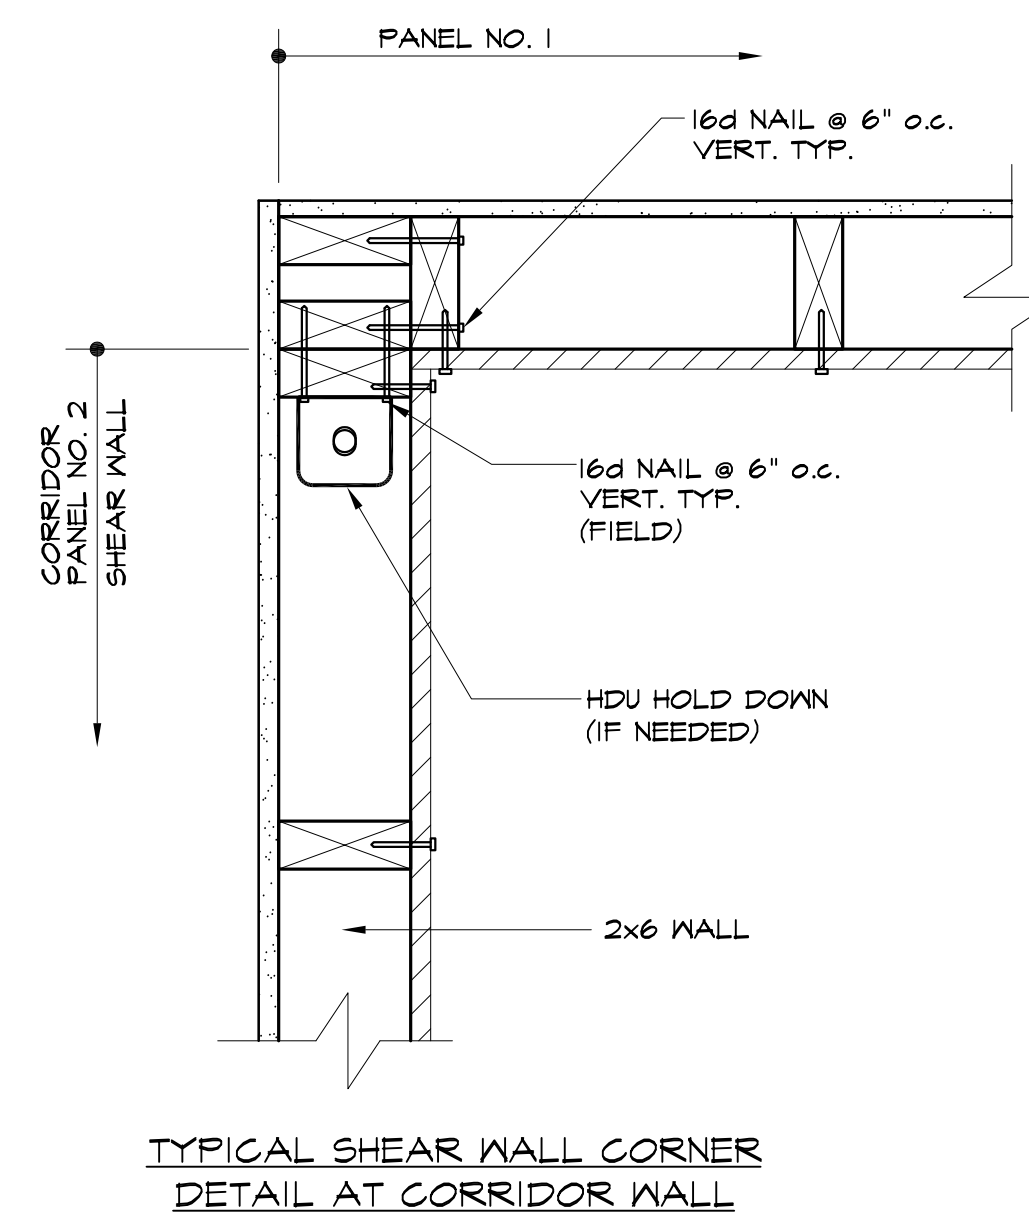


TYPICAL SHEAR WALL CORNER DETAIL AT CORRIDOR WALL

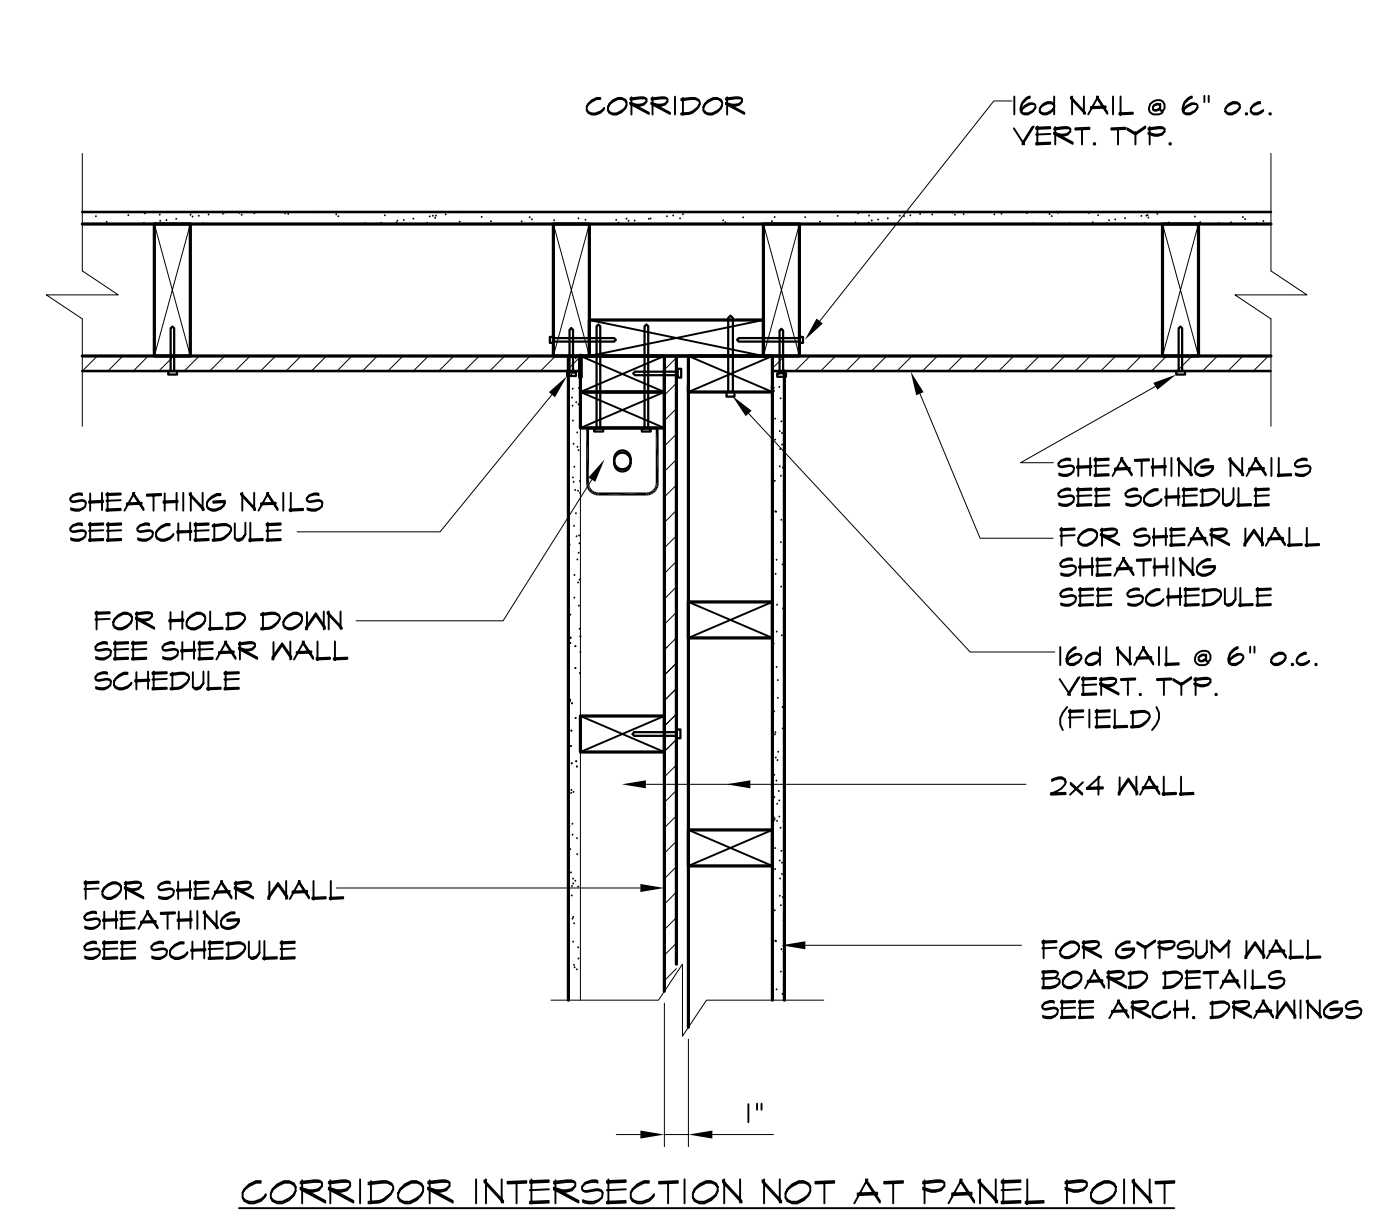


CORRIDOR INTERSECTION NOT AT PANEL POINT

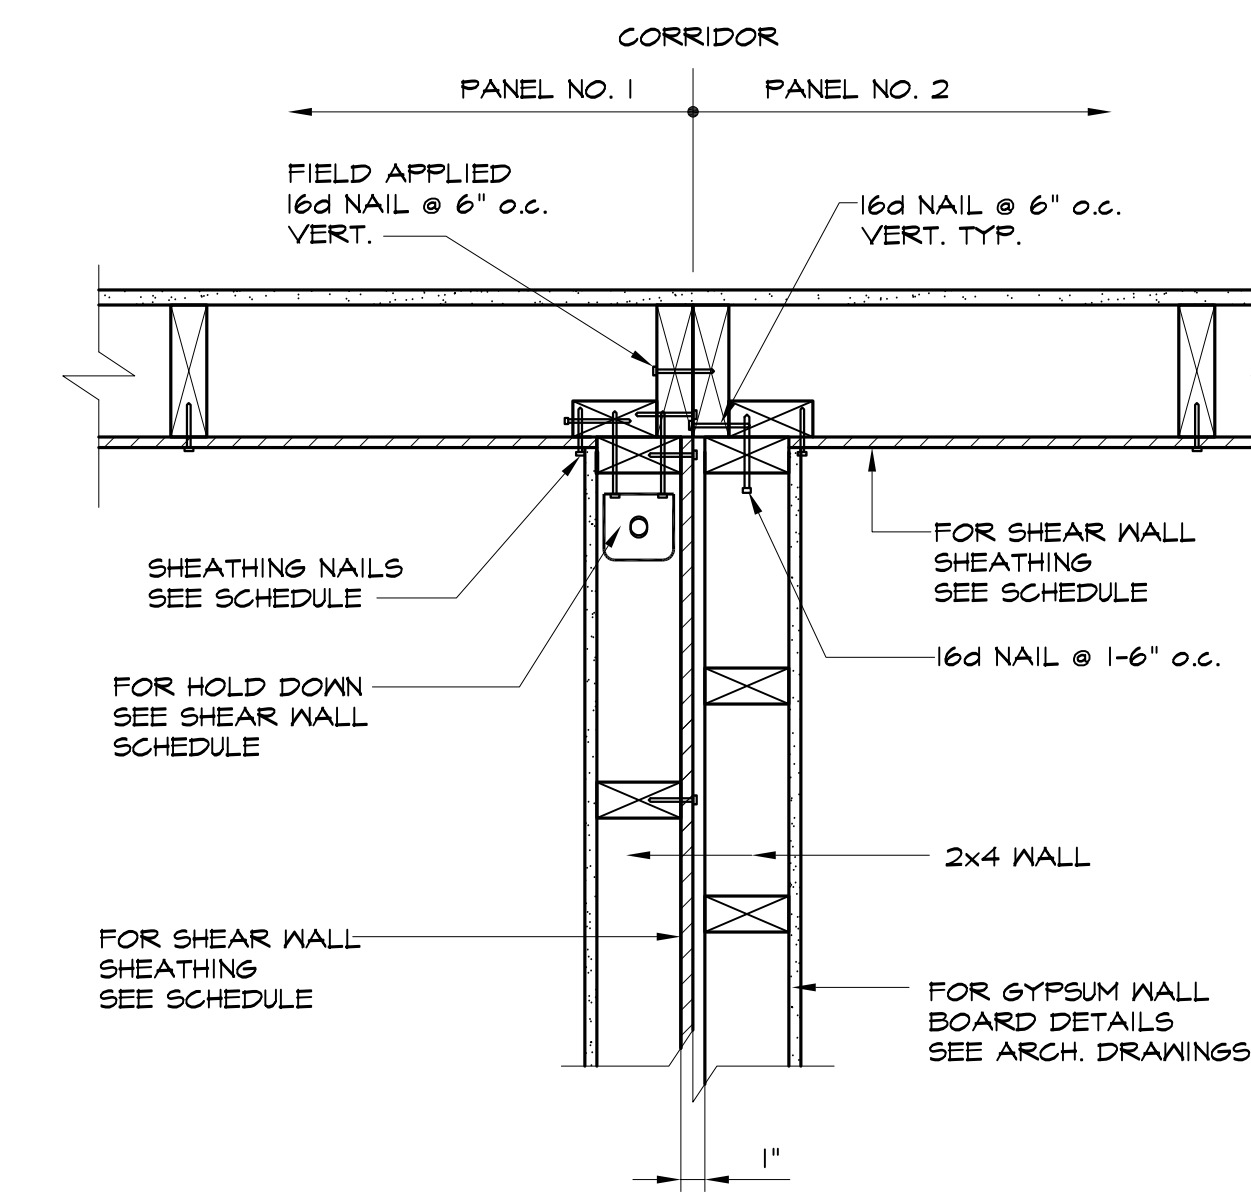


TYPICAL SHEAR WALL DETAIL AT DOUBLE WALL AT EXTERIOR WALL

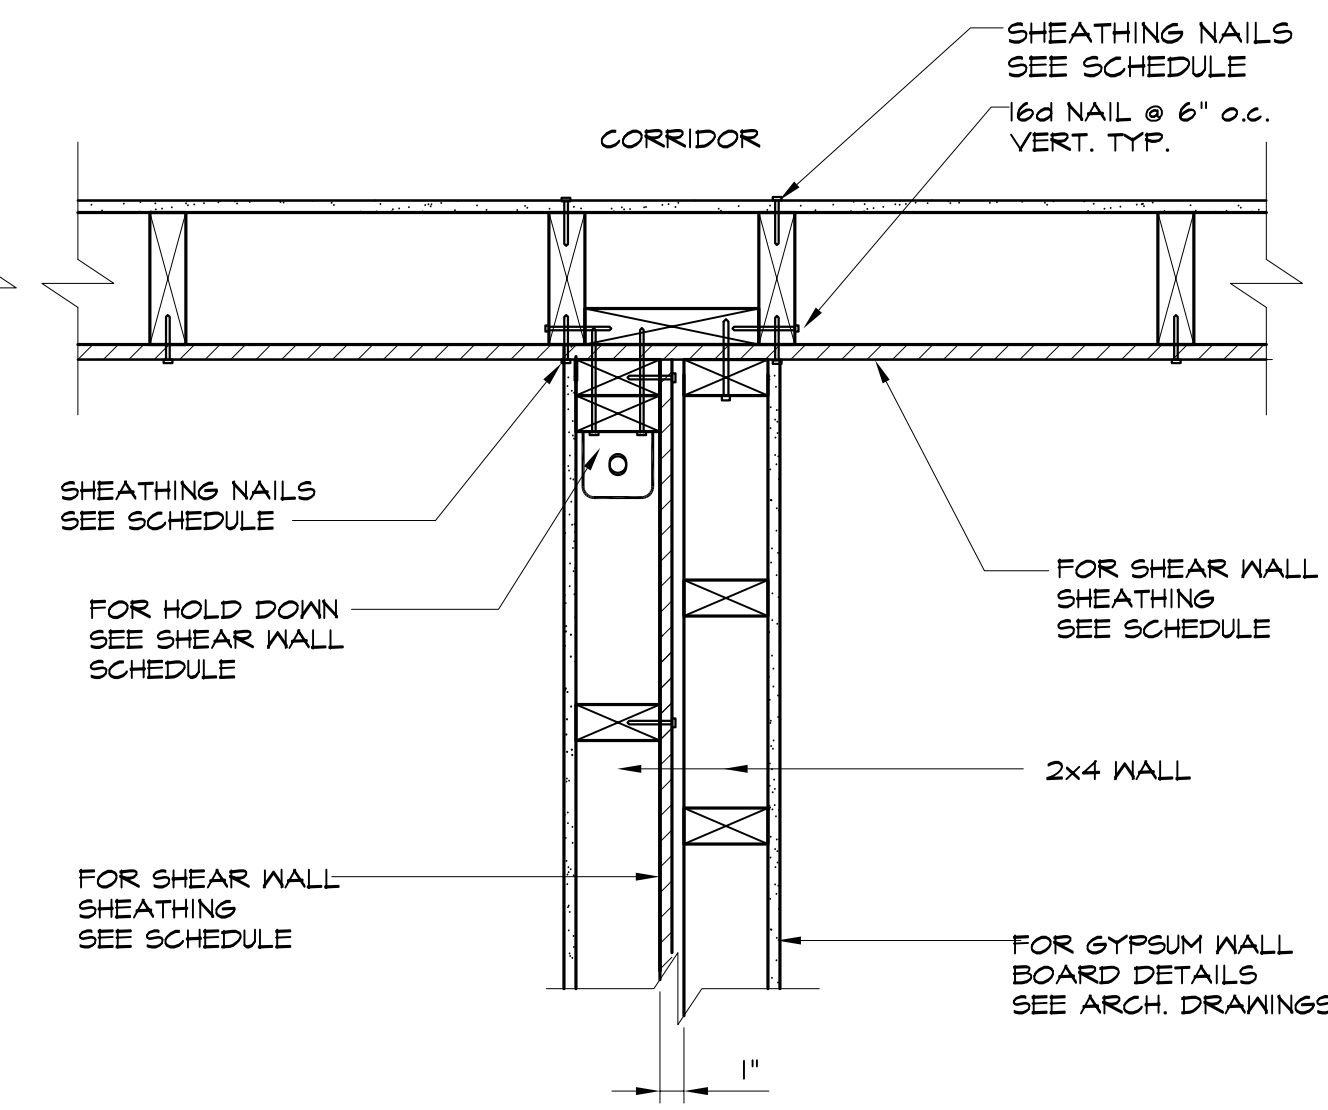


CORRIDOR INTERSECTION NOT AT PANEL POINT W/ OSB RUNNING THRU

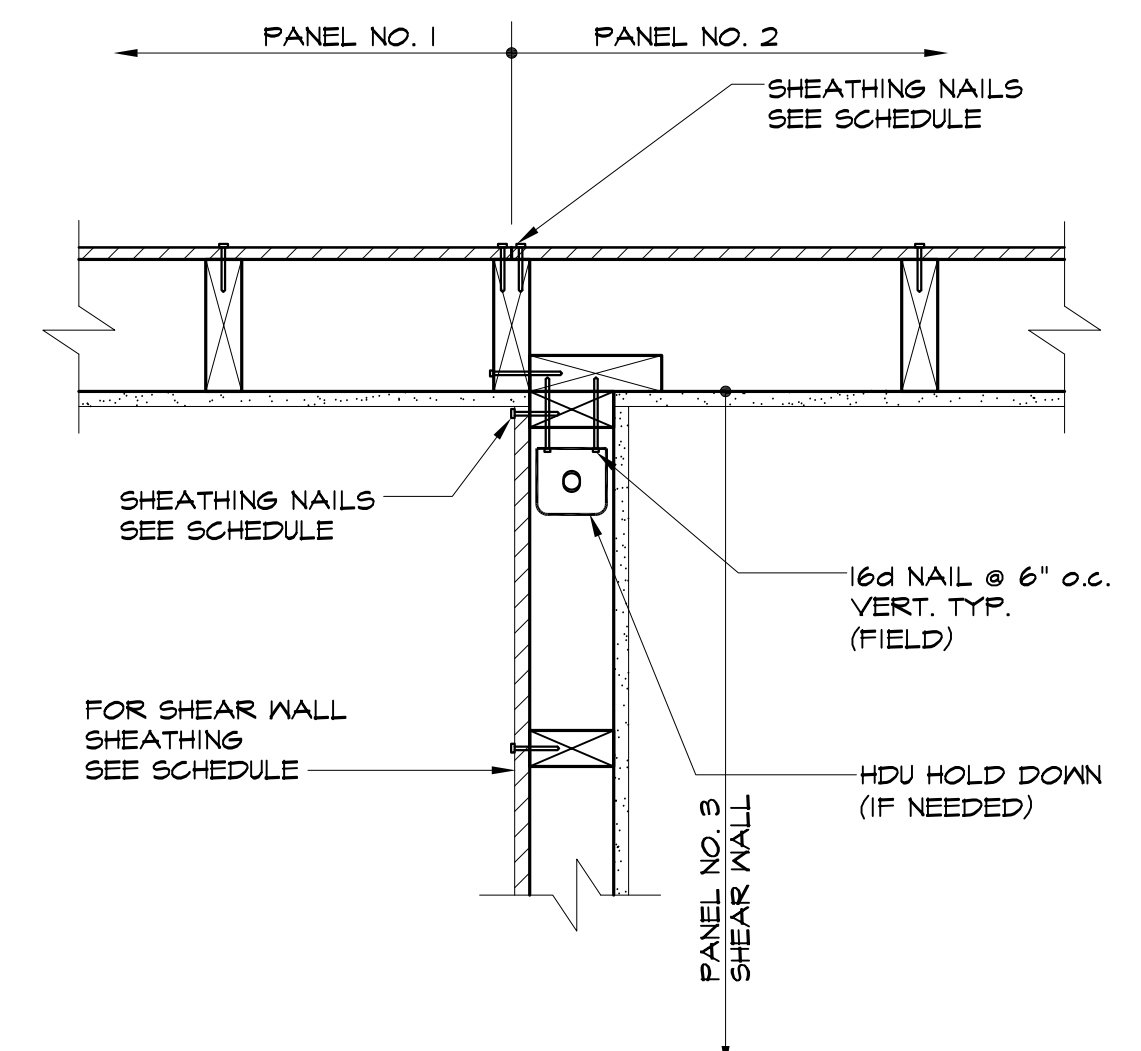

TYPICAL SHEAR WALL DETAILS AT EXTERIOR WALL

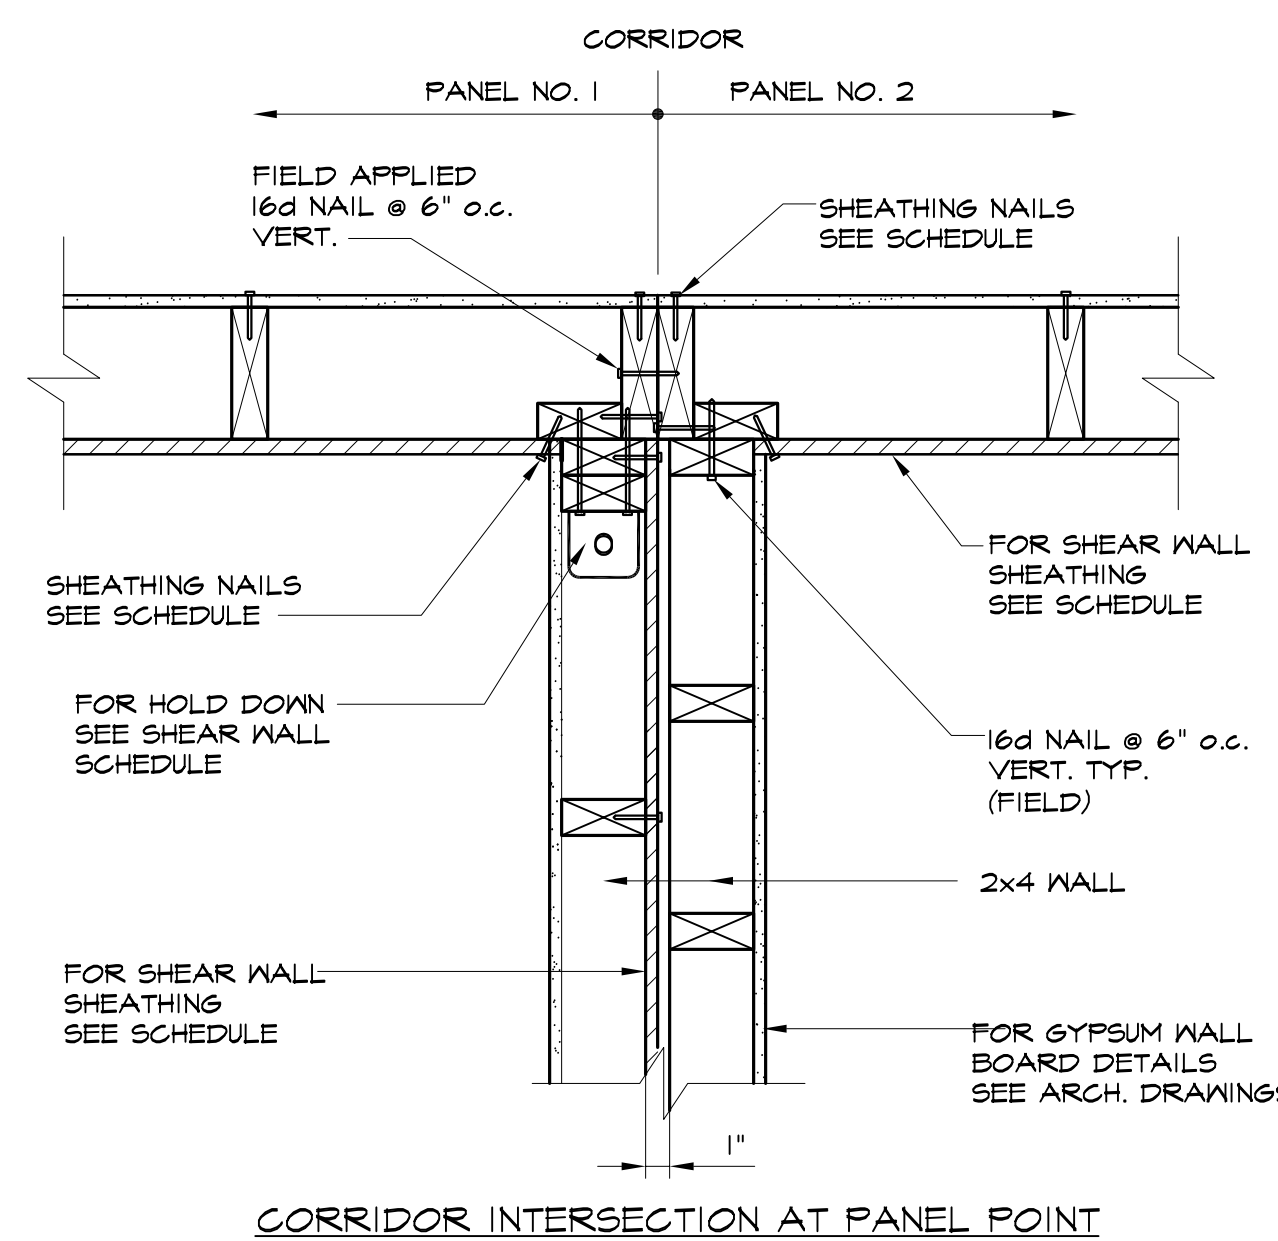


CORRIDOR INTERSECTION AT PANEL POINT

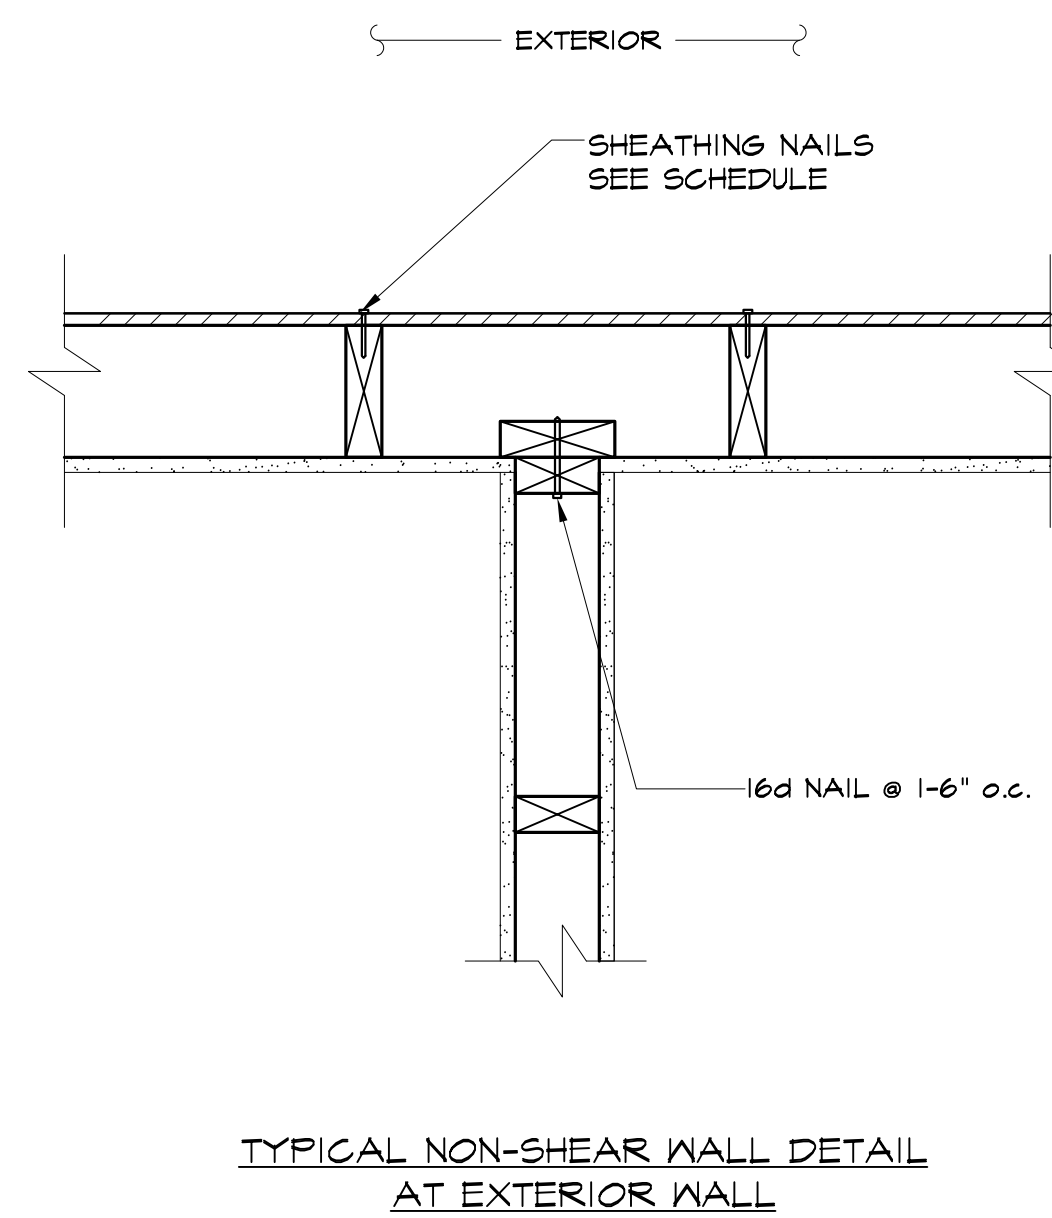

TYPICAL NON-SHEAR WALL DETAIL AT EXTERIOR WALL

NOTE:  
SHOP NAILS NOT SHOWN FOR CLARITY

- INDICATES FIELD APPLIED 16d NAIL @ 6" o.c. VERT.
- INDICATES FIELD APPLIED SHEATHING NAIL SEE SCHEDULE FOR

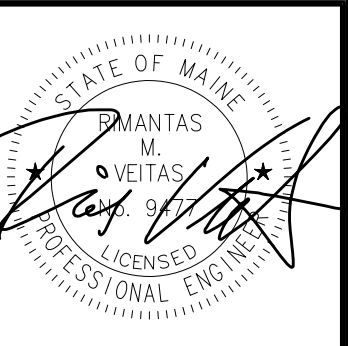

Prepared For:  
**118 on Munjoy Hill, LLC**  
118 CONGRESS STREET  
PORTLAND, ME 04101

Consultant:  
**VEITAS VEITAS** engineers  
620 Granite Street, Suite 10184  
Portland, ME 04101  
TEL: 754-2583 FAX: 754-2583-2005

Architect:  
**ARCHETYPE architects**  
48 Union Wharf Portland, Maine 04101  
(207) 772-6022 Fax (207) 772-4056

Project:  
**118 ON MUNJOY HILL**  
118 CONGRESS STREET  
PORTLAND, MAINE

Revisions:  
100% CONSTRUCTION DOCUMENTS

Date: 5 MAR 2014  
Scale: As indicated  
**Shear Wall Elevation & Shear Wall Details**

**S3.04**