

CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

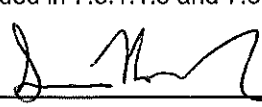
October 13, 2017


Responsible Party 1: Dyer Neck Development, LLC. 29 Kellogg Street, #3 Portland, ME 04101		
Location 29 KELLOGG ST	CBL 017 E026001	Inspection Date 9/19/2017
Inspector Robert Mcpartlan	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 10/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. Need apartment numbers on all units, front and back	<u>Oct/15/2017</u>
NFPA 101- 31.3.1.1.1 VERTICAL OPENINGS NOT FIRE RATED; Vertical openings shall be enclosed or protected in accordance with Section 8.6. Pipes and wiring running from the basement up the back staircase. Holes need to be fireproofed.	<u>Oct/15/2017</u>
NFPA 101- 7.5.1.1 EXIT OBSTRUCTED; Where exits are not immediately accessible from an open floor area, continuous passageways, aisles, or corridors leading directly to every exit shall be maintained and shall be arranged to provide access for each occupant to not less than two exits by separate ways of travel, unless otherwise provided in 7.5.1.1.3 and 7.5.1.1.4. Stairs and rear landing on the 3rd floor needs to be cleared. 	IMMEDIATELY remove all obstructions from the exits. Your signature below indicates that all obstructions have been removed and will not be replaced.
NFPA 101- 7.2.1.8.1 FIRE DOORS MUST BE SELF- OR AUTO-CLOSING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. Most of the doors are not self closing. Some need adjusting as they don't not close	<u>Dec/31/2017</u>

Violation	Proposed Date of Completion
<p>NFPA 10- 7.2.4.4 FIRE EXTINGUISHER INSPECTION TAG; Where manual inspections are conducted, records for manual inspections shall be kept on a tag or label attached to the fire extinguisher, on an inspection checklist maintained on file, or by an electronic method.</p> <p>2 loose extinguishers. 1 in basement by furnace and one on 2nd floor read landing. Need to be inspected and mounted.</p>	<p><u>05/15/17</u></p>
<p>NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6.</p> <p>No CO detectors found. Need one in each apartment. 3 total</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p> <p></p>
<p>NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers)</p> <p>Need domestic sprinkler protection over the boiler and gas water heater in basement.</p>	<p><u>Dec/31/17</u></p>
<p>NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour.</p> <p>First floor apartment door missing the fire rating tag. Replace the door or contact the Fire Prevention Bureau for options.</p>	<p><u>05/15/17</u></p>
<p>FINAL DATE OF COMPLETED VIOLATION(S)</p>	<p><u>Dec/31/17</u></p>
<p>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</p>	<p><u> / / </u></p>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

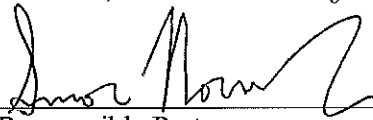
VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

Nov 1st 2017
Date


Responsible Party

Date

Responsible Party

SEEN AND AGREED

11/16/17
Date

CAPT. 
Fire Prevention Bureau

