- EXISTING SECOND FLOOR

CEILING FINISH VARIES

- GLAZING STOP INSTALLED

- NEW PORCELAIN TILE

WITH 1/2" DOUBLE SIDED

ASSEMBLY

- 2X BLOCKING

GLAZING TAPE

-2X6 HEADER

3 1/2"

5 3/4"

PAINTED WOOD PANEL AT SOFFIT -

LED RECESSED DOWNLIGHT -

CONSULTANTS:

- MINERAL WOOL INSULATION

- 2X6 CEILING/SOFFIT FRAMING

- 2X6 WALL FRAMING

PAINED WOOD PANELING

PAINED WOOD PANELING

DOOR

- ADA THRESHOLD

- EXISTING SUBFLOOR

- NEW ALUMINUM-CLAD WOOD ENTRY

- EXISTING FINISHED FLOORING

REVISIONS: No. Name Date

ISSUED FOR


PERMITTING ISSUED: 11/01/17 PROJECT No:

DRAWN BY: CHECKED BY:

SHEET TITLE: STOREFRONT SECTION

DETAILS

A622



EXISTING GRANITE STEP TO-

EXISTING BRICK SIDEWALK TO -

REMAIN

EXISTING GRANITE LINTEL -

EXISTING CAST IRON PILASTER -BEYOND

1" QUARTER ROUND GLAZING


STOP INSTALLED WITH 1/2" DOUBLE SIDED GLAZING TAPE

LED SPOT LIGHT FIXTURE FOR -

EXISTING CAST IRON PILASTER -

BEYOND

SIGN LIGHTING

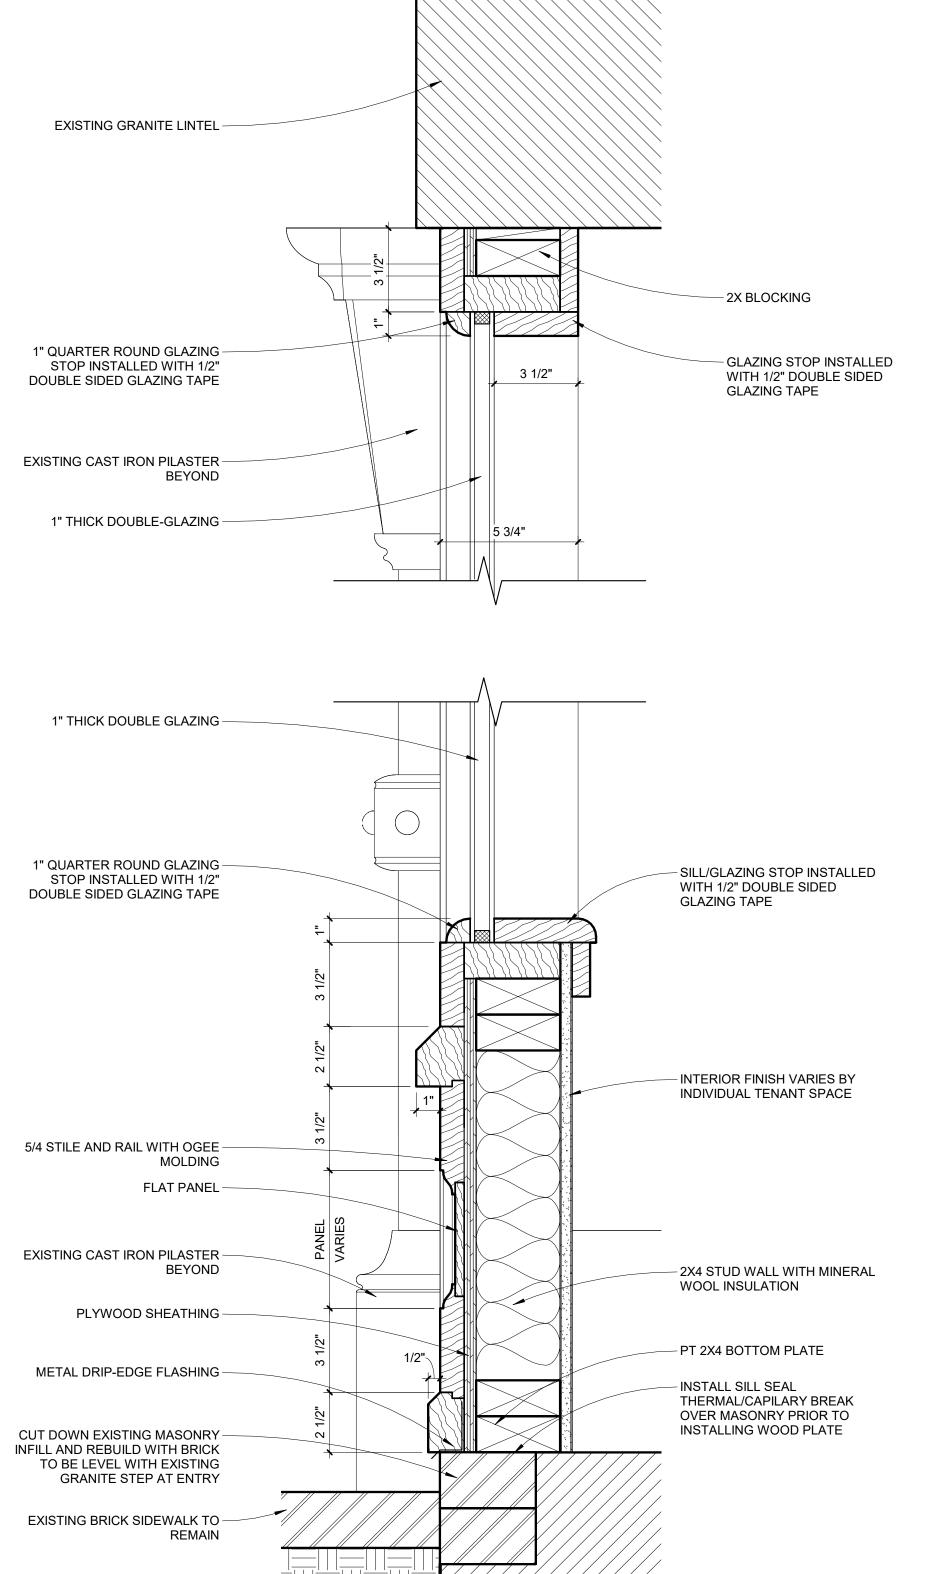

1 CUSTOM WOOD STOREFRONT AND PANEL SECTION 3" = 1'-0"

