


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

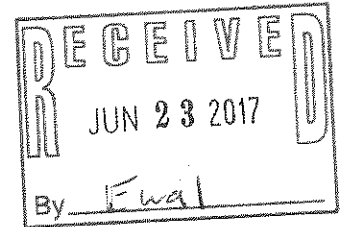

NOTICE OF VIOLATION AND ORDER TO CORRECT

May 4, 2017

| | | |
|---|---|-------------------------------------|
| Responsible Party 1: J & P LLC 250 HIGH ST PORTLAND, ME 04101 | | |
| Location 250 HIGH ST | CBL 036 D021001 | Inspection Date 4/19/2017 |
| Inspector Daniel Thompson | Inspection Type FP Routine Inspection | Status Failed |

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 5/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

| Violation | Proposed Date of Completion |
|---|-----------------------------|
| NFPA 101- 31.3.1.1.1 VERTICAL OPENINGS NOT FIRE RATED; Vertical openings shall be enclosed or protected in accordance with Section 8.6. third floor apt rear exit through a "storage area" vent in roof | <u>8 / 24 / 17</u> |
| NFPA 101- 31.3.3.2 INTERIOR FINISH; Interior wall and ceiling finish materials complying with 10.2 shall be permitted as follows: (1) Exit enclosures- Class A or B (2) Lobbies and corridors- Class A or B (3) Other Spaces- Class A, B, or C. untreated wood paneling in rear stairwell | |
| NFPA 101-7.9.3 EMERGENCY LIGHTS REQUIRE MAINTENANCE; 7.9.3 Periodic Testing of Emergency Equipment 7.9.3.1 Required emergency lighting systems shall be tested in accordance with one of the three options offered by 7.9.3.1.1, 7.9.3.1.2, or 7.9.3.1.3. 7.9.3.1.1 Testing of required emergency lighting systems shall be permitted to be conducted as follows: (1) Functional testing shall be conducted monthly with a minimum of 3 weeks and a maximum of 5 weeks between tests, for not less than 30 seconds, except as otherwise permitted by 7.9.3.1.1(2). (2) The test interval shall be permitted to be extended beyond 30 days with the approval of the authority having jurisdiction. (3) Functional testing shall be conducted annually for a minimum 1-1/2 hours if the emergency lighting system is battery powered. (4) The emergency lighting equipment shall be fully operational for the duration of the test required by 7.9.3.1.1(1) and (3). (5) Written records of visual inspections and tests shall be kept by the owner for inspection by the authority having jurisdiction. no battery backup e-lights | <u>8 / 24 / 17</u> |

| Violation | Proposed Date of Completion |
|---|---|
| <p>NFPA 101- 7.5.1.1 EXIT OBSTRUCTED; Where exits are not immediately accessible from an open floor area, continuous passageways, aisles, or corridors leading directly to every exit shall be maintained and shall be arranged to provide access for each occupant to not less than two exits by separate ways of travel, unless otherwise provided in 7.5.1.1.3 and 7.5.1.1.4. front and rear stairwells used for storage, unused furniture blocking hallway</p> | <p>IMMEDIATELY remove all obstructions from the exits. Your signature below indicates that all obstructions have been removed and will not be replaced.</p> |
| <p>NFPA 101- 31.2.2.1.2 EXIT STAIR REQ 60-MIN FIRE DOORS - NON-HIGH-RISE; In buildings using Option 4, exit enclosures shall have a minimum 1-hour fire resistance rating, and doors shall have a minimum 1-hour fire protection rating.</p> | <p>8 / 24 / 18</p> |
| <p>NFPA 101- 7.2.2.1.1 STAIRS REQUIRE REPAIR; Stairs shall meet the following criteria: (1) New stairs shall be in accordance with Table 7.2.2.2.1.1(a) (2) Existing stairs shall be permitted to remain in use, provided that they meet the requirements for existing stairs shown in Table 7.2.2.2.1.1(b) (3) Approved existing stairs shall be permitted to be rebuilt in accordance with the following: (a) dimensional criteria of table 7.2.2.2.1.1(b) and other stair requirements of 7.2.2 (4) The requirements for new and existing stairs shall not apply to stairs located in industrial equipment access areas where otherwise provided in 40.2.5.2. third floor interior rear stairs are in disrepair, all exterior stairs are in need of repair (front and both sides)</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 13 INCOMPLETE SPRINKLER COVERAGE; Refer to NFPA 13. no sprinkler on hot water heater</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. front stairwell storage under stairs</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 101- 7.2.1.8.1 FIRE DOOR BLOCKED OPEN; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. front door</p> | <p>IMMEDIATELY remove all blocks or chocks from fire doors, ensuring that they close fully. Your signature below indicates that all fire doors are fully closed and will not be blocked open in the future.</p> |
| <p>NFPA 70- ARTICLE 110 B CERTIFY ELECTRICAL SYSTEM; Listed or labeled equipment shall be installed and used in accordance with any instructions included in the listing or labeling. Entire electrical system needs to be looked at. recent upgrade to electrical system exterior and panel, interior has multiple exposed wires including a 50 amp cable running under a carpet to an unknown location on third floor rear "storage area"</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 70 MISSING BOX COVERS; Refer to NFPA 70, National Electrical Code, on standards for missing box covers. most in basement are without, third floor exit has open outlets</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) none on hot water heater in basement</p> | <p>8 / 24 / 17</p> |
| <p>NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. multiple units without fire doors front and rear.</p> | <p>8 / 24 / 18</p> |

| Violation | Proposed Date of Completion |
|--|-----------------------------|
| FINAL DATE OF COMPLETED VIOLATION(S) | 8 / 24 / 17 |
| FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S) | _ / _ / _ |

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

6/23/17 _____
 Date Responsible Party

 Date Responsible Party

SEEN AND AGREED

7 July 2017 _____
 Date Fire Prevention Bureau

