


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

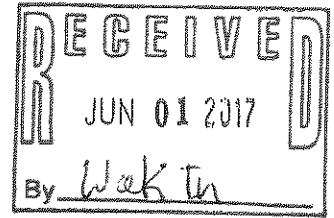

NOTICE OF VIOLATION AND ORDER TO CORRECT

May 8, 2017

Responsible Party 1: Cekutis Steven 20 SUMMER ST # 1 PORTLAND , ME 04102		
Location 20 SUMMER ST	CBL 058 D003001	Inspection Date 4/26/2017
Inspector Curtis Magnuson	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 5/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101- 8.3.5 HOLE IN WALL NEEDS REPAIR; The provisions of 8.3.5 shall govern the materials and methods of construction used to protect through-penetrations and membrane penetrations in fire walls, fire barrier walls, and fire resistance-rated horizontal assemblies. The provisions of 8.3.5 shall not apply to approved existing materials and methods of construction used to protect existing through-penetrations and existing membrane penetrations in fire walls, fire barrier walls, or fire resistance-rated horizontal assemblies, unless otherwise required by chapters 11 through 43. Rear stairwell on the second floor.	8-31-17
N.F.P.A. 101 CHP. 31.3.3.2 HOLE IN CEILING NEEDS REPAIR; InteriorWall and Ceiling Finish Interior walls and ceiling finish materials complying with 10.2 shall be permitted as follows: 1) Exit encloures -- Class A or class B 2) Lobbies and corridors--Class A or Class B 3) Other spaces Class A, orClass B, or Class C Rear stairwell outside 1st floor apartment and second floor	8-31-17
NFPA 80- ANNEX D.4 1-HOUR FIRE DOORS ASSEMBLIES REQ; Listings are provided for floor fire door assemblies that are installed in fire-rated floor-ceiling or roof-ceiling assemblies that have been tested in accordance with the methods described in NFPA 288. The listing indicates the fire-rated assembly and the hourly rating (3 hours, 2 hours, 1.5 hours, 1 hour, .75 hours) for which the door can be permitted to be used so that access to the space above the ceiling or to the floor above can be provided without adversely affecting the fire resistance rating of the entire assembly. The listing provides limitations on the maximum size of an individual door opening and the total area of all door openings permitted for each 100 square feet of floor or ceiling. Basement door.	8-31-18

Violation	Proposed Date of Completion
<p>NFPA 80- ANNEX D.4 1-HOUR FIRE DOORS ASSEMBLIES REQ; Listings are provided for floor fire door assemblies that are installed in fire-rated floor-ceiling or roof-ceiling assemblies that have been tested in accordance with the methods described in NFPA 288. The listing indicates the fire-rated assembly and the hourly rating (3 hours, 2 hours, 1.5 hours, 1 hour, .75 hours) for which the door can be permitted to be used so that access to the space above the ceiling or to the floor above can be provided without adversely affecting the fire resistance rating of the entire assembly. The listing provides limitations on the maximum size of an individual door opening and the total area of all door openings permitted for each 100 square feet of floor or ceiling.</p> <p>The entry doors to each unit need to be 1 hour rated fire doors with self closures. All the doors, except the front door to unit #1, are not tagged as fire rated doors. Need proof of the doors fire rating or certification by a third party. Based on the condition and size of the door jambs they will be allowed. Also the front door to unit #2 has a gap at the top which is not allowed.</p>	8-31-18
FINAL DATE OF COMPLETED VIOLATION(S)	8/31/18
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	9/3/18

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

Date
5-30-17

Responsible Party
Steven L. CeKatis

Date

Responsible Party *Steven L. CeKatis*

SEEN AND AGREED

Date

Fire Prevention Bureau