MATERIALS/APPLICATION

- A WHITE 3M #7725-10 vinyl graphics.
- B. Apply all vinyl with the exception of the handicap symbol of accessibility on second surface when glass is clear to medium tint
- C. Apply vinyls on first surface when glass is dark tinted.
- D. Typeface is to be Franklin-Gothic-Demi-Condensed. Use only this font. Substitute fonts are not allowed.
- E. Note: Hours information to be verified with the Branch Manager.


 All optional information must be provided through inspection of site from technical audit
- F. Preferred position of 13' x 12' Acrylic Holder.
- Holder by others on second surface of opposite door across from hours decals, as shown
- G. Handicap symbol to be reverse silkscreened blue field on white 3M #7725-10 vinyl. Symbol of accessibility to reverse out white. Use UV inks manufactured by Sericol or approved equal. Blue field to match PMS 7462C, finish to meet 70% gloss ADA compliance requirements. When required, always apply handicap vinyl to exterior of plass

VINYLS: (Always refer to State-specific pages to check for regional layouts or copy.)

- 1. Inline Signature format Always use Master Brand.
- 2. Lobby Hours Always use. Maintain flush left alignment of days and flush right alignment of hours information as shown.

- 3. ATA Copy Always use if applicable. Maintain flush left alignment
- of days and flush right alignment of hours information as shown.
- 4. 'Also visit the ATM, bankofamerica.com and www.bofa.mobi'- Always use.
- 5. Non-employees may not solicit or distribute materials Always use.
- 6. Handicap symbol Use only on accessible entrance doors. For non accessible entrances see sheets 19 and 20. Single handicap symbol alone should be used to denote a handicap entrance.
- 7. No Smoking symbol -Always use.
- 8. 'NO PETS PLEASE' Always use.
- 9. ATM location information If ATM redirect copy exists remove only- do not
- 10. 'NOTICE: This facility may be used only to transact banking business.
- NO TRESPASSING. Police take notice.' Always use.
- 11. 'In case of emergency, contact Bank of America Security 1-800-222-7511' Always use

NOTE: If entry door crash bar or other obstructions are on the front of the door, space copy above or below as required. Provide a minimum space of 1" above and 2" below the obstruction or crash bar. Maintain a minimum of 4' above bottom mullion. If there is not enough space to apply necessary copy, convert to a door plaque. Placement of crash bar and dimensions of bottom mullion are shown in example only, field verify exact conditions prior to fabrication.

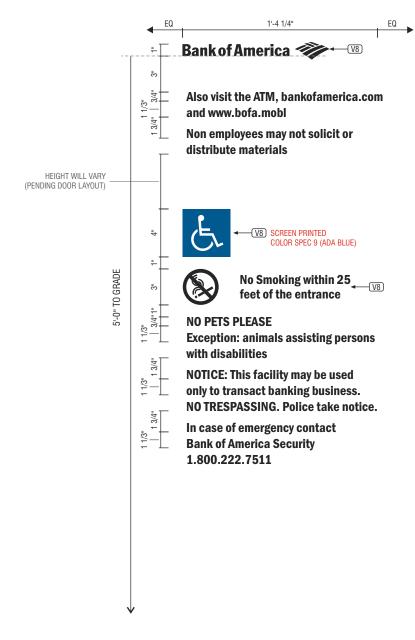

2 DOOR VINYL - 24 HOUR ATM

QTY: 1 FIRST SURFACE APPLICATION SCALE: 1 1/2"=1'-0"



RECOMMEN	Drawing prepared for:			
Location:	Proj #:	 Bank of America 		
500 Forest Ave	4305	- Dalik VI Alliel Ica		
Portland, ME	Loc #:			
File Path:	4101			

Rev #:	Req#:	Date:	Req. By:	Drawn By:	Revision Description: Drawings are the exclusive property of ICON,. Any unauthorized use or duplication is not permitted.						
Original		04/21/15		MM							
	210197	05/12/15	SD	MM	See Request		Rev #:	Req#:	Date:	Req. By:	Drawn By:
Rev 1	211022	05/20/15	SD	NLR	Sign 1: Revised to K1 Le	tterset; Vinyl Updated	Rev 7	000000	00/00/00	XXX	XXX
Rev 3	000000	00/00/00	XXX	XXX			Rev 8	000000	00/00/00	XXX	XXX
Rev 4	000000	00/00/00	XXX	XXX			Rev 9	000000	00/00/00	XXX	XXX
Rev 5	000000	00/00/00	XXX	XXX			Rev 10	000000	00/00/00	XXX	XXX
Rev 6	000000	00/00/00	XXX	XXX							Pg. 6