


Frame Member Schedule								
Part	Mem	Width	Thick	WebThk.	Depth1	Depth2	Approx.Lgth	Approx.Weight
CX007	1	6.0000	.3125	.1345	1'-0"	2'-0"	23'-2 5/8"	555#
RBX007	2	5.0000	.3125	.1345	1'-11"	1'-1"	20'-5 1/16"	391#
	3	5.0000	.2500	.1345	1'-1"	1'-11"		
RBX008	4	5.0000	.2500	.1345	1'-11"	1'-1"	23'-10 5/8"	483#
	5	5.0000	.3125	.1345	1'-1"	1'-11"		
CX008	6	5.0000	.3125	.1345	1'-0"	2'-1"	19'-5 7/8"	407#

Bolt Connection & Plate Schedule								
Id	Qty	Grade	Bolt	Bolt	Plate	Rows	Rows	PartNo
			Dia.	Length	Thick.	Out	In	
A	10	A325	3/4"	2 1/2"	1/2"	3	2	0097284
B	6	A325	3/4"	2 1/2"	3/8"	1	2	0097284
C	8	A325	3/4"	2 1/2"	1/2"	2	2	0097284

Frame Clearances  
 Horiz. Clearance between members 1(CX007) and 6(CX008): 41'-6"  
 Vert. Clearance at member 1(CX007): 20'-11 7/8"  
 Vert. Clearance at member 6(CX008): 19'-5 7/8"  
 Finished Floor Elevation = 100'-0" (Unless Noted Otherwise)

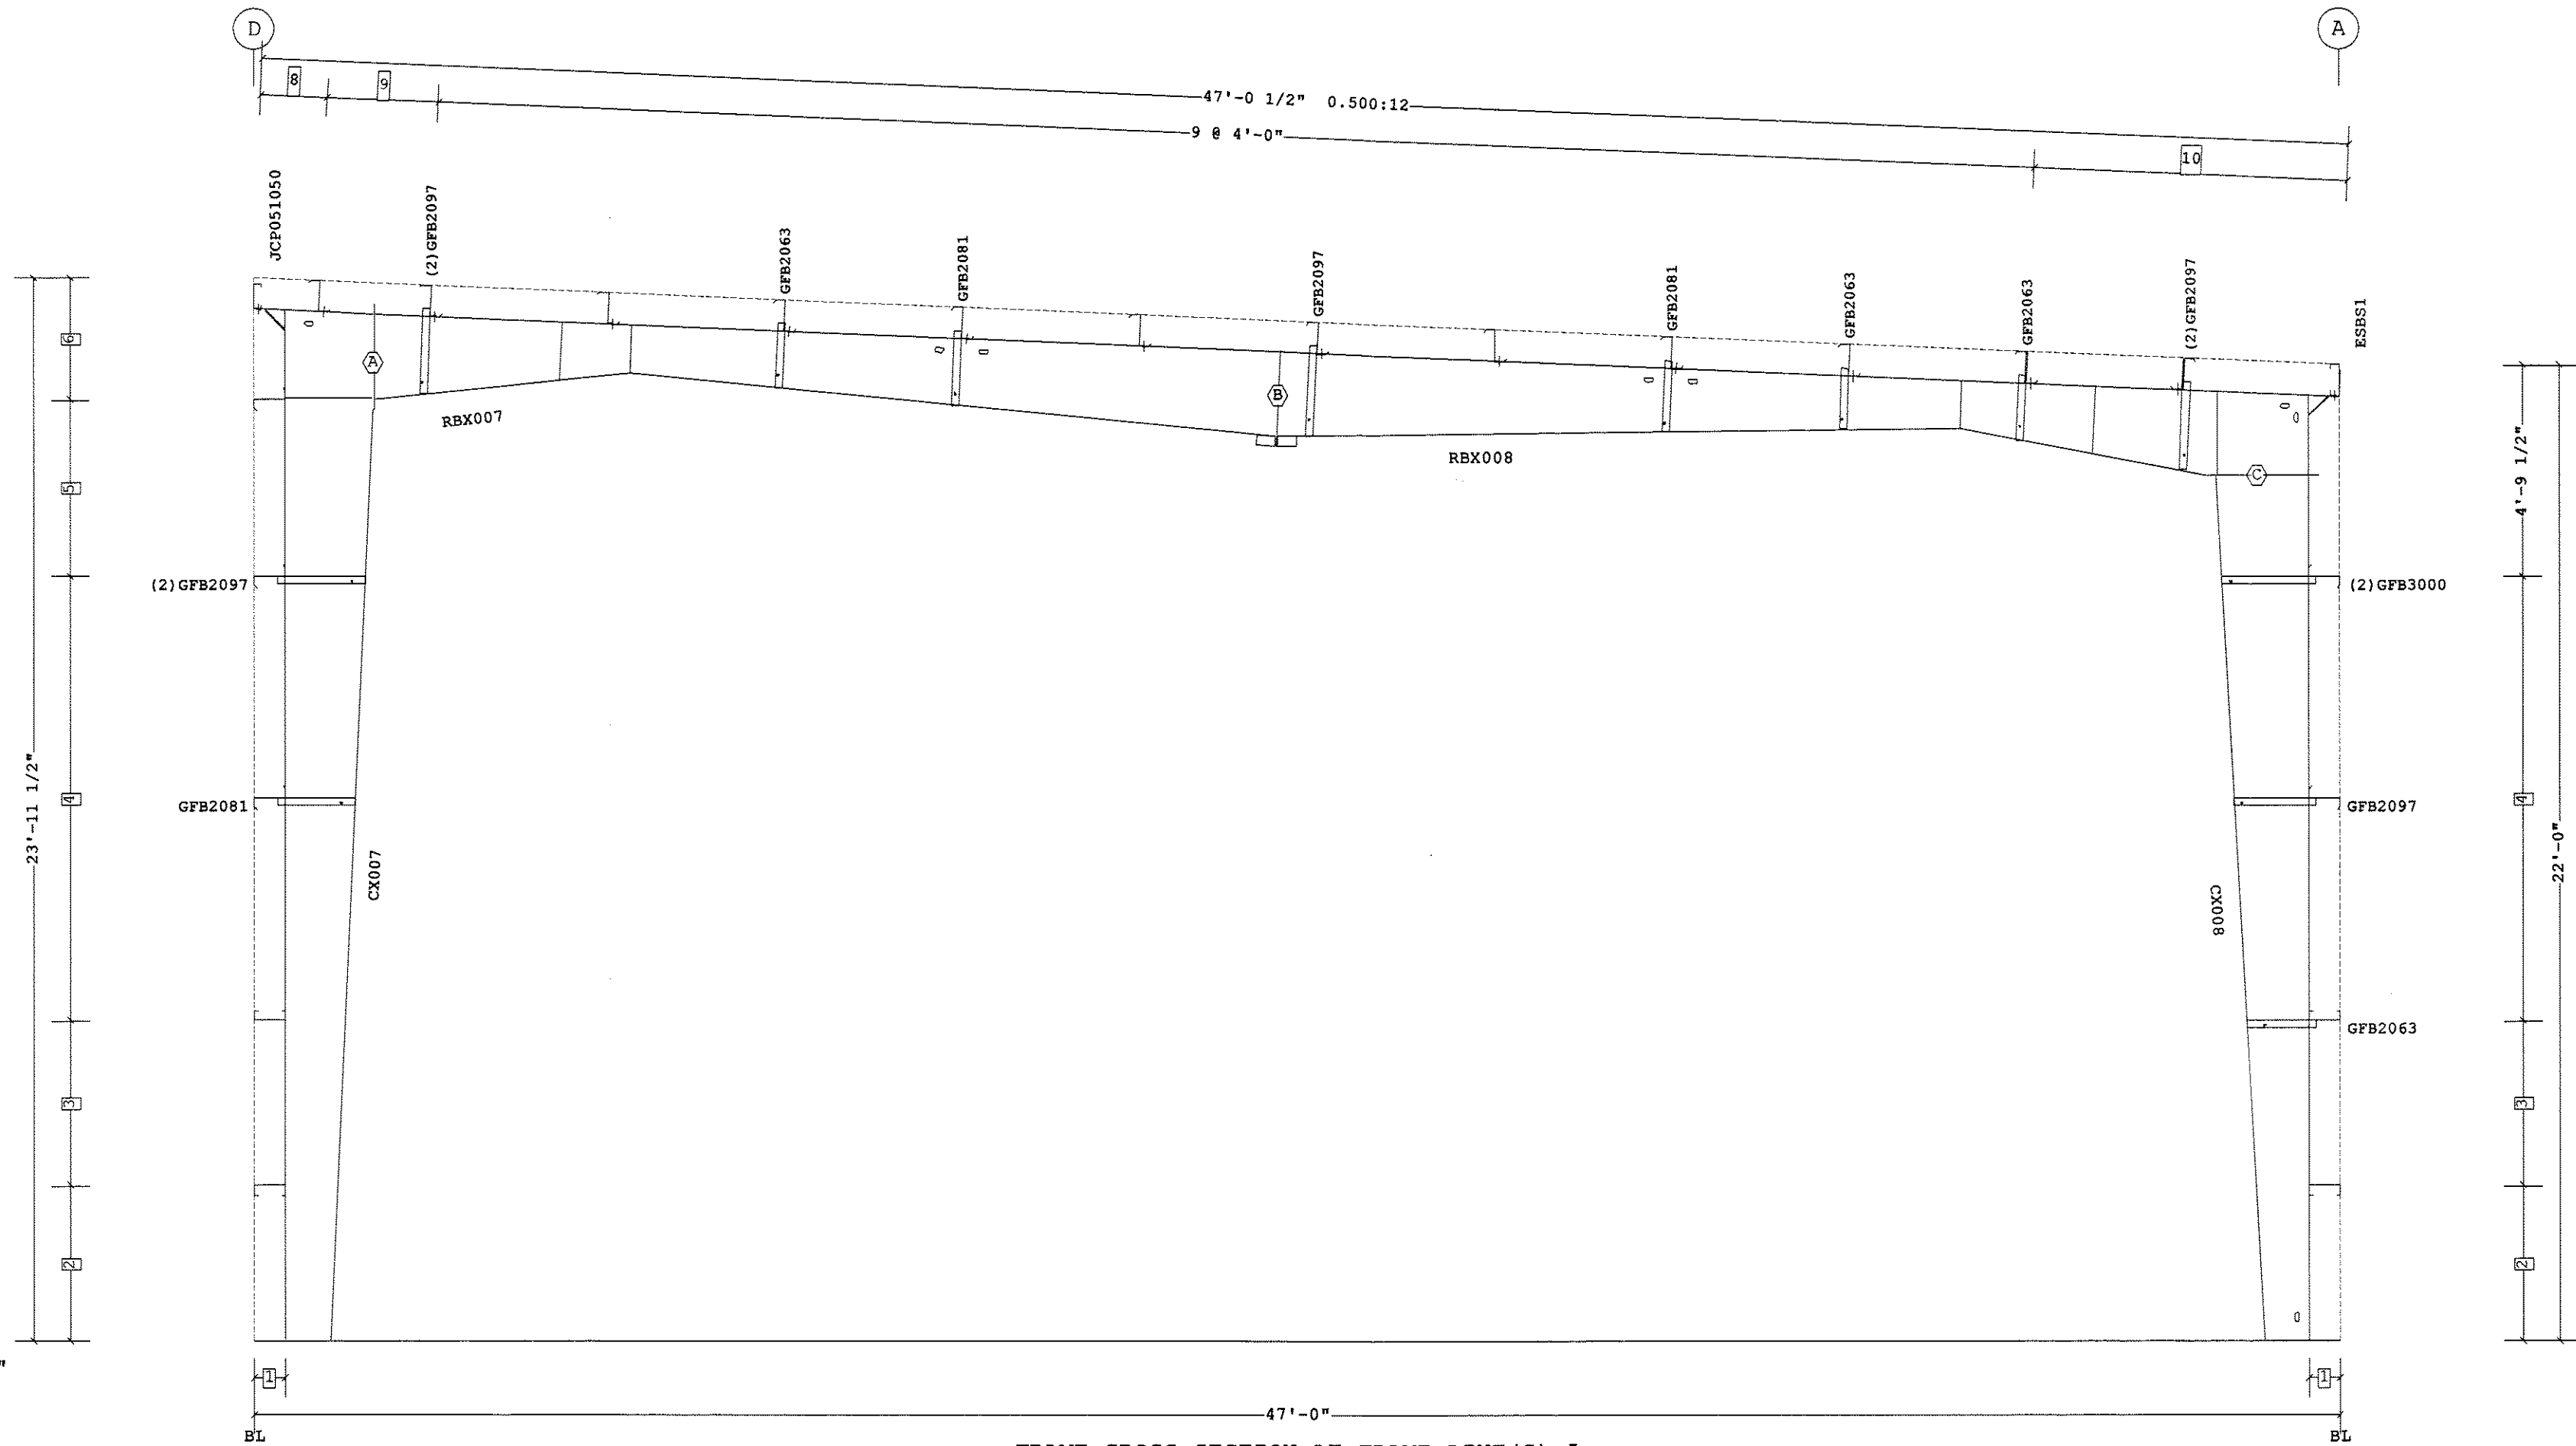

- 10 2 @ 3'-6 1/4"
  - 9 2'-6"
  - 8 1'-6"
  - 7 0'-0"
  - 6 2'-9"
  - 5 4'-0"
  - 4 2 @ 5'-0"
  - 3 3'-8 1/2"
  - 2 3'-6"
  - 1 8 1/2"
- Dimension Key

FRAME CROSS SECTION AT FRAME LINE(S) 5

Shape Name = Pack Edge Wall 4, Frame 4

1. USE 1/2 X 1 1/2 A325 SNUG TIGHTENED BOLTS FOR ALL SECONDARY CONNECTIONS, SECONDARY CLIP CONNECTIONS, AND FLANGE BRACE CONNECTIONS, UNLESS NOTED OTHERWISE.  
 2. SLOT REINFORCEMENT PLATES NEED NOT BE LOCATED ON THE SAME SIDE OF THE WEB AS THE HILLSIDE WASHER.

THE VP ENGINEER'S SEAL APPLIES ONLY TO THE WORK PRODUCT OF VP AND DESIGN AND PERFORMANCE REQUIREMENTS SPECIFIED BY VP. THE VP ENGINEER'S SEAL DOES NOT APPLY TO THE PERFORMANCE OR DESIGN OF ANY OTHER PRODUCT OR COMPONENT FURNISHED BY VP EXCEPT TO ANY DESIGN OR PERFORMANCE REQUIREMENTS SPECIFIED BY VP.

THIS DRAWING, INCLUDING THE INFORMATION HEREON, REMAINS THE PROPERTY OF VP BUILDINGS. IT IS PROVIDED SOLELY FOR ERECTING THE BUILDING DESCRIBED IN THE APPLICABLE PURCHASE ORDER AND SHALL NOT BE MODIFIED, REPRODUCED OR USED FOR ANY OTHER PURPOSE WITHOUT PRIOR WRITTEN APPROVAL OF VP BUILDINGS.

THE GENERAL CONTRACTOR AND/OR ERECTOR IS SOLELY RESPONSIBLE FOR ACCURATE GOOD QUALITY WORKMANSHIP IN ERECTING THIS BUILDING IN ACCORDANCE WITH THIS DRAWING, DETAILS REFERENCED IN THIS DRAWING, ALL APPLICABLE VP BUILDINGS ERECTION GUIDES, AND INDUSTRY STANDARDS PERTAINING TO PROPER ERECTION, INCLUDING THE CORRECT USE OF TEMPORARY BRACING.

VP Buildings				FRAME CROSS SECTION AT FRAME LINE(S) 5	
3200 Players Club Circle Memphis TN 38125				BUILDER	Patco
REV	DATE	BY	DESCRIPTION	CUSTOMER	12-4084
				LOCATION	3/14/2013
				PROJECT	DRAWN/CHECK
				BUILDERS POW	COOP DC
					PAGE
					9