


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

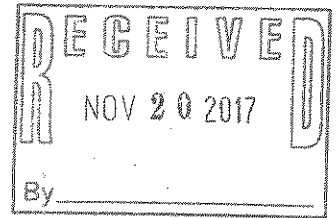

NOTICE OF VIOLATION AND ORDER TO CORRECT

October 25, 2017

Responsible Party 1: Winslow Laurie 137 ALLEN AVE PORTLAND, ME 04103		
Location 137 ALLEN AVE	CBL 436 A019001	Inspection Date 9/21/2017
Inspector Mark Stewart	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 11/15/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. Units need numbers.	11/24/17
NFPA 101- 7.2.2.4.1.1 STAIRS SHALL HAVE HANDRAILS; Stairs and ramps shall have handrails on both sides, unless otherwise permitted in 7.2.2.4.1.5 or 7.2.2.4.1.6. Stairs in rear stairwell need railings.	2/1/18
NFPA 101- 7.2.2.4.1.6 STAIRS WITH IN UNITS NEED HANDRAILS; Existing stairs, existing ramps, stairs within dwelling units and within guest rooms, and ramps within dwelling units and guest rooms shall be permitted to have a handrail on one side only. Stairs to third floor in Unit #139 need railings.	2/1/18
NFPA 101- 31.3.6.2.3 DOORS SHALL BE SELF-CLOSING & SELF-LATCHING; Doors that open onto exit access corridors shall be self-closing and self-latching. Check all fire doors to ensure the self close and latch.	11/30/17
NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY; NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OR OTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FT OF ANY STRUCTURE Grill on rear deck must be removed.	11/30/17
NFPA 70 MISSING BREAKER IN PANEL; Refer to NFPA 70, National Electrical Code, for information on missing breakers in an electrical panel. Garage Panel missing breaker.	11/30/17

Violation	Proposed Date of Completion
<p>NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6.</p> <p>Unit #135 and #137 need CO detectors.</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p>NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements.</p> <p>Unit #135 needs smoke detector immediately outside the bedrooms.</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p>NFPA 101- 31.3.6.3.1 UNPROTECTED OPENINGS ARE PROHIBITED IN CORRIDORS; Unprotected openings, other than those from spaces complying with 31.3.6.3.2, shall be prohibited in exit access corridor walls and doors.</p> <p>Close in hole in wall in rear stairwell.</p>	<p>2/1/18</p>
<p>NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers)</p> <p>Boiler in basement needs a domestic sprinkler head above it for protection.</p>	<p>12/15/17</p>
<p>NFPA 101- 8.2.3 FIRE RATING NOT MAINTAINED; The fire resistance of structural elements and building assemblies shall be determined in accordance with test procedures set forth in NFPA 251, ASTM E 119, ANSI/ UL 263, or other approved test methods, or analytical methods approved by the authority having jurisdiction. Materials used to construct fire resistance-rated elements and assemblies shall be limited to those permitted in this code.</p> <p>Repair/replace all missing sheetrock in garage on walls and ceiling.</p>	<p>2/1/18</p>
<p>NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load.</p> <p>Shelf on stairs to rear of #139 must be removed.</p>	<p>12/15/17</p>
<p>FINAL DATE OF COMPLETED VIOLATION(S)</p>	<p>___/___/___</p>
<p>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</p>	<p>___/___/___</p>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.


VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.


I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

11/10/17
Date


Responsible Party

11/10/17
Date


Responsible Party

SEEN AND AGREED

11/28/17
Date

 CAPT. [unclear]
Fire Prevention Bureau