
Coastal Forest Products Hancock NH

NORDIC

REPAIR FOR (4) 1" HOLES IN TOP FLANGE CENTER OF JOIST. $9\frac{1}{2}$ " NI-40x SPACING = 16" O.C. 40psf LIVE LOAD 10psf DEAD LOAD



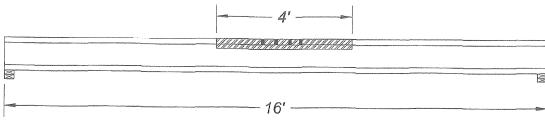

ATTACH 4' - 2 x 4 #2 spf TO ONE SIDE OF TOP FLANGE CENTERED OVER HOLES AS SHOWN WITH 100% PL 400 GLUE CONTACT AND (1) ROW .131" X 3" NAILS INTO FLANGE @ 3" C/C AS SHOWN.

NORDIC # 1202-051

REPAIR 1

1.) UNIFORM LOADS ONLY.

P. E. ROBBINS, INC. 1777 ST. RT. 167 VICTORIA, ILLINOIS 61485