

FURNACE SCHEDULE

TAG	MANUFACTURER	MODEL #	BTU'S INPUT	COOLING CAPACITY	MCA	VOLTS	OPTIONS
B1	TRANE	TUH1B090A9381	60,000	36,000	1H	115	
B2	TRANE	TUH1C080A9601	80,000	60,000	2A	115	
B3	TRANE	TUH1C080A9601	80,000	60,000	2A	115	

CONDENSER SCHEDULE

TAG	MANUFACTURER	MODEL #	COOLING CAPACITY	PHASE	MCA	VOLTS
B1	TRANE	4TTA36036	36,000	3	9.2	208
B2	TRANE	4TTA3060	60,000	3	13.5	208
B3	TRANE	4TTA3060	60,000	3	13.5	208

01 CONSTRUCTION PLAN - BASEMENT LEVEL

lgensler.ad\Projects\Revit\UseModels\2494\CIEE4HO\_Renovation\_2016\_Sinead\_Gallivan@gensler.com.rvt

SHEET NOTES

- FURNISH AND INSTALL GATED, 3/4" RECESSED FIRE EXTINGUISHER, LABELED TO MATCH EXISTING
- FURNISH AND INSTALL MIRROR, PROVIDE FIRE TREATED PLYWOOD BLOCKING AS REQUIRED
- EXISTING TO REMAIN FIRE EXTINGUISHER CABINET
- REINSTALL SALVAGED SHOWER ENCLOSURE INCLUDING PURL PLUMBING, FIXTURES, BUILT UP CURB, SPOTTY AND TILE FINISH AT ALL SIZES. COORDINATE WITH PLUMBING DESIGNER'S CONTRACTOR
- PREP, PATCH, PAINT ALL AREAS AFFECTED BY DEMOLITION FOR SMOOTH, LINE NEW FINISH
- EXISTING TO REMAIN MIRROR
- EXISTING CONCRETE FOOTING
- LOCKED VENTED ACCESS PANEL - CONTRACTOR TO COORDINATE WITH OWNER
- AS ABOVE, BOTTOM ONLY A.F.F., ALIGN TOP WITH MIRROR
- LOW RACK AND SHELF ABOVE

GENERAL NOTES


- ALL DIMENSIONS ARE DIMENSIONED FROM FINISH FACE TO FINISH FACE UNLESS OTHERWISE NOTED. UNLESS DIMENSIONS MARKED TO CLEAR OR HOLD, ALLOW FOR THICKNESS OF FINISHES
- COORDINATE AND PROVIDE BLOCKING WITHIN PARTITION FOR ALL MILLWORK AND ITEMS ATTACHED OR MOUNTED TO WALLS OR CEILING
- UNDERCUT OF DOORS TO CLEAR TOP OF FLOOR FINISH BY 1/4" UNLESS OTHERWISE NOTED
- ALL EXTERIOR GLAZING TO BE SAFETY GLAZING IN ACCORDANCE WITH APPLICABLE CODES
- MARK THE LOCATION OF ALL PARTITIONS ON THE SLAB FOR REVIEW AT THE APPLICABLE FINISH TO INSTALLATION. REVIEW SHALL BE FOR DESIGN INTENT. CONTRACTOR TO VERIFY ALL CONDITIONS IN ORDER TO INSURE PROPER FIT. ALL PARTITIONS SHALL BE PERPENDICULAR OR PARALLEL TO BUILDING CORE WALLS UNLESS OTHERWISE NOTED
- WHERE FACE OF ALL DOOR OR CASES SHALL BE LOCATED FROM ADJACENT PERPENDICULAR WALL UNLESS OTHERWISE NOTED
- WHERE EXISTING ACCESS PANELS CONFLICT WITH CONSTRUCTION, RELOCATE PANELS TO ALIGN WITH AND FIT WITH NEW CONSTRUCTION. REVIEW WITH ARCHITECT IN THE FIELD
- REPAIR AND/OR RETIRE ALL EXISTING FIREPROOFING DAMAGED DUE TO DEMOLITION AND NEW WORK. FIREPROOFING SHALL BE AS REQUIRED TO MAINTAIN EXISTING FIRE PROTECTION RATING
- PATCH AND REPAIR ALL EXISTING AND/OR NEW PENETRATIONS THROUGH EXISTING FIRE RATED GLASS AND PARTITIONS. AS REQUIRED, TO MAINTAIN EXISTING FIRE PROTECTION RATING
- PATCH AND REPAIR ALL EXISTING WALLS, CEILING AND SURFACES SCHEDULED TO REMAIN AS REQUIRED TO LEAVE THEM SMOOTH AND EVEN TO RECEIVE NEW SCHEDULED FINISHES. REFER TO FINISH PLAN FOR ADDITIONAL INFORMATION

LEGEND

- EXISTING CONSTRUCTION TO REMAIN
- NEW PARTITION
- 1 HR. RATED PARTITION
- 2 HR. RATED PARTITION
- 3 HR. RATED PARTITION
- 4 HR. RATED PARTITION
- SMOKE PARTITION
- ALL WORK
- MILLION POINT
- WALL TYPE REFERENCE
- DOOR REFERENCE NUMBER, REFER TO DOOR SCHEDULE
- DOOR TYPE
- HARDWARE TYPE
- DOOR NUMBER
- DOOR TYPE / HARDWARE TYPE
- WINDOW REFERENCE NUMBER (REFER TO WINDOW SCHEDULE)



Council on International Educational Exchange  
300 Fore Street  
Portland, ME

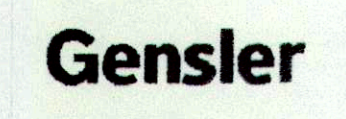

One Beacon Street  
Third Floor  
Boston, MA 02108  
(617) 619-5700  
(617) 619-5701


Date & Issue	Description	By	Check
06/26/16	ISSUED FOR PERMIT	ACH / AG	GL
12/29/16	ISSUED FOR CONSTRUCTION	ACH / AG	GL
02/25/17	BULLETIN 01	SG	GL

Seal/Signature

Project Name  
CIEE HQ Renovations

Project Number  
11,7366,000

Description  
CONSTRUCTION / PLAN - BASEMENT LEVEL

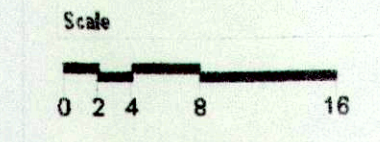

A02.200

© 2016 Gensler