


- WITH CONSTRUCTION RATING REQUIREMENTS SHOW IN LIFESAFETY DOCUMENTS, COLUMN, WALL AND FLOOR UL ASSEMBILIES, TO PROVIDE FOR A FULL AND COMPLETE RATED BUILDING ASSEMBILIES AS NOTED GOVERNING CODES, REGULATIONS AND RATED ASSEMBILIES; INCLUDING BUT NOT LIMITED TO THE IBC, NFPA, AND BY THE AHJ. SEE A4.00-A4.03 FOR GENERAL CONSTRUCTION CONDITIONS.
- SUBBASEMENT TREAT PARTIALLY EXPOSED BEAMS WITH INTUMESCENT FIRE RATED PAINT. LEVEL 1 RESTAURANT - REMOVE PLASTER & LATH BEAM WRAP TO CONCRETE BEAM WRAP. PLUG, PATCH AND RESTORE EXG CONCRETE TO LEVEL SPECIFIED BY RESTAURANT DESIGNER. RESTORATION TO INCLUDE CASTING OF CAPITALS
- AT COLUMNS TREATED WITH INTUMESCENT PAINT (5B & 5C). LEVELS 2-7 GUESTROOMS ARE COMPRISED OF 3 GENERAL CEILING AREAS; ENTRY AREAS, BATHROOM BLOCK (BATHROOM, CLOSET, MISC), AND LOFTED GENERAL AREAS. CEILINGS IN ENTRY
- AND BATHROOM AREAS ARE TYPICALLY NOTED LEVELS 2-7 GUESTROOMS; WHERE CLOSETS OCCUR AWAY FROM THE BATHROOM BLOCK PROVIDE GYPSUM CEILING AT THE HEIGHT OF THE
- BATHROOM WHETHER SHOWN OR NOT. LEVELS 2-7 GUESTROOMS; IN LOFTED GENERAL AREAS APPLY 5/8" GYPSUM BD ON 1/2" HAT LEVELS 2-7 GUESTROOMS; IN ADDITION OR IN
- CHANNEL CEILINGS APPLIED TO DECK, TYPICALLY CONCERT WITH STRUCTURE RATING WORK WRAP ALL EXISTING BEAMS WITH GYPSUM AS SHOWN IN TYPICAL INTERIOR DETAILS, SEE TYPICAL GUEST ROOM BEAM WRAP IN A-400 SERIES.

(C.5)—

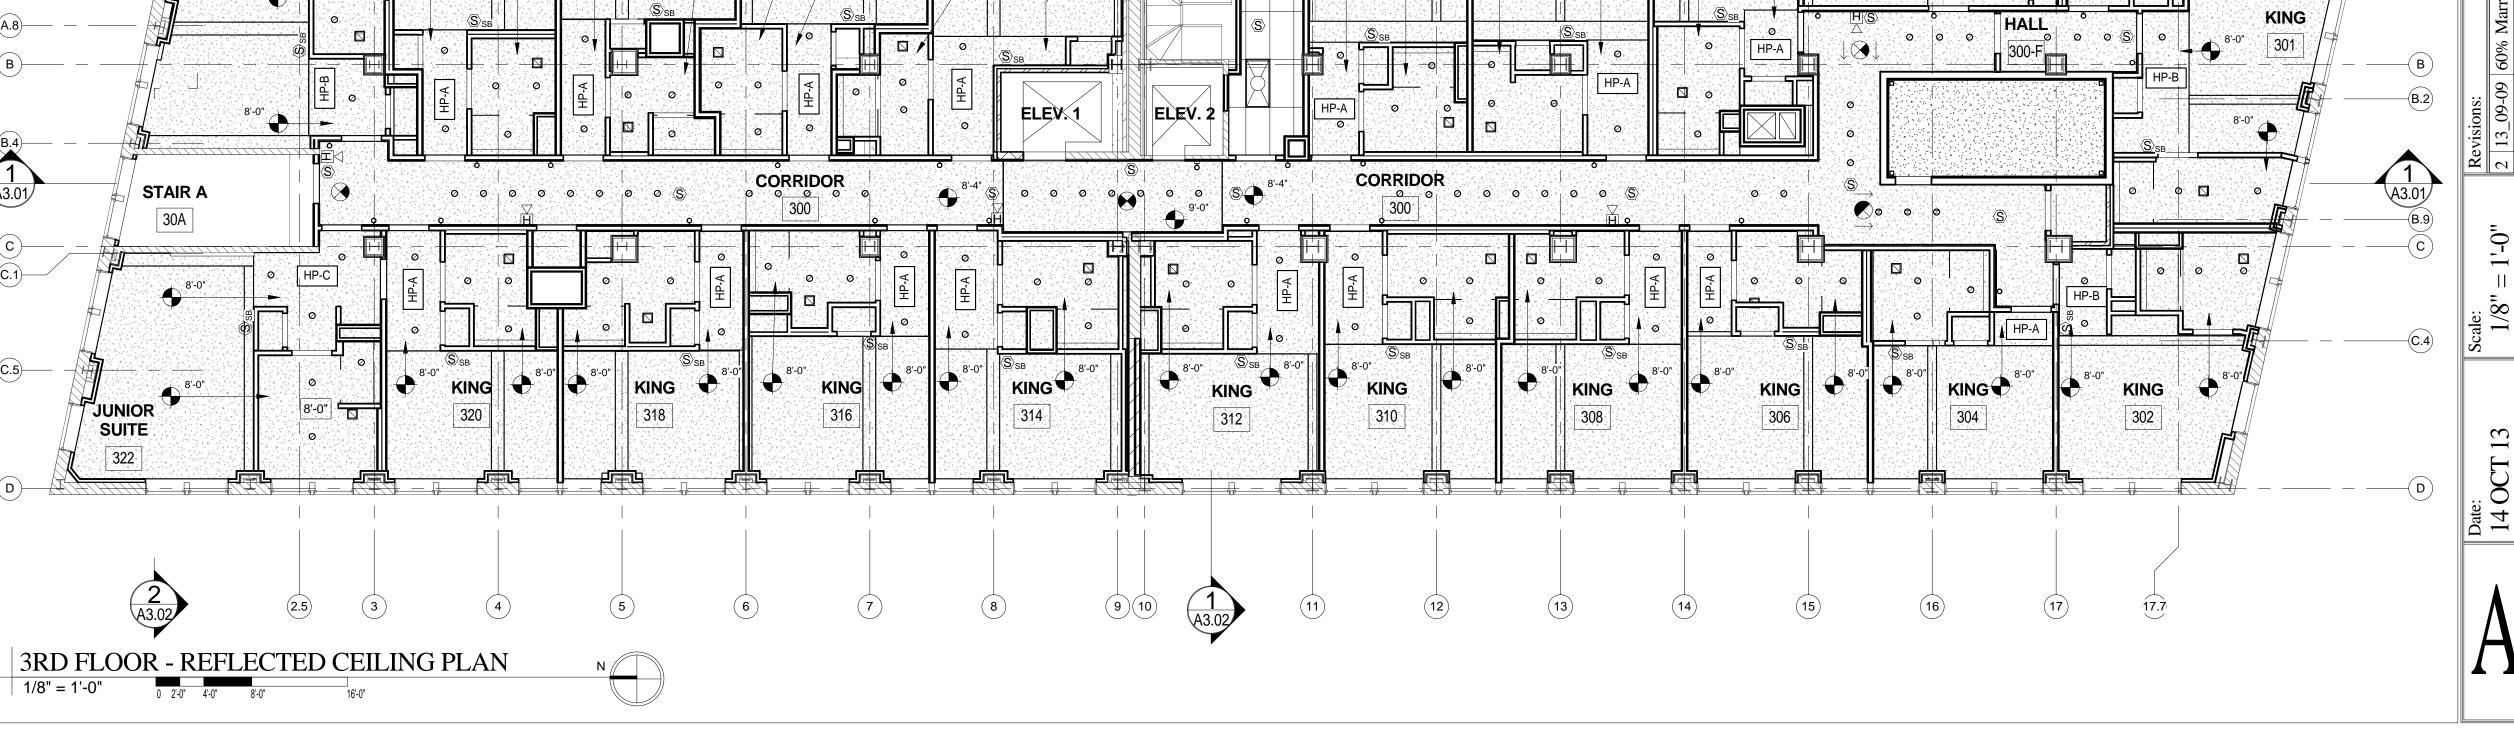

THIRD AND FOURTH FLOOR RCP

Development

0

IEI

PRESS