



South elevation
Residential entry



Preble st. elevation
original entry elevation

project name

Schlotterbeck Block

117 Preble Street
Portland, Maine

Schlotterbeck Block LLC

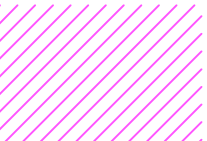
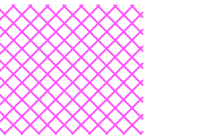


goduti/thomas architects

44 oak st.

portland, maine 04101

ph. 207-775-3184

fax 207-774-0846

-  hatch indicates area where masonry needs to be cut and repointed see detail O sheet A5.0
-  hatch indicates area where masonry needs to be repaired and repointed see detail O sheet A5.0
-  repair spalled cast stone
-  spalled cement coating repair

WINDOW STEEL LINTEL SCHEDULE

- type A: original lintel has been replaced no work necessary
- type B: original lintel in place repair, replace
- type C: replace existing lintel with new galvanized lintel
- type B/C: either repair or replace inspect with lift

- NOTES:
1. wash all brick product: Eco Chem, Restore One
 2. remove all loose cement based waterproof coating on existing cast stone apply new coating layer over all existing cast stone
 3. cut and point all brick to cast stone joints and all cast stone to cast stone joints
 4. % of misc. repointing incomplete (no lift)

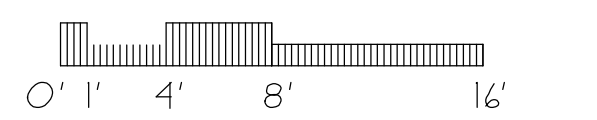
revisions

date

dec 2015

sheet title

masonry repair elevations



scale

1/8"=1'-0"

drawn by

MS

project number

brewer

sheet number