

project name

Schlotterbeck Block

117 Preble Street
Portland, Maine

Schlotterbeck Block LLC


goduti/thomas architects

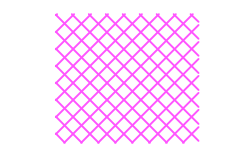
44 oak st.

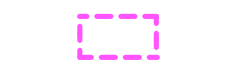

portland, maine 04101

ph. 207-775-3184

fax 207-774-0846

 hatch indicates area where masonry needs to be cut and repaired
see detail O sheet A5.O

 hatch indicates area where masonry needs to be repaired and reported
see detail O sheet A5.O

 repair spalled cast stone
 spalled cement coating repair

WINDOW STEEL LINTEL SCHEDULE
type A: original lintel has been replaced
no work necessary
type B: original lintel in place
repair, replace
type C: replace existing lintel
with new galvanized lintel
type B/C: either repair or replace
inspect with lift


NOTES:
1. wash all brick
product: Eco Chem, Restore One
2. remove all loose cement based waterproof coating
on existing cast stone
apply new coating layer over all existing cast stone
3. cut and paint all brick to cast stone joints
and all cast stone to cast stone joints

revisions

date
dec 2015

sheet title

masonry repair elevations


0' 1' 4' 8' 16'

scale
1/8"=1'-0"

drawn by
MS

project number
brewer

sheet number

A2.4



Kennebec St. elevation



Elm St. elevation