

CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

NOTICE OF VIOLATION AND ORDER TO CORRECT

December 7, 2017

Location 22 SHERMAN ST	CBL 036 F006001	Inspection Date 11/9/2017
Inspector John Brennan	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 12/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE; Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. 1) Patch the hole in the wall (caused by the door handle) in the front stairwell. 2) Patch the damaged sheet rock above the basement stairs.	<u>2 / 28 / 18</u>
NFPA 10- 7.2.4.4 FIRE EXTINGUISHER INSPECTION TAG; Where manual inspections are conducted, records for manual inspections shall be kept on a tag or label attached to the fire extinguisher, on an inspection checklist maintained on file, or by an electronic method. Extinguishers in the stairwells must be inspected and tagged or removed.	<u>1 / 31 / 18</u>
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. Remove all storage from the front and rear stairwells on all levels.	<u>1 / 31 / 18</u>
NFPA 70- 4.10.8 DEFECTIVE LIGHT FIXTURE; Luminaries shall be installed such that the connections between the luminaire conductors and the circuit conductors can be inspected without requiring the disconnection of any part of the wiring unless the luminaries are connected by attachment plugs and receptacles. Multiple light fixtures in the basement are missing lightbulbs.	<u>1 / 31 / 18</u>
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Install a domestic sprinkler head above the gas water heaters in the basement. 1 centrally located head will be sufficient.	<u>2 / 28 / 18</u>

Violation	Proposed Date of Completion
NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE; Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. Second floor rear hall Hole in wall needs to be repaired near piping	2 / 28 / 18
FINAL DATE OF COMPLETED VIOLATION(S)	2 / 28 / 18
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	_ / _ / _

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION


I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

12 / 28 / 17

 Date

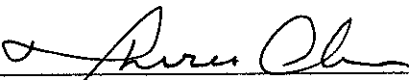

 Responsible Party


 Date

 Responsible Party

SEEN AND AGREED

1 / 9 / 18

 Date

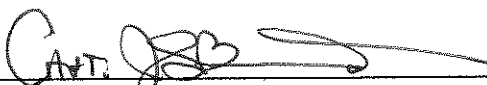

 Fire Prevention Bureau

