

ITEM YORKCODE DESCRIPTION REF DWG 57 EA DF DOOR FRAME REMOVAL AND JAMB REPAIR REF DWG S7 REPLACE LANDING SUPPORT ANGLE STA EA TREAD COVER REMOVAL/RESINSTALL AND TREAD REPAIR 25 EA REF DWG 57 TCR REF DWG 56 TM PEDESTRIAN MEMBRANE AT LANDINGS SF REF DWG 55 50 CR CONCRETE REPAIR 75 LF REF DWG S5 CCR CRACK CHASE REPAIR STAIRWAY REF DWG 50 PREP AND PAINT STEEL STAIR FRAMING REF DWG 50 PAINT WALLS AND CEILING COVERS REF DWG S5 CCC COLUMN COVER CMU REPLACEMENT REF DWG 55 CRS ROUT/SEAL CMU CRACK LF LF REF DWG 55 CSJ CUT OUT AND REPLACE REPLACE MASONRY CONTROL JOINT REF DWG S5 SC CUT AND AND REPLACE CURTAIN WALL TO CMU JOINT SEALANT 45 LF SF REF DWG 55 OH OVERHEAD SPALL REPAIR REF DWG 57 EA DFR REPLACE DOOR AND FRAME AT LVL D


SCOPE OF WORK - STAIR #2


QUANTITY UNIT NOTES


NOTES: 1. QUANTITIES SHOWN IN THE SCHEDULE ABOVE MAY BE GREATER THAN WHAT ARE SHOWN ON THE PLAN. 2. ALL QUANTITIES SHOULD BE FIELD VERIFIED.

(10) 16'-6" TM- 42 -- STA- 1 EX PIPE--CRS-10 EXTENT OF EX BRICK AND A_2

LEVEL B PLAN AT STAIR TOWER #2

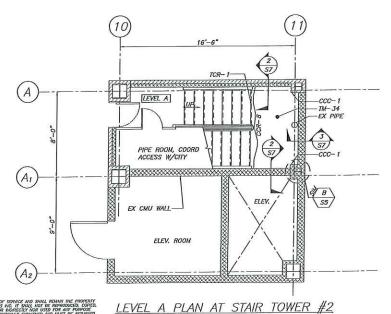

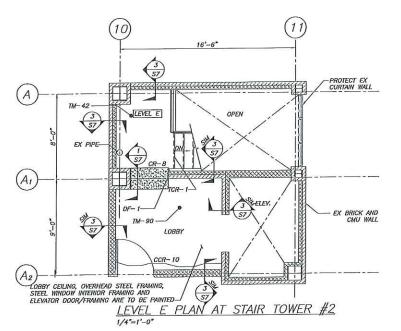

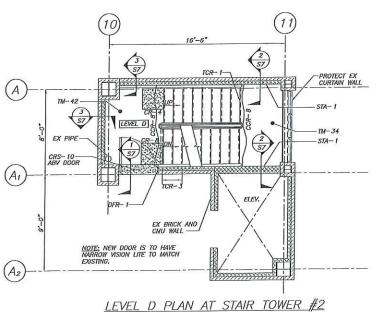

LEGEND

CRACK CHASE REPAIR

CONCRETE LANDING REPAIR

STAIR LANDING REPLACEMENT

OVERHEAD SPALL REPAIR

CMU WALL

BRICK MASONRY WALL

WORK COUNTITY

L QUANTITY

WORK CODE INDICATOR

"PATIFYING SYMBOL (f -- IDENTIFYING SYMBOL (REF LEGEND)

- STAIR TOWER #2 PAINTING NOTES:

 1. REFERENCE DRAWNIG SO AND SPECIFICATIONS FOR ADDITIONAL PAINTING AND SUPERACE PREPARATION REQUIREMENTS.

 2. ALL EXPOSED STEEL WITHIN STAIR TOWER IS TO PREPARED AND PAINTED INCLUDING BUT NOT LUMITED TO STAIR FRAMING, HANDRAILS, GUARDRAILS, STEEL ATTACHMENTS TO THE CURTAIN WALL AND MISCELLANEOUS EXPOSED STRUCTURAL SIEEL.

 3. ALL STAND AND DRAIN PIPES ARE TO BE PREPPED AND PAINTED. THE UNDERSIDE OF THE CONCRETE LANDINGS ARE TO BE SCRAPPED OF LOOSE PAINT AND REMAIN UNPAINTED.

 5. ELECTRICAL BOXES, LIGHTS AND EMERGENCY LIGHTS DO NOT NEED TO BE REMOVED AND CAN BE PAINTED AROUND, ELECTRICAL CONDUIT DOES NOT NEED TO BE REMOVED AND CAN BE PAINTED PROUND, ELECTRICAL CONDUIT THE WILLS. PROTECTION CAGES AROUND THE LIGHTS ARE TO BE REMOVED, PAINTED AND RESET.

 6. CONTRACTOR TO REMOVE AND REINSTALL ALL SIGNS ATTACHED TO THE WALL PRIOR TO PAINTING.

STRUCTURAL ENGIN 57 York Street Pertland, Malno 207,879,1838 • beckenstructura

GARAGE STREET PARKING G PORTLAND, MAINE STAIR REPAIRS #2 STAIR SPRING

Designed Scole

JMM AS NOTED RJB Date 11/30/17 Checked Becker Job Number JMM 4198

S2