

•
•
•
•
•
•
•

389 Congress St.Rm 315
Portland, ME 04101
Phone: (207)874-8700
Fax: (207)874-8716

facsimile transmittal


To: David Merrill/TFH **From:** Mike Nugent

Fax: 773-0194 **Date:** March 23, 2004

Phone: 775-6141 **Pages:** 1

Re: 85 Grant St. 048 B011 Permit# 040182

Urgent For Review Please Comment Please Reply Please Recycle

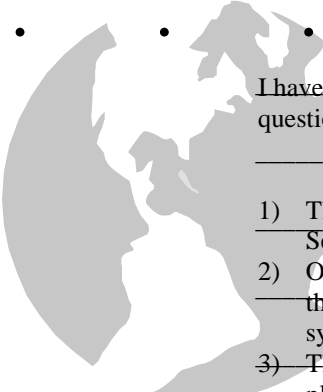

I have commenced a partial review the submissions for the above permit and have the following questions:

- 1) The sound transmission rating for the hallway assemblies are less than that required by Section 1214.2 of the Code
- 2) On page G1, it appears that the fire separation between the mixed uses is 1 Hour. In looking at the exception that you used I believe that this would apply with the use of an NFPA 13 system, as the exception references 906.2.1 and not both 906.2.1 & 906.2.2
- 3) The code review references half hour rated corridors and dwelling unit separations, yet the plan shows 1 hour ratings, which standard will be used?
- 4) I couldn't find specific information relative to fire separation assembly penetration protection.
- 5) The bathroom vents penetrate the rated floor ceiling assembly, I didn't find fire dampers or other appropriate protection.

• • • • •