




1	ADDENDUM 1	03.22.18
NO	ISSUE	DATE
Job Number	152181.000	
Drawn	REE	
Checked	BMH	
Approved	JHT	

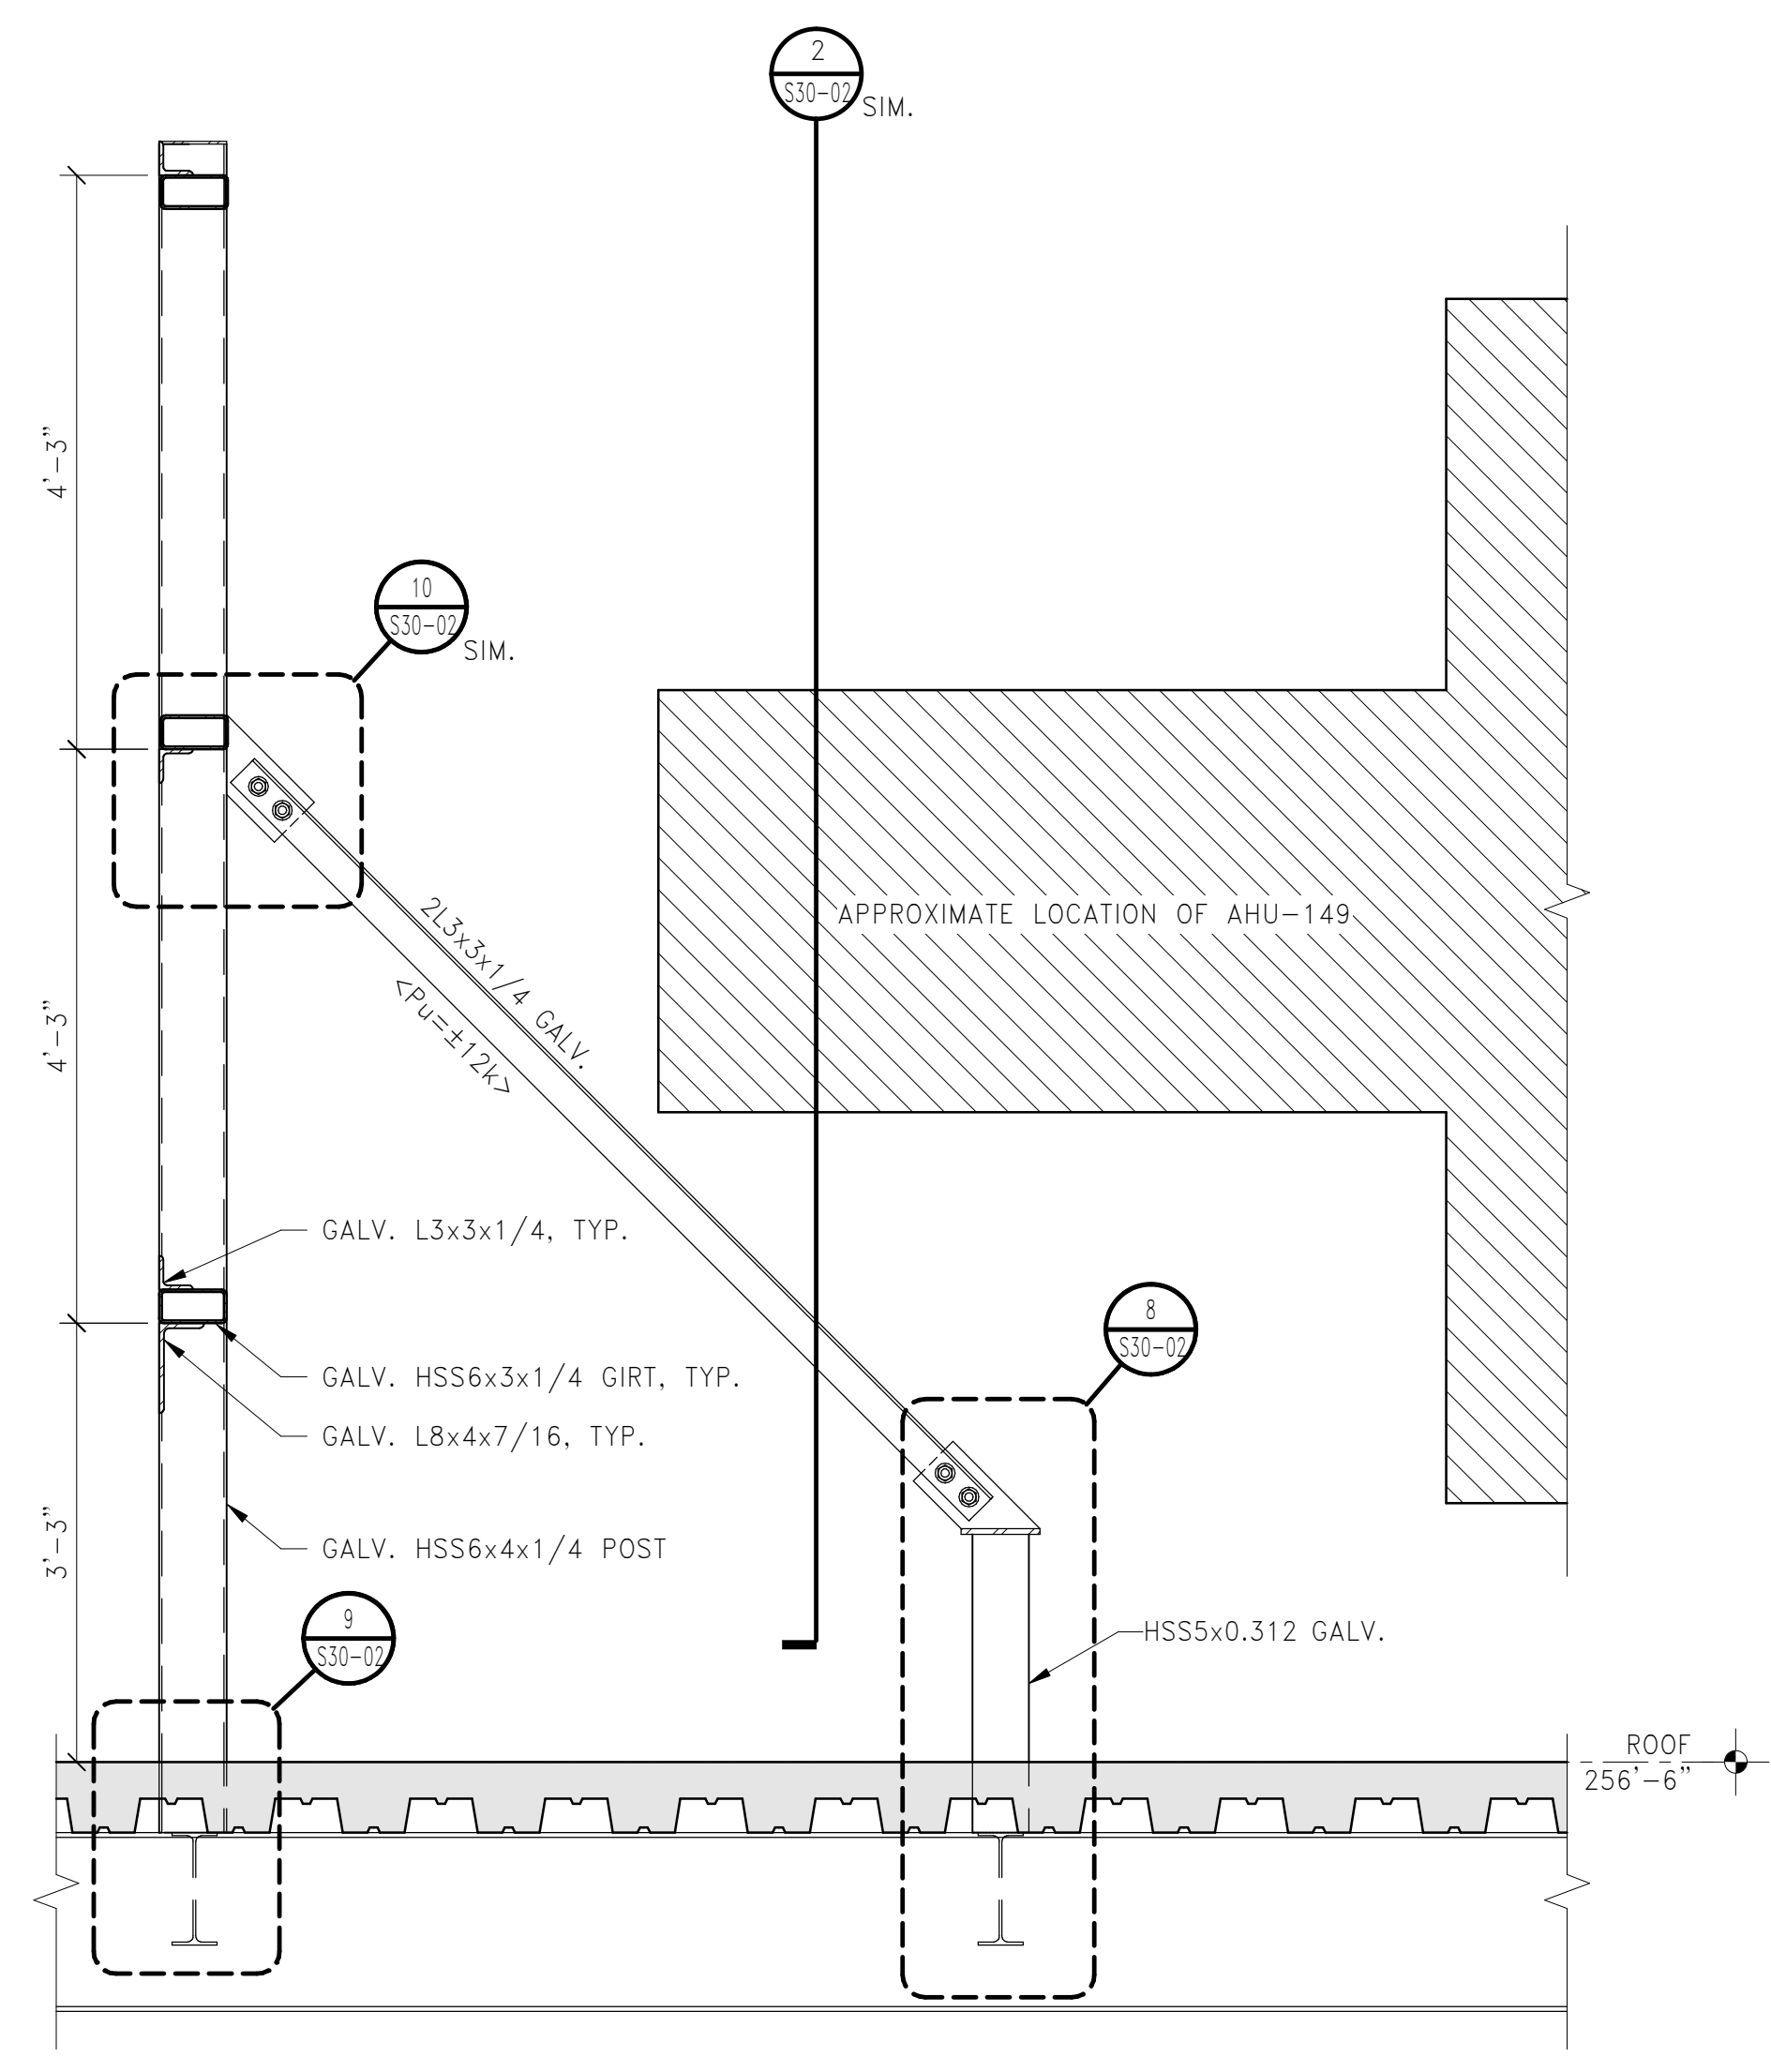


13 SECTION: LOWERED SCREEN WALL SUPPORT KICKER  
 3/4" = 1'-0"

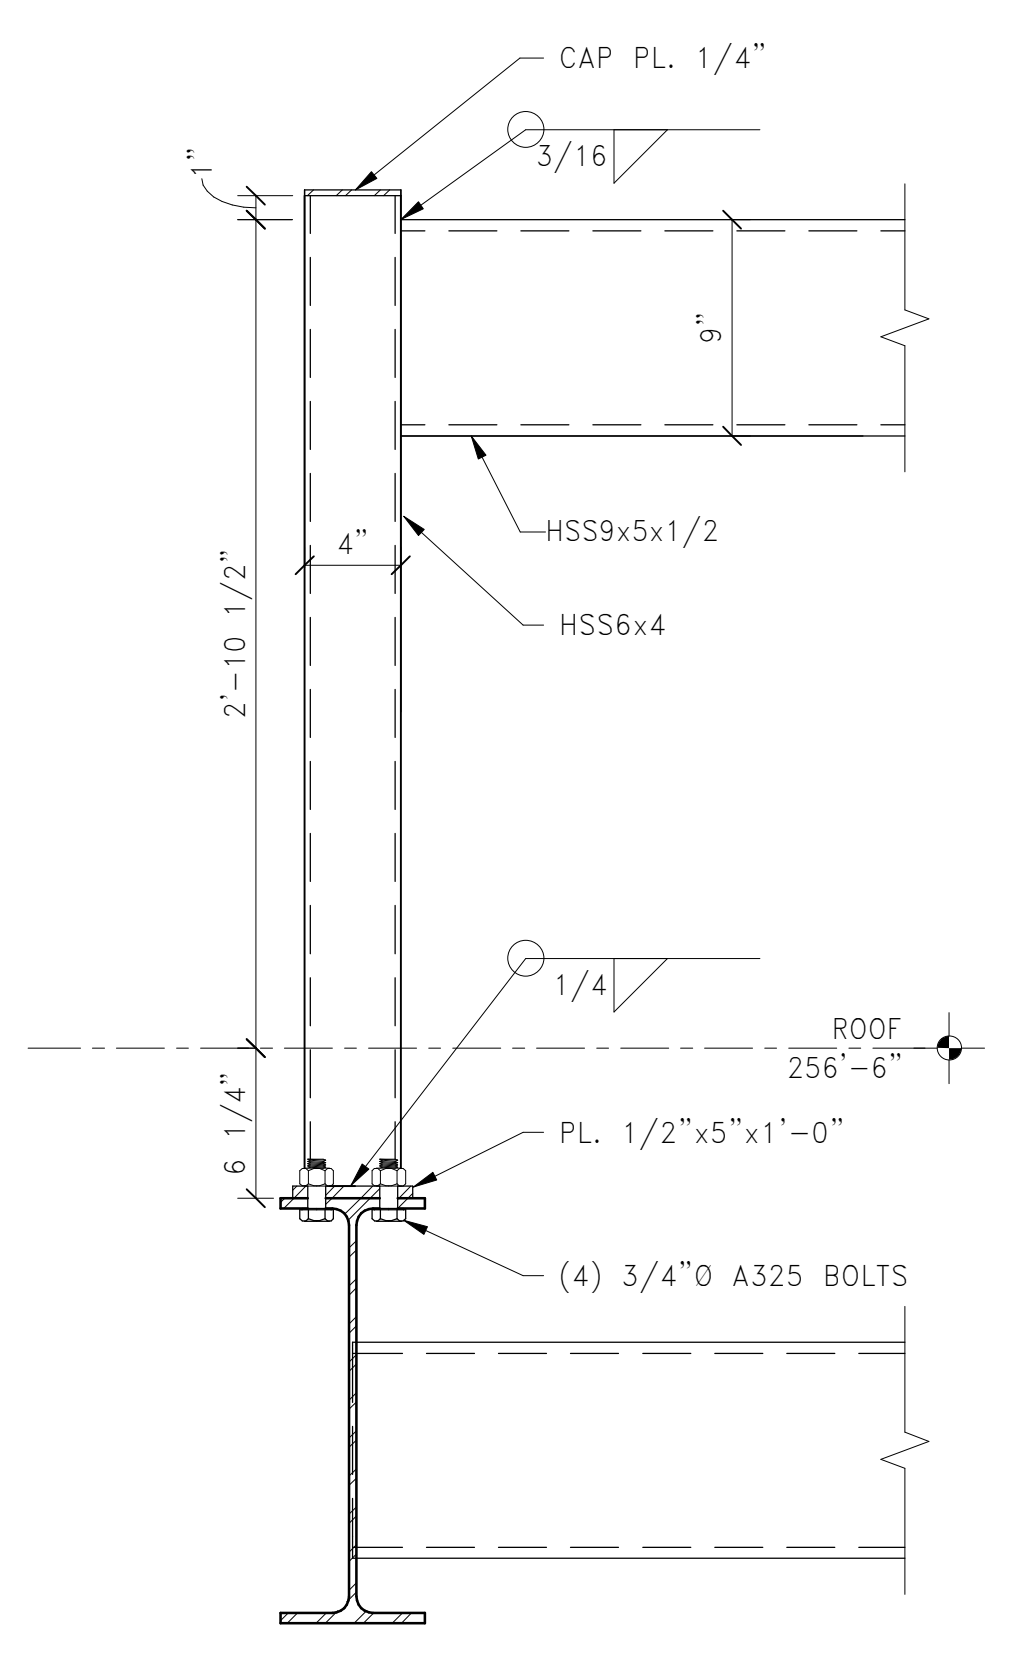


12 SECTION: ELEVATOR DIVIDER BEAM ABOVE ROOF  
 1 1/2" = 1'-0"

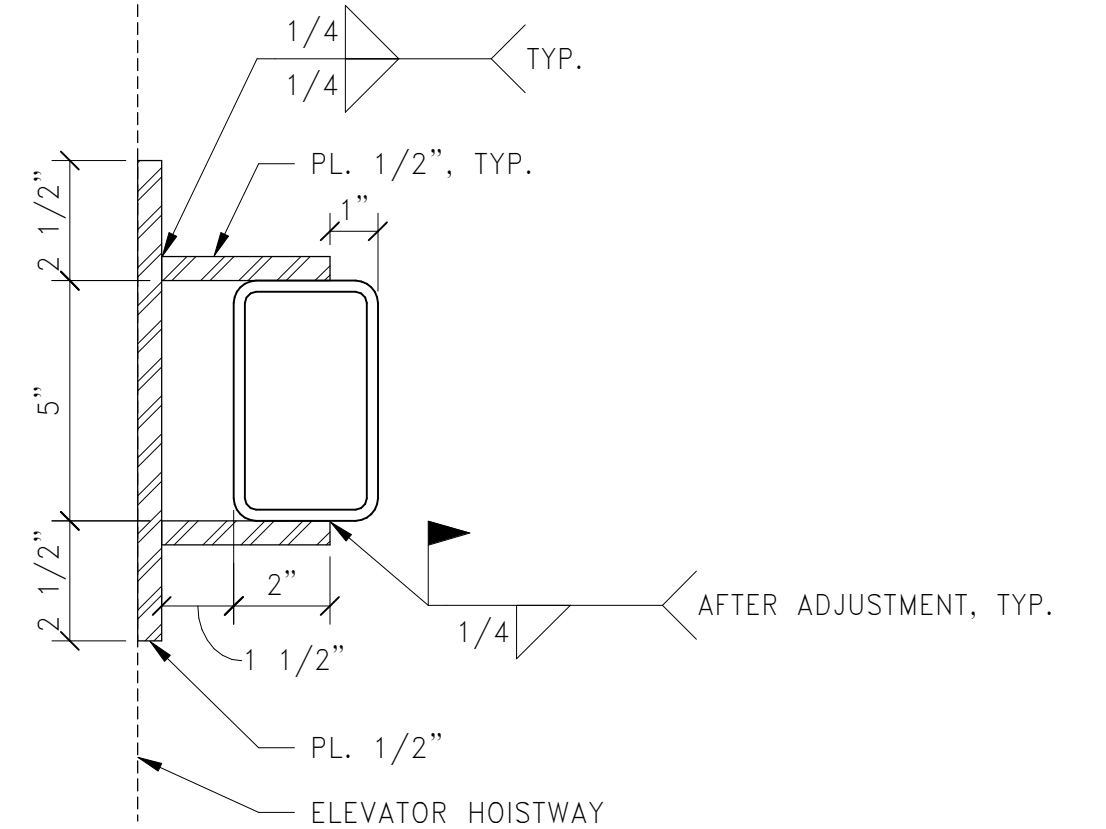


11 SECTION: ELEVATOR GUIDE RAIL SUPPORT PLATE  
 3" = 1'-0"

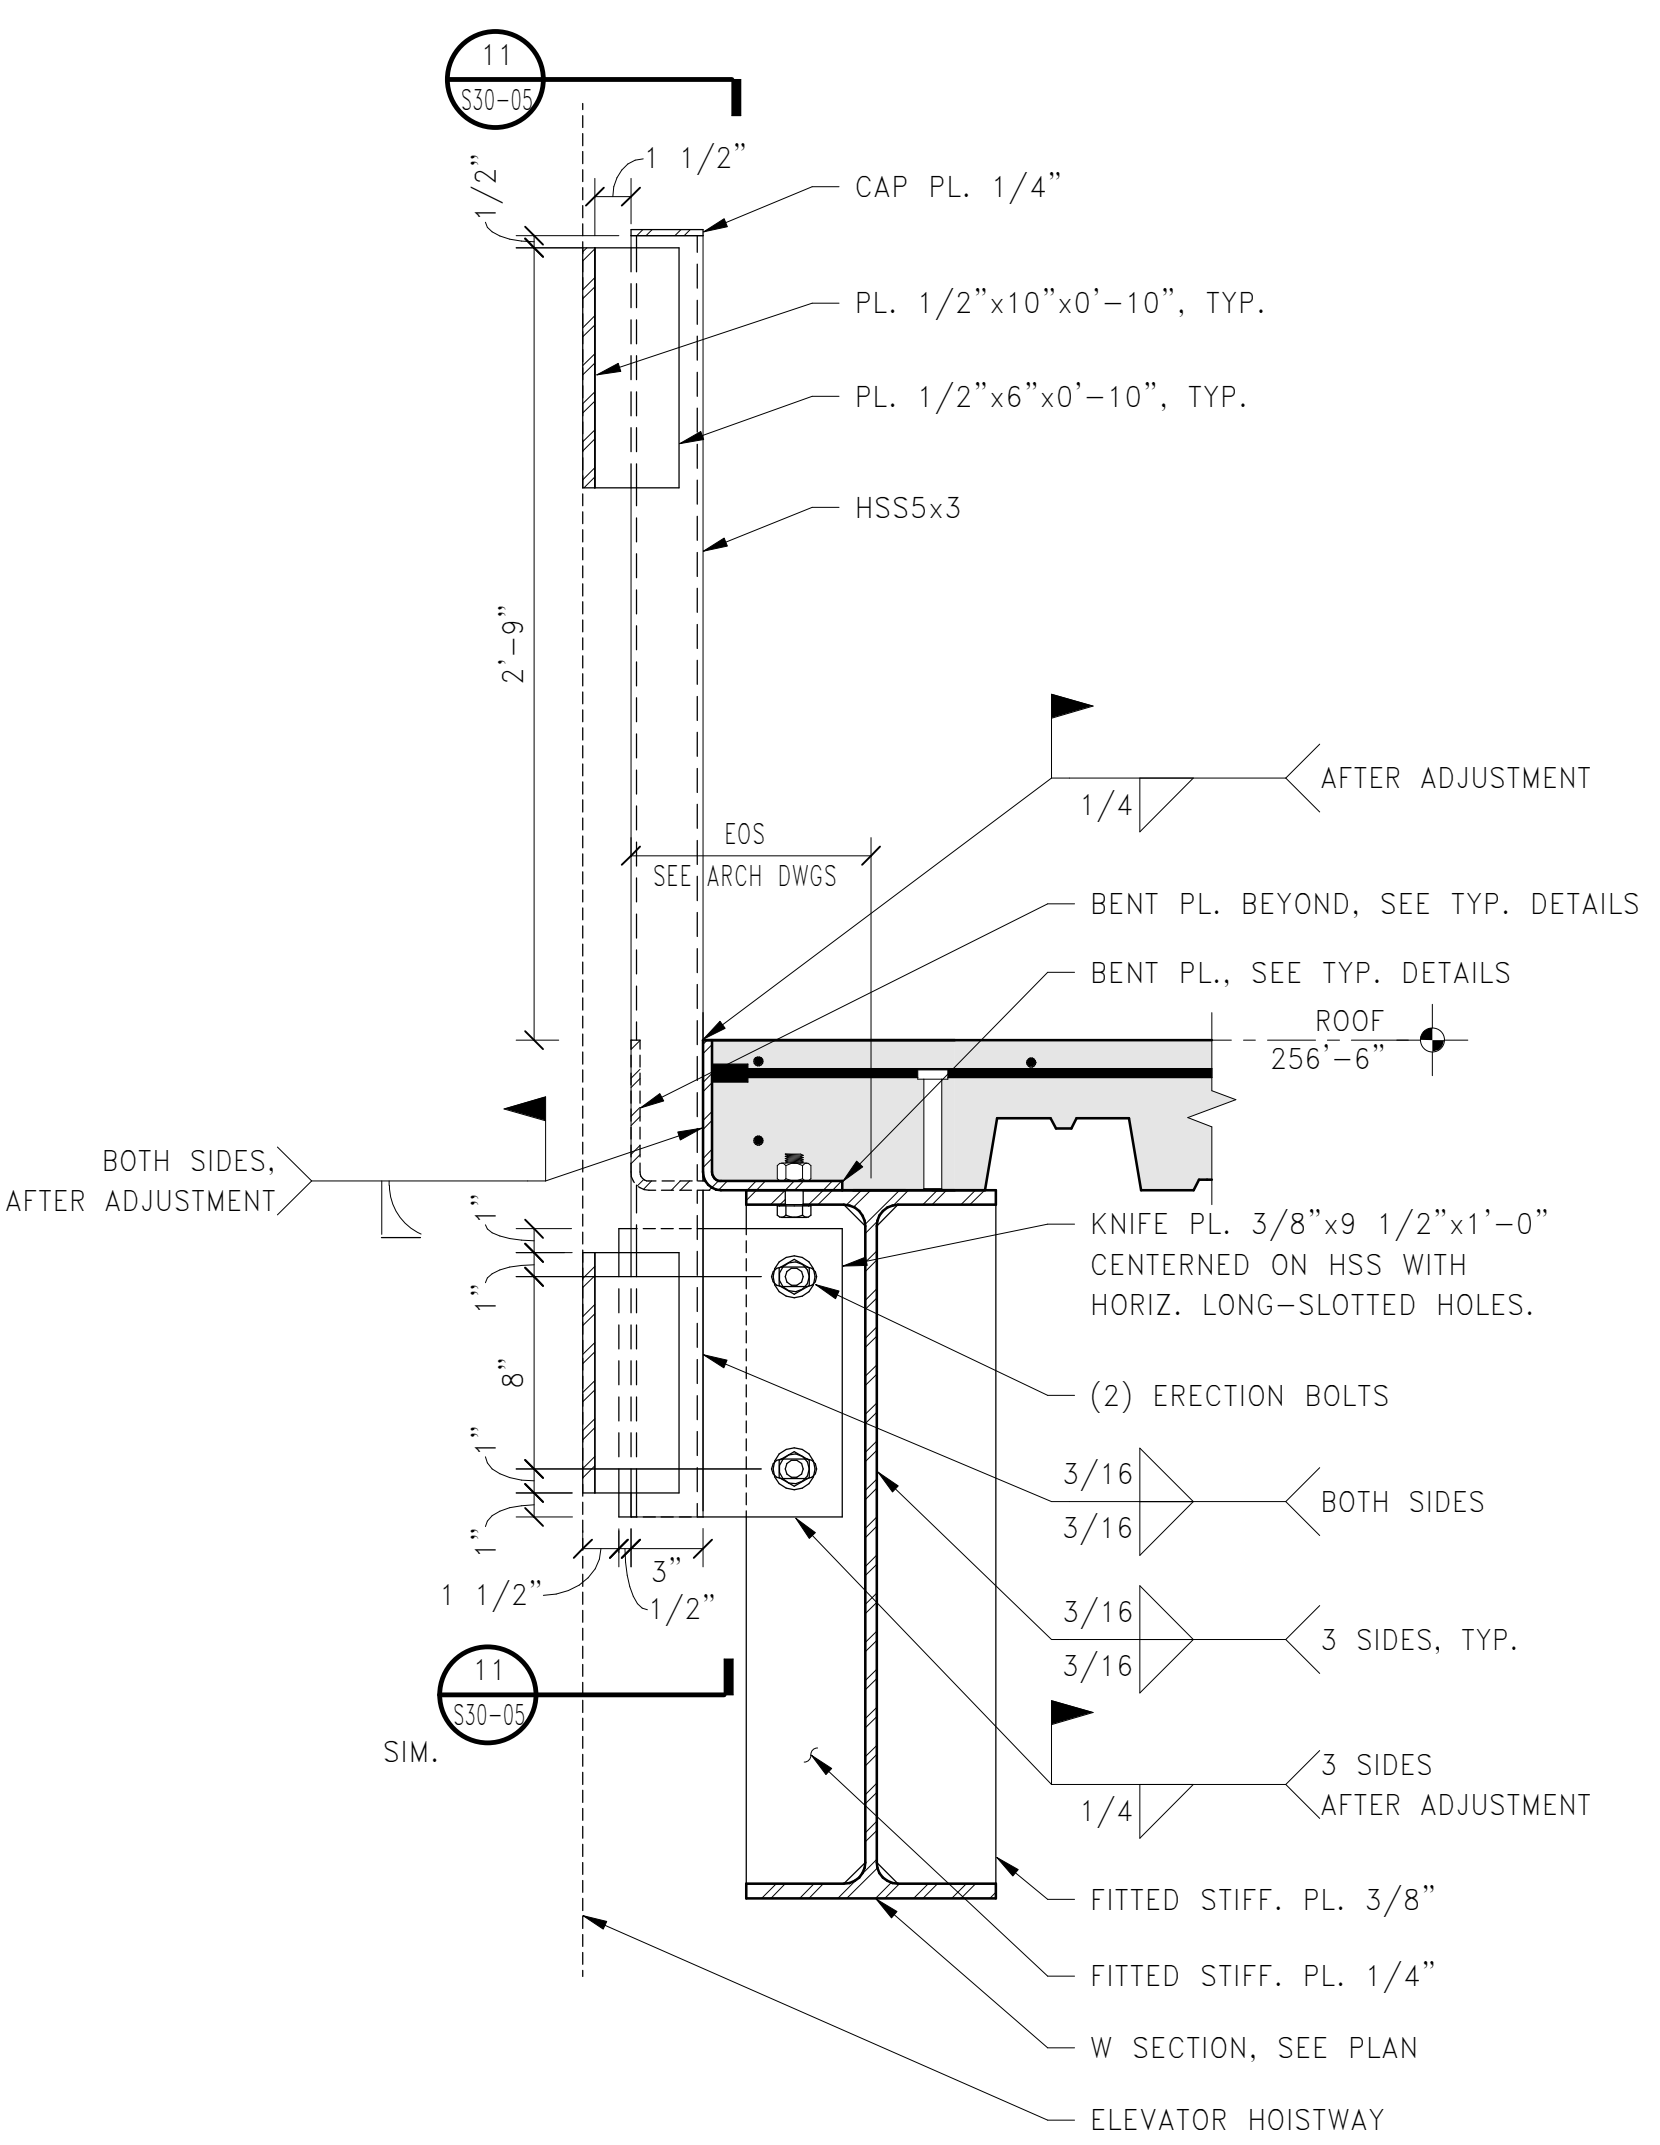


10 SECTION: ELEVATOR GUIDE RAIL SUPPORT ABOVE ROOF  
 1 1/2" = 1'-0"

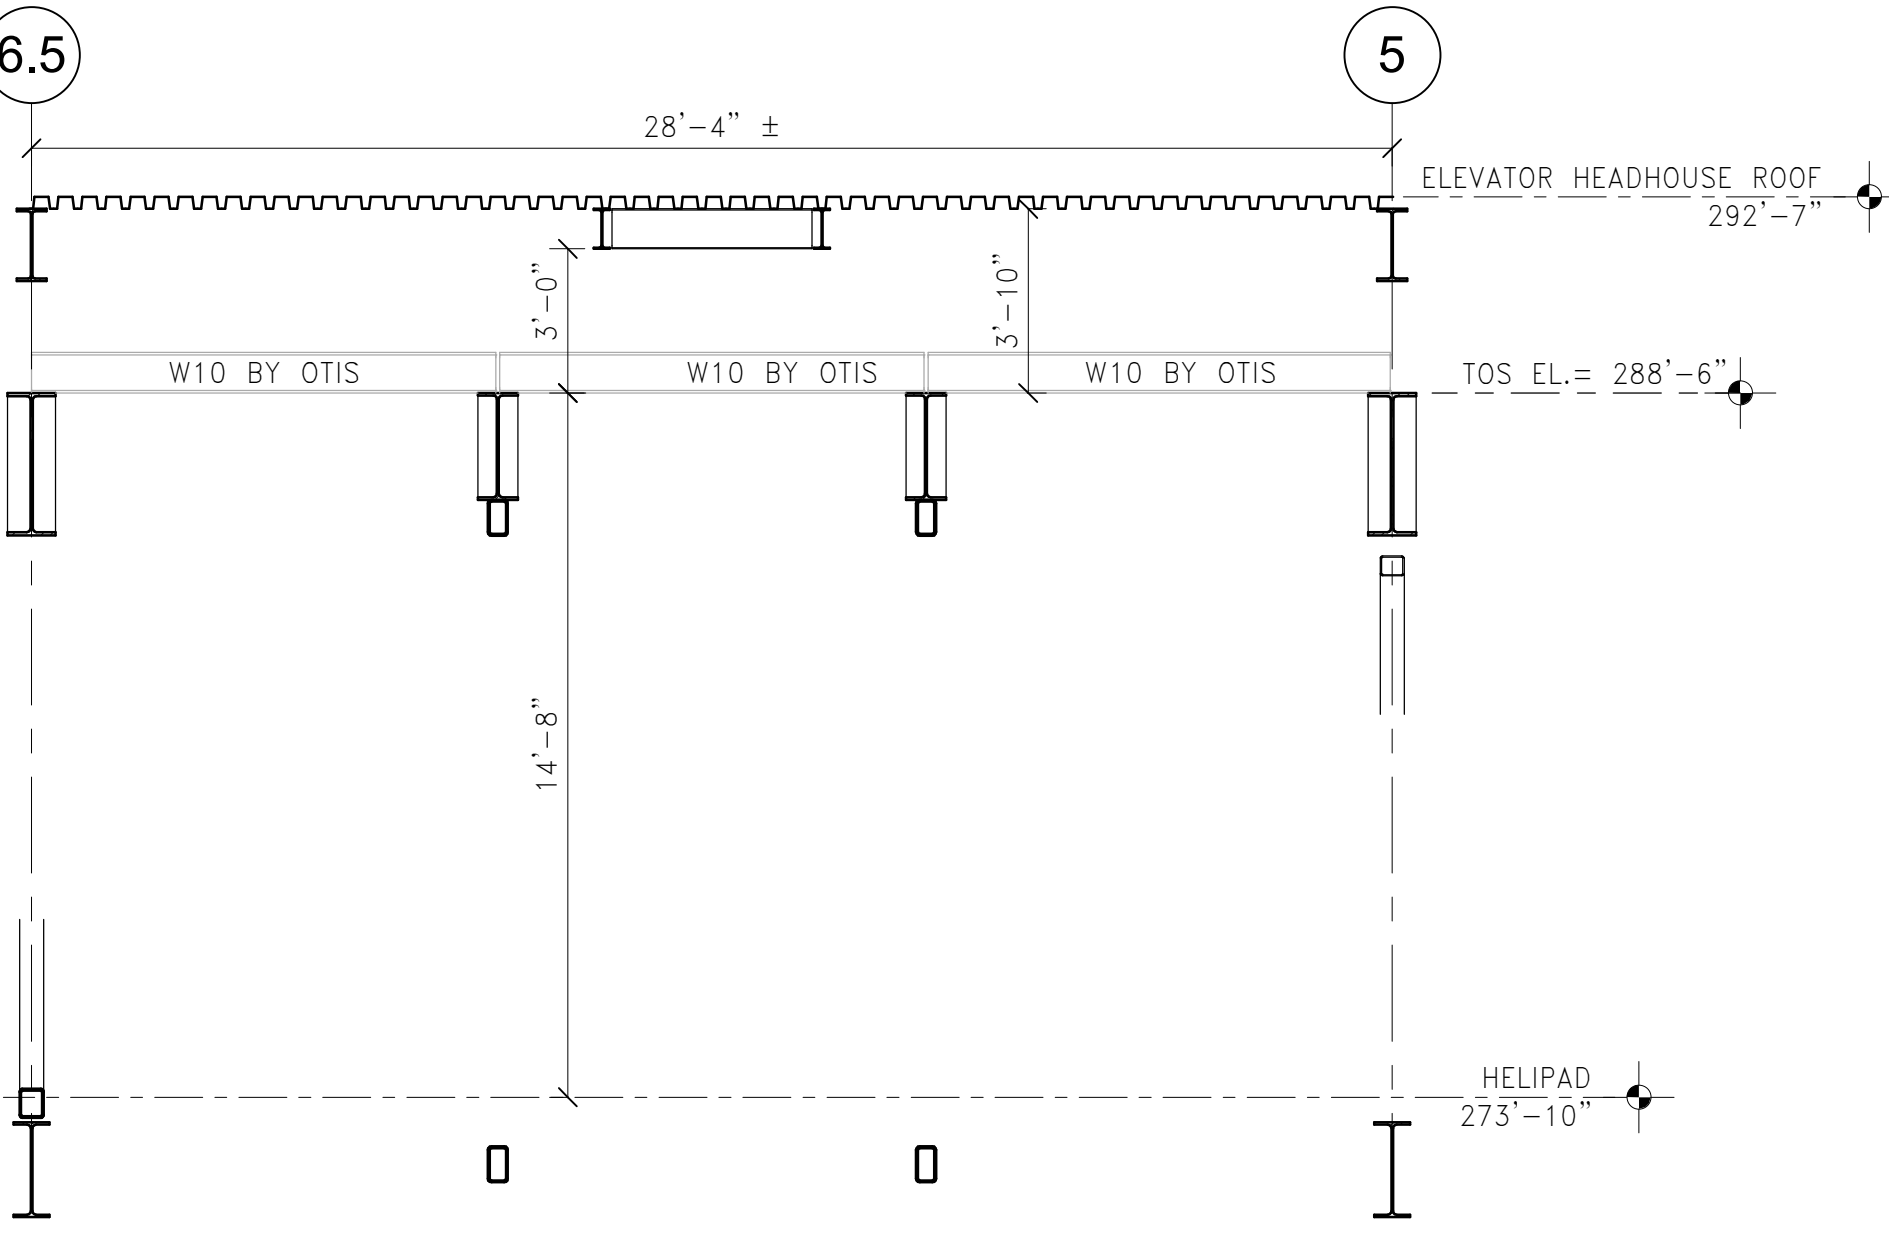


9 SECTION: SERVICE CAR ELEVATOR CLEARANCES  
 1/4" = 1'-0"

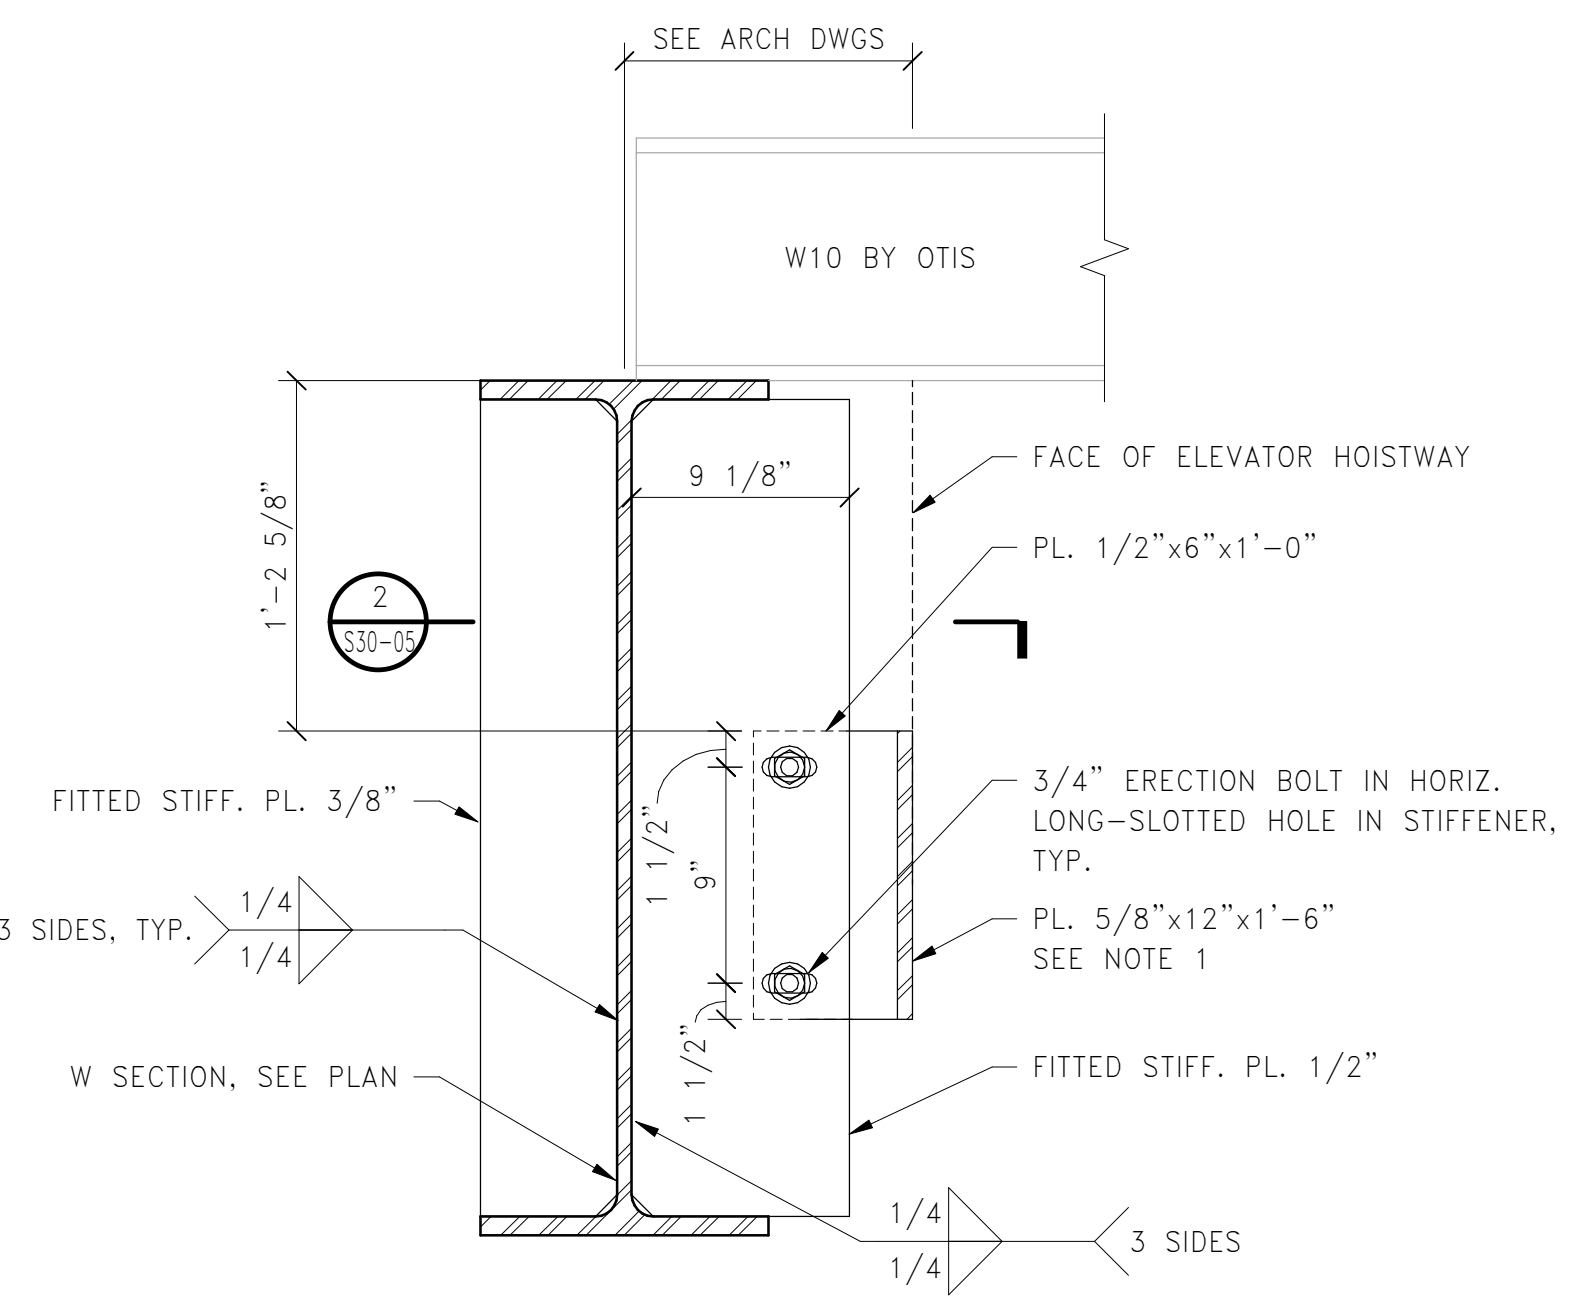


8 SECTION: ELEVATOR GUIDE RAIL SUPPORT AT OVERRUN  
 1 1/2" = 1'-0"

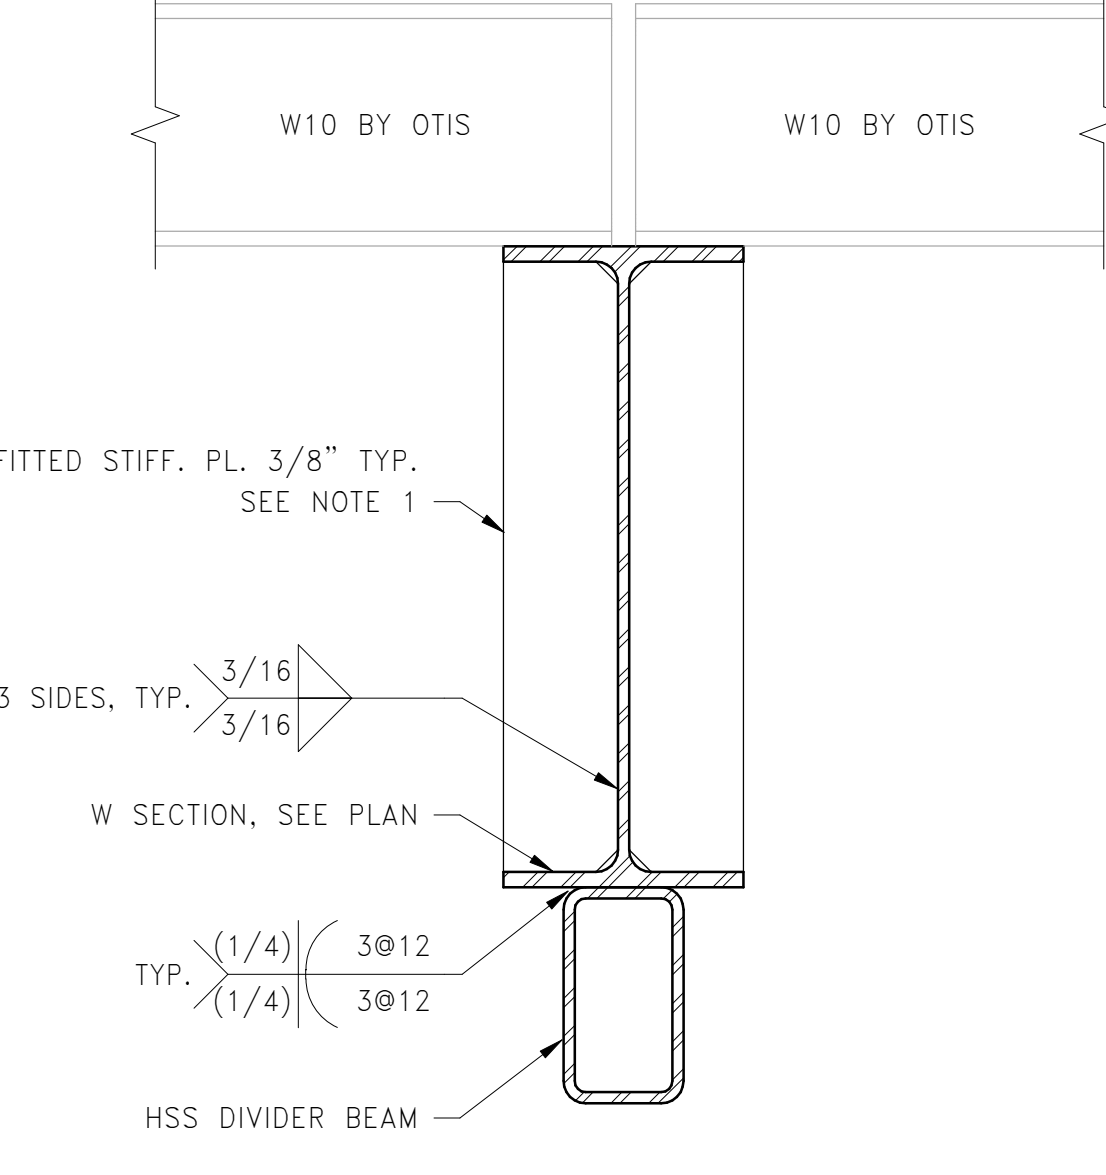


7 SECTION: CASSETTE SUPPORT WITH DIVIDER BEAM  
 1 1/2" = 1'-0"

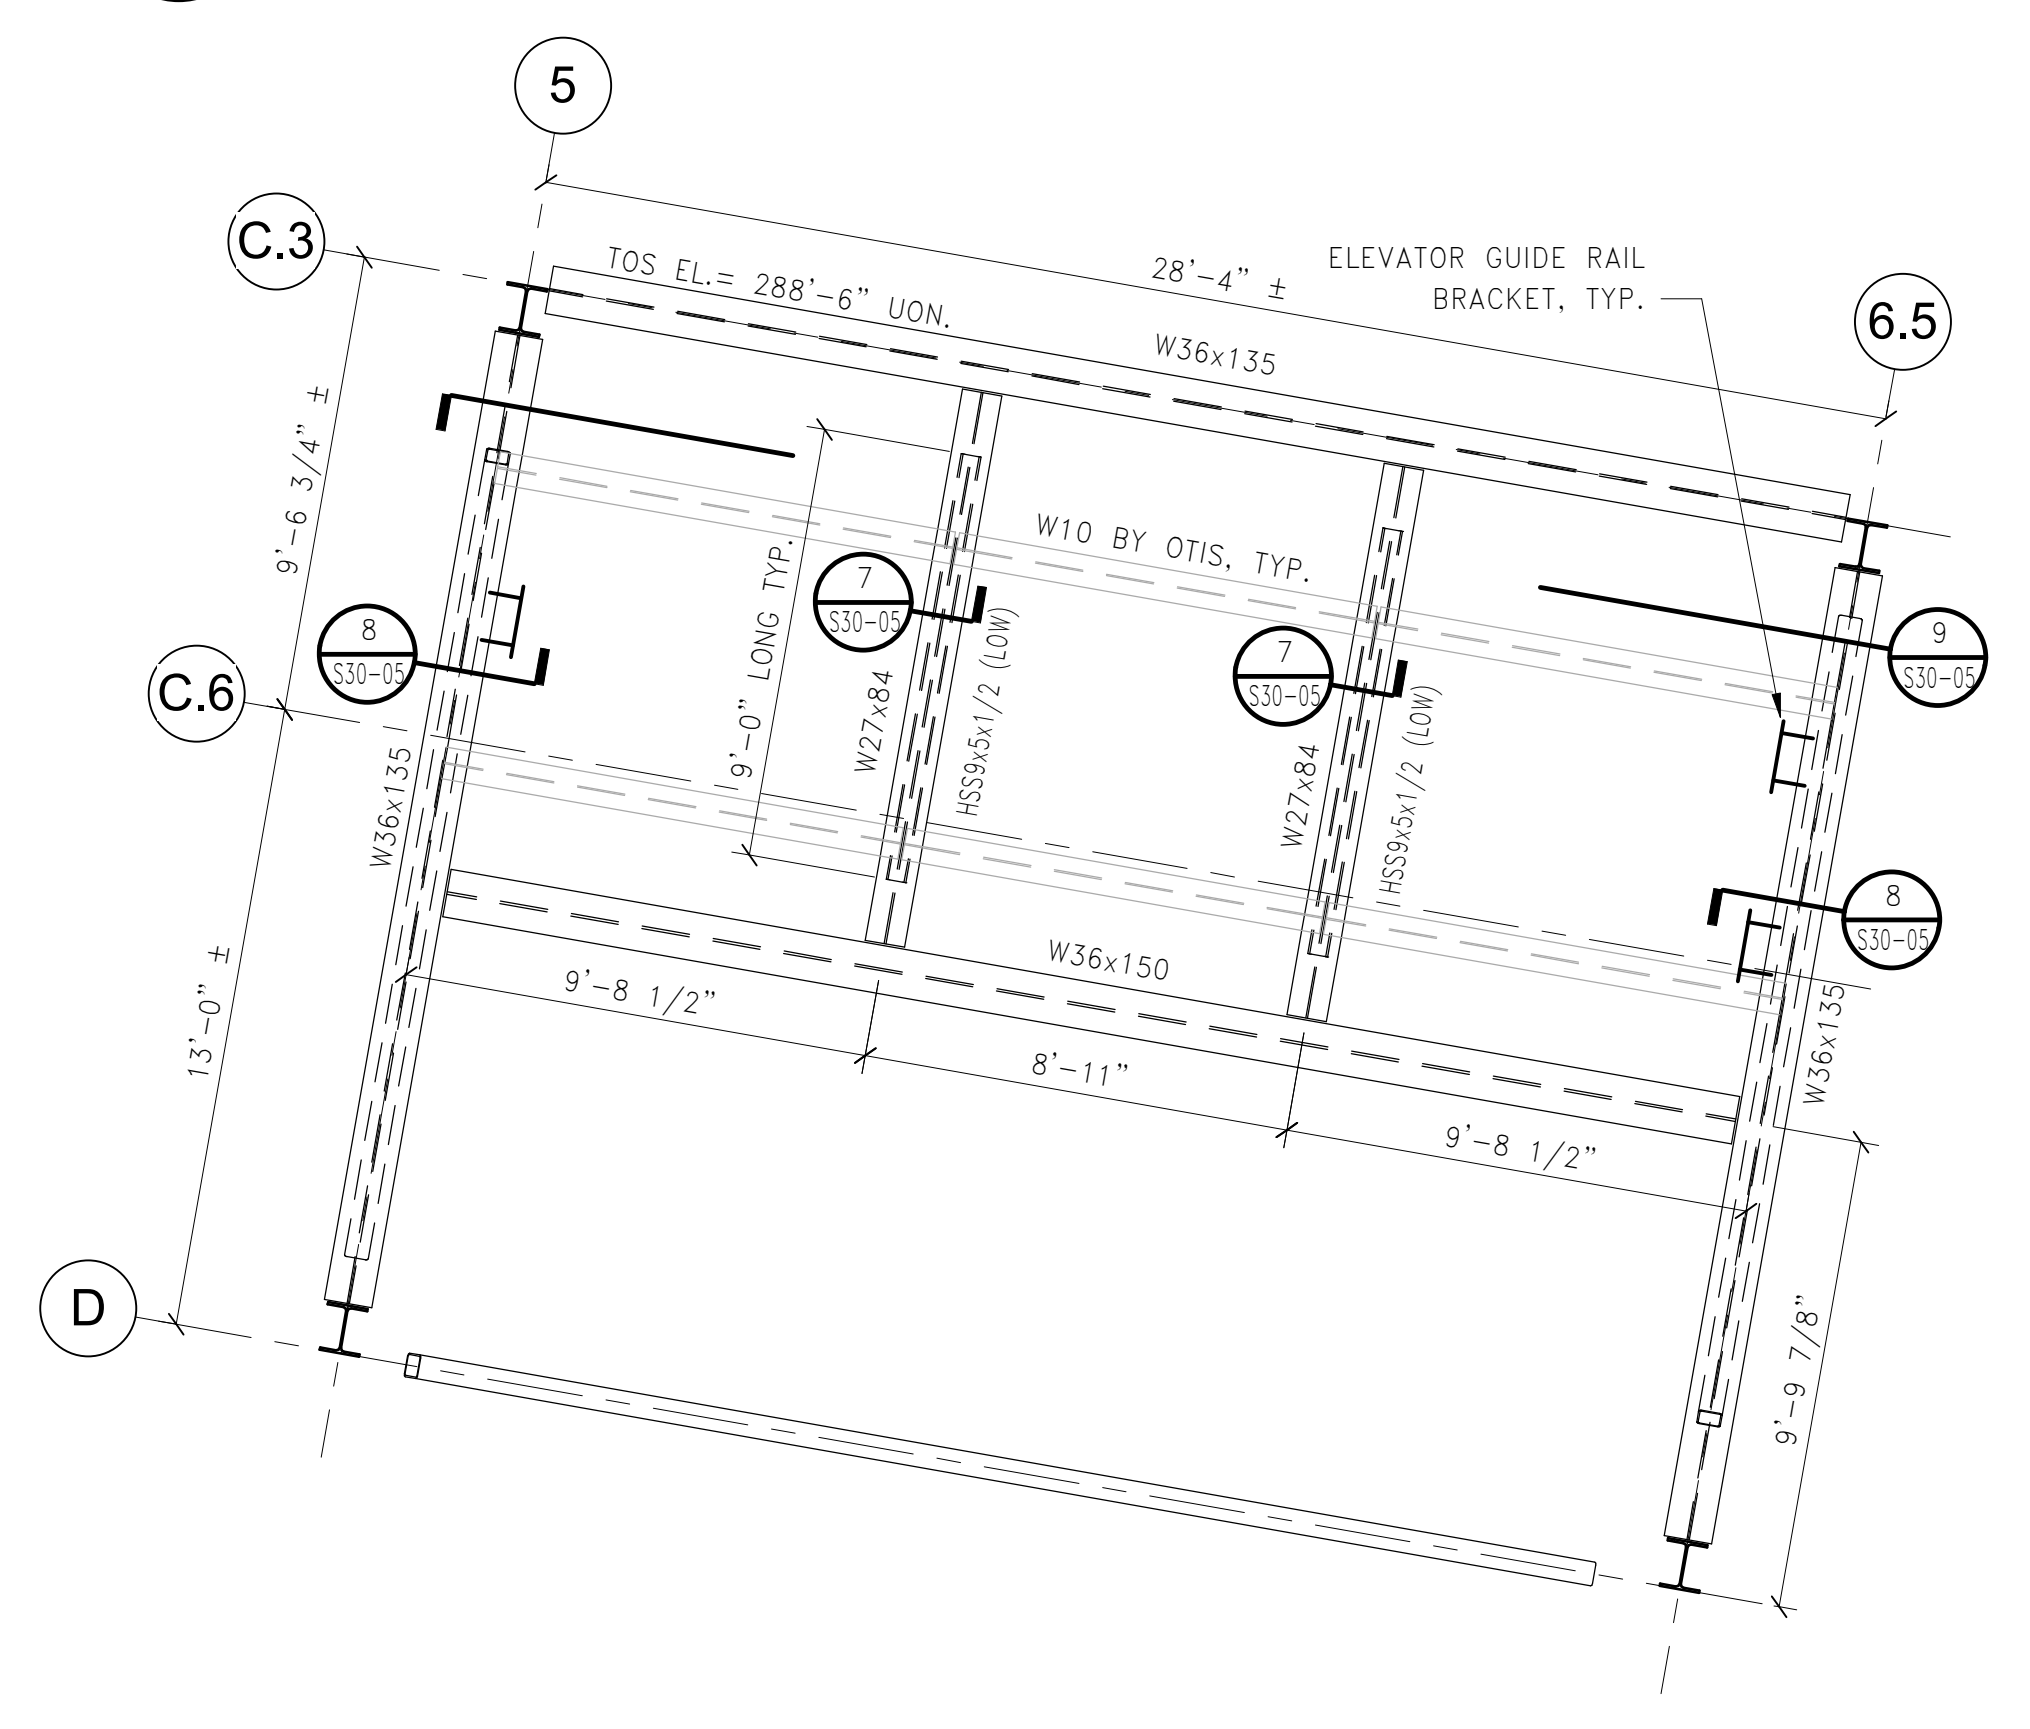


6 PART PLAN: ELEVATOR OVERRUN FRAMING  
 1/4" = 1'-0"

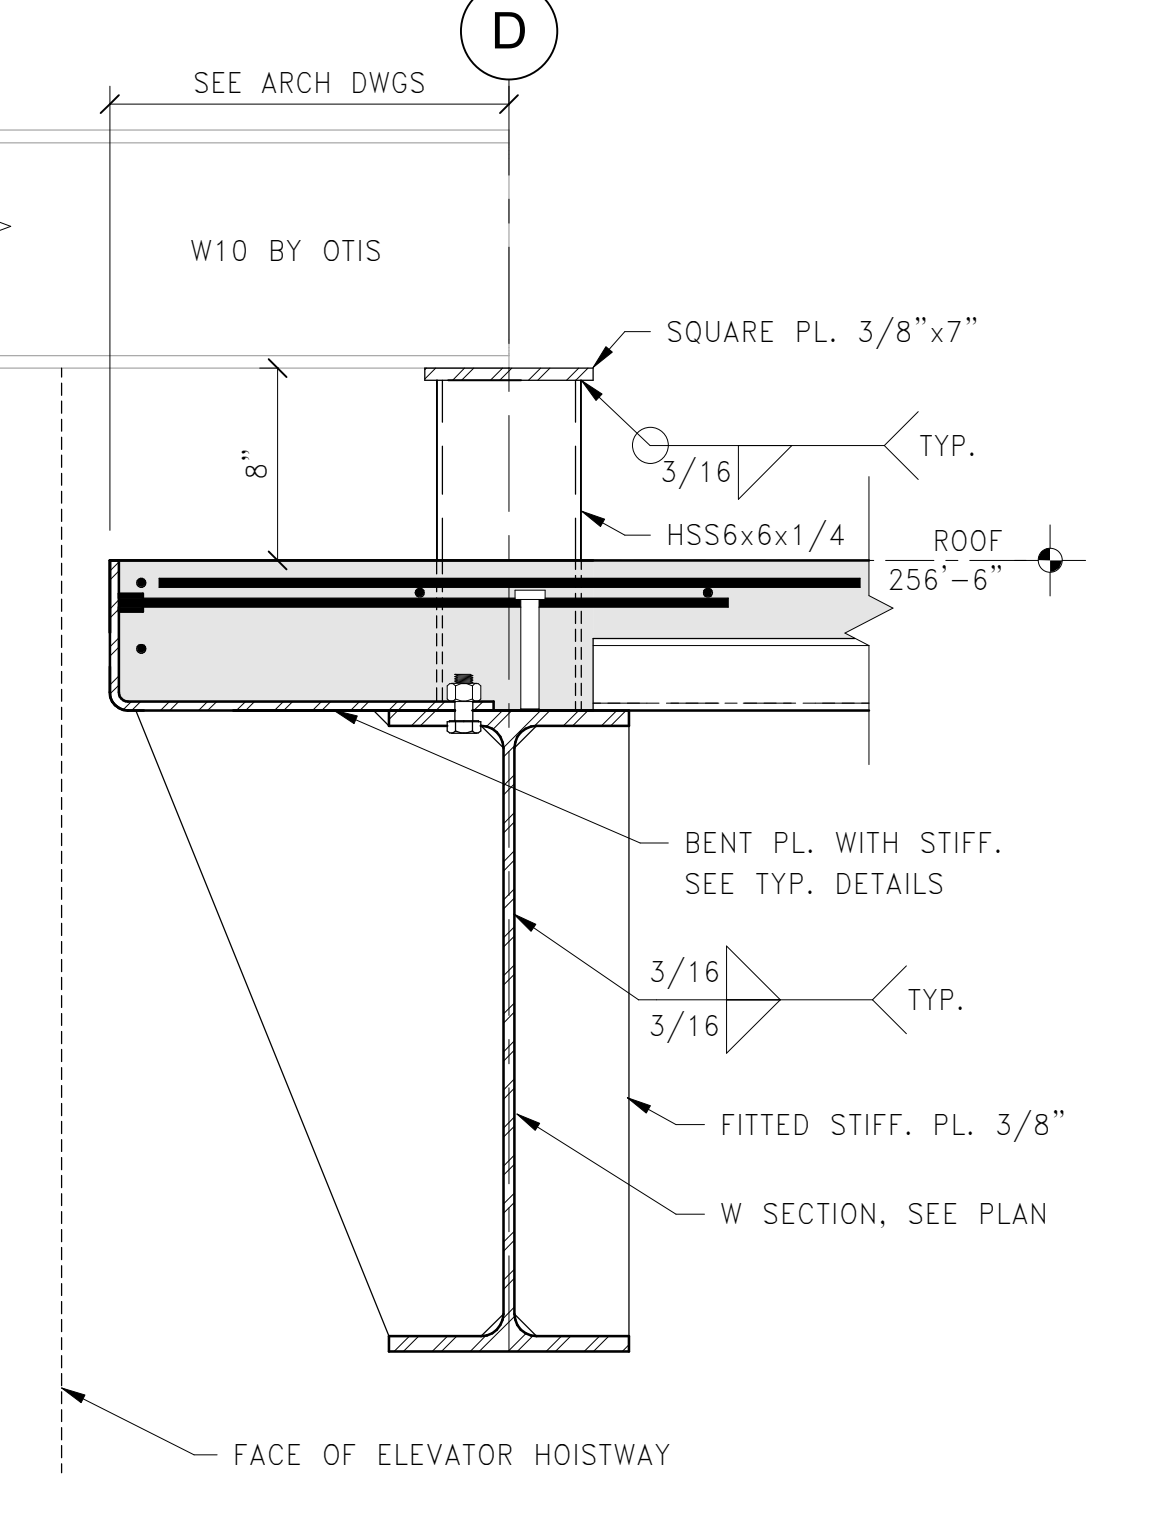


5 SECTION: CASSETTE BEAM AT SLAB  
 1 1/2" = 1'-0"

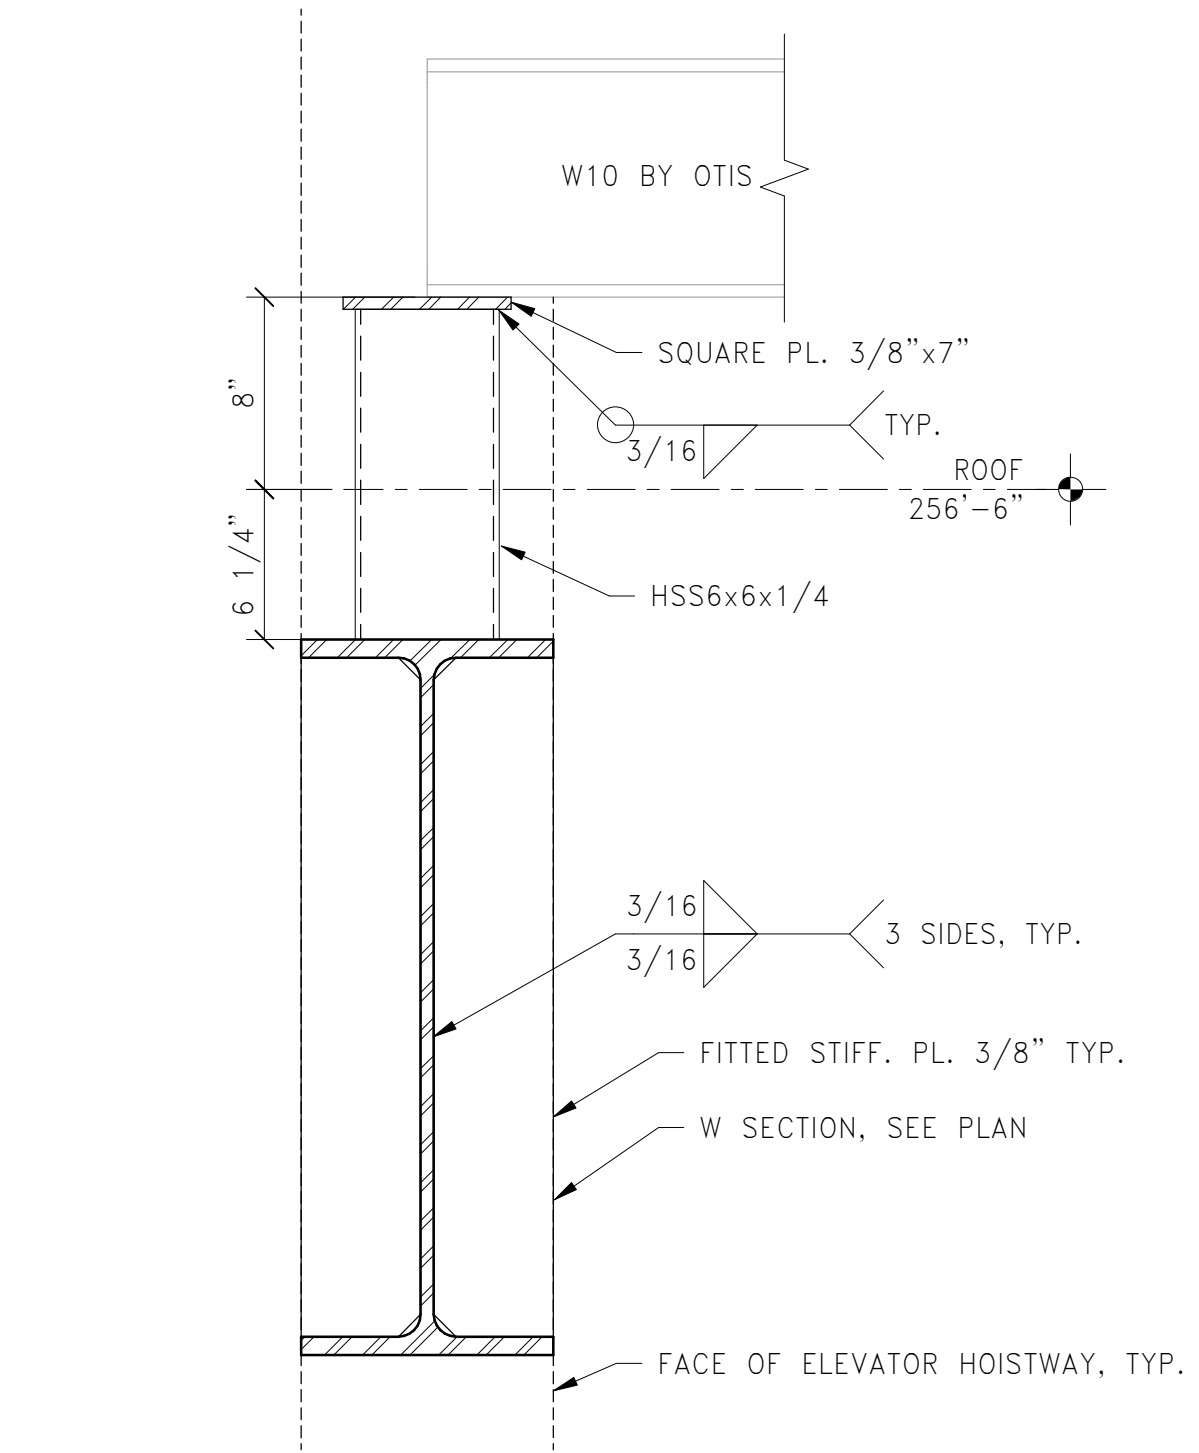


4 SECTION: ELEVATOR CASSETTE BEAM SHIM  
 1 1/2" = 1'-0"

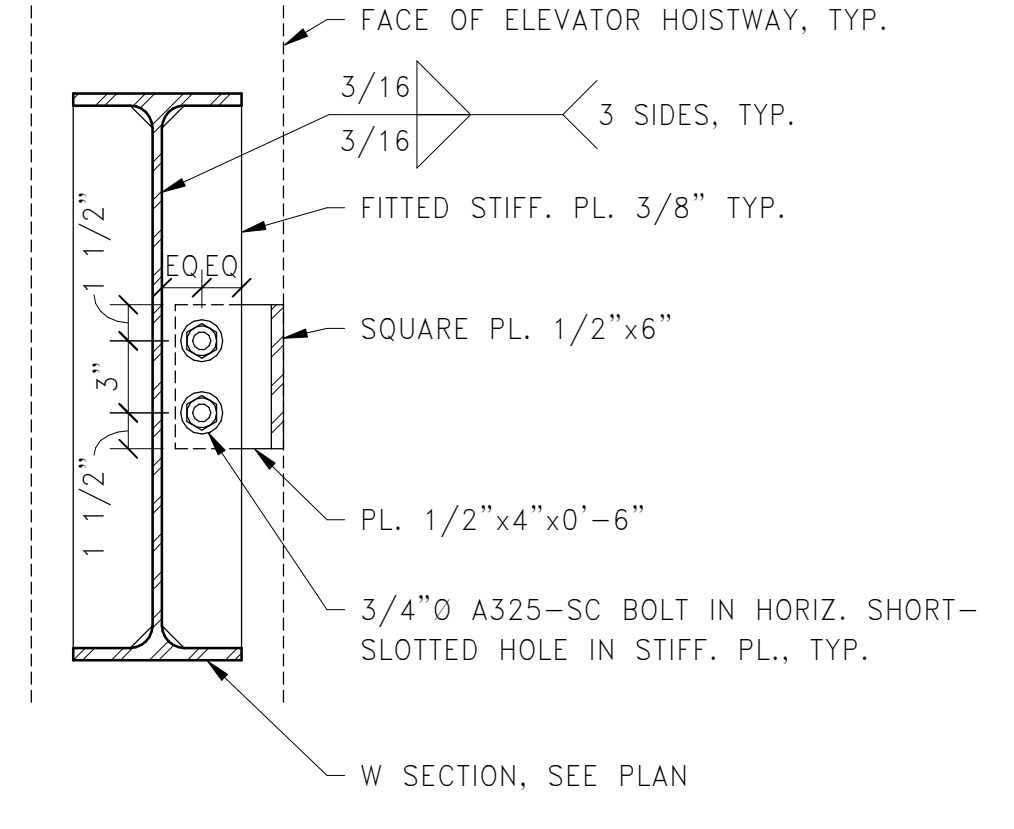

3 SECTION: TYPICAL COUNTERWEIGHT SUPPORT  
 1 1/2" = 1'-0"

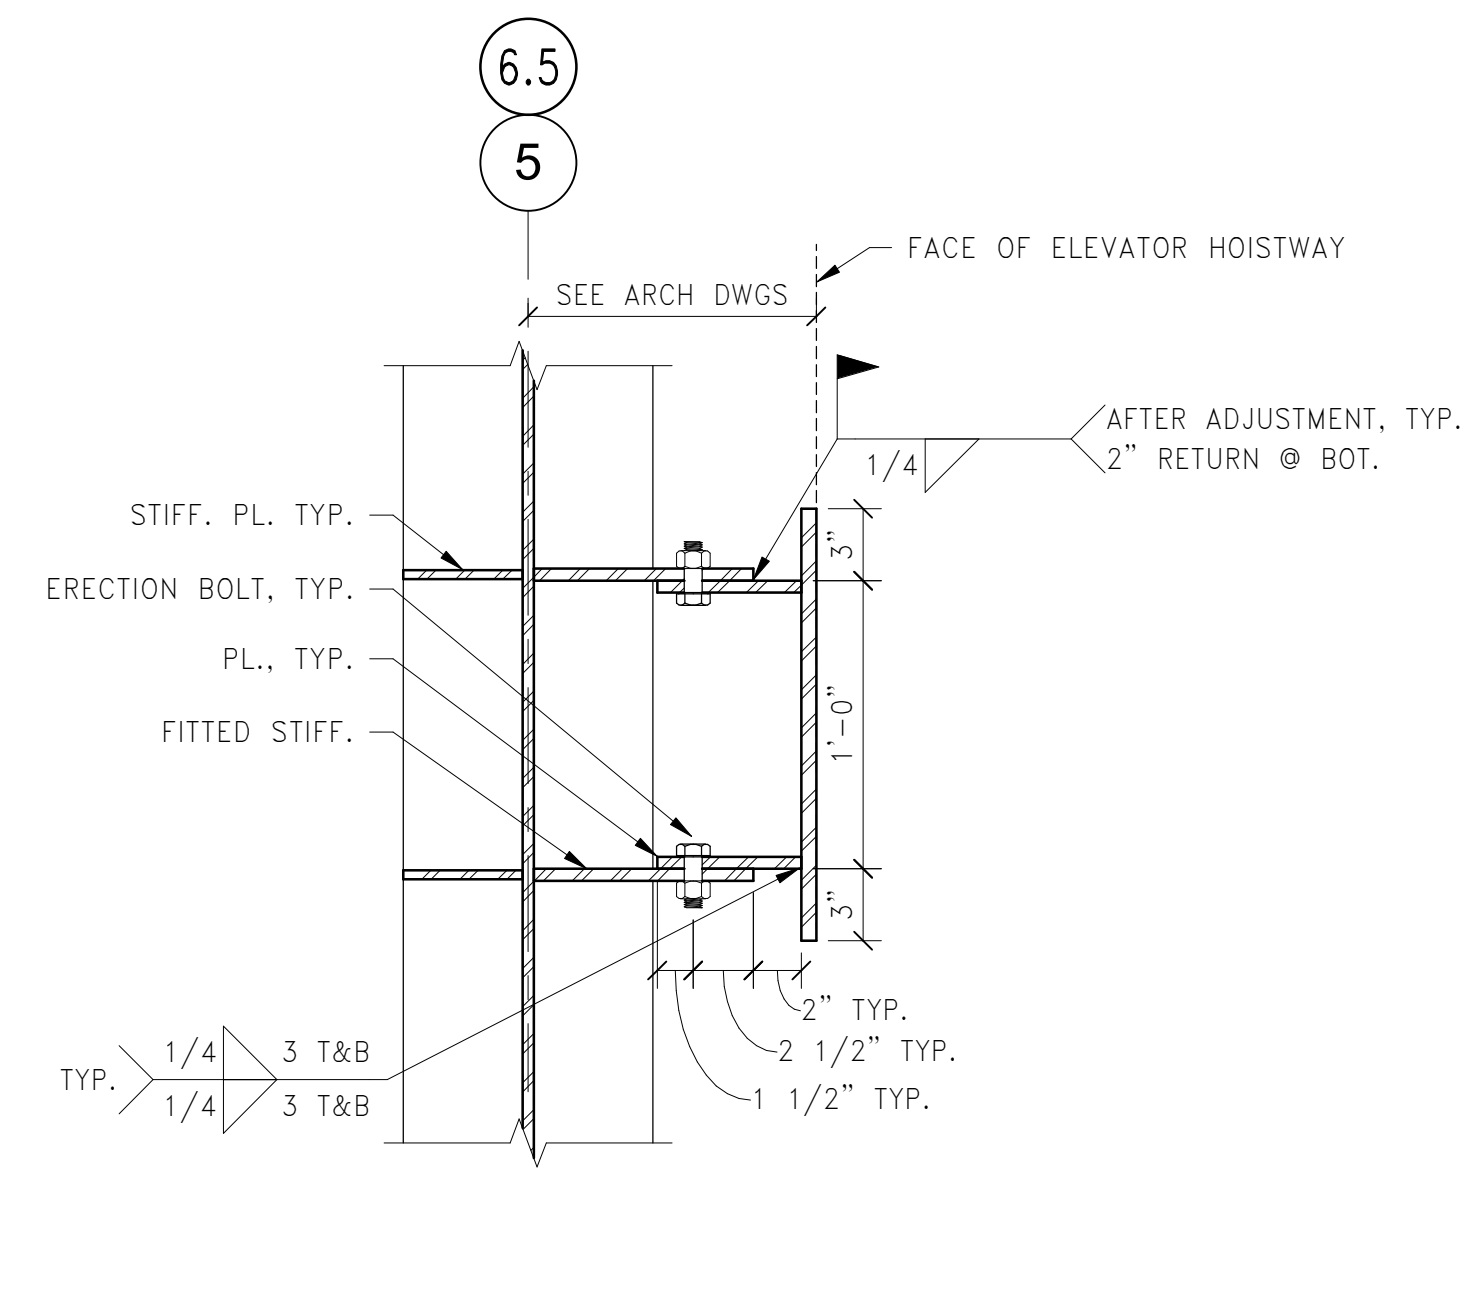

2 PLAN DETAIL: TYPICAL ELEVATOR GUIDE RAIL SUPPORT  
 1 1/2" = 1'-0"

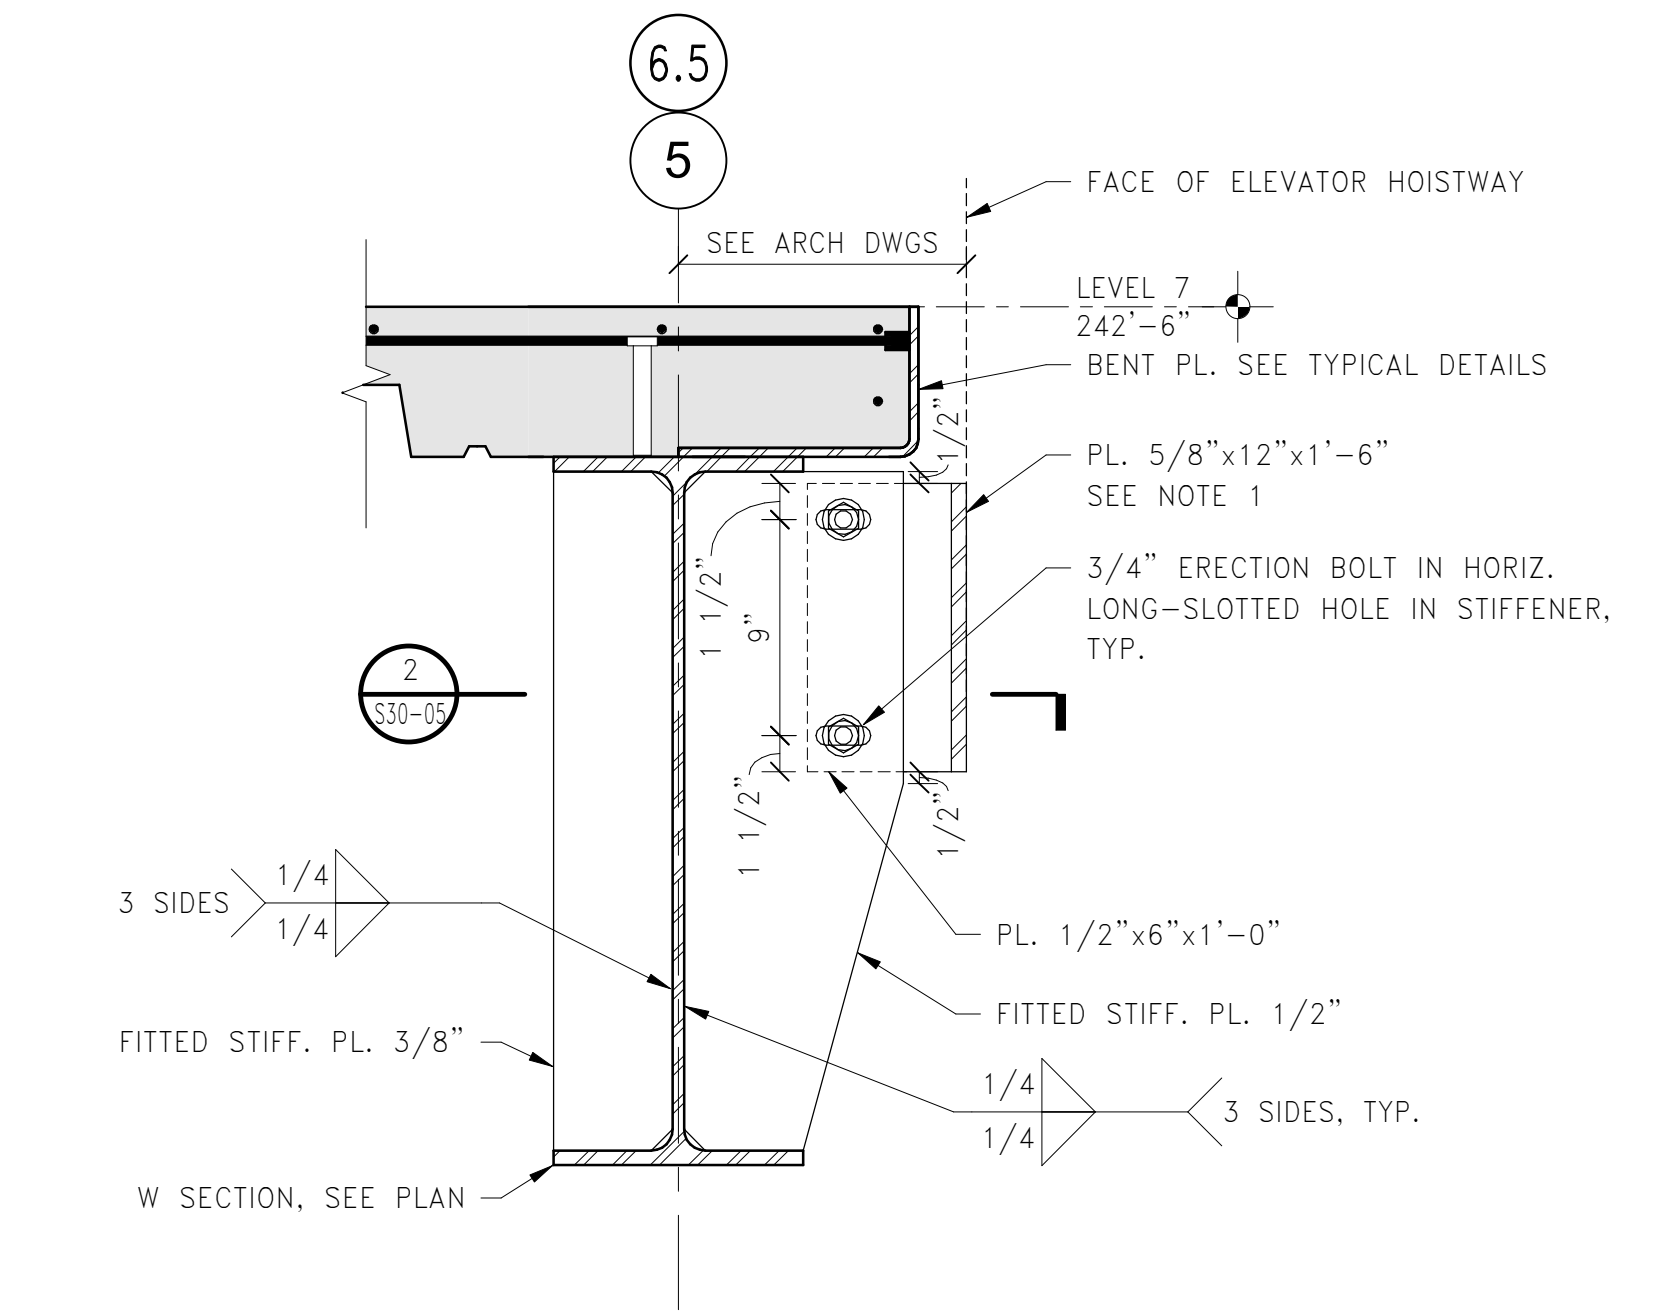

1 SECTION: TYPICAL ELEVATOR GUIDE RAIL SUPPORT  
 1 1/2" = 1'-0"

3/28/2018 9:20:28 AM I:\S3\Projects\2018\10\1093\_05\LMC\Drawings\Working\_Sets\Revit\LOCAL\_USER\REVIT\152181-MMC-EAST TOWER-0017\_STRUCT-REV.rvt