


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

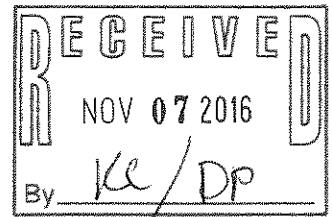

NOTICE OF VIOLATION AND ORDER TO CORRECT

October 27, 2016

Responsible Party 1: FERRY JOHN H & JAN M EAKINS JTS <i>Ricker Park Condominiums</i> 290 BAXTER BLVD #A3 <i>44 Indian Lane</i> PORTLAND, ME 04101		
Location 290 BAXTER BLVD	CBL 127 A003039	Inspection Date 10/5/2016
Inspector Todd Zsiga	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must complete the proposed date of completion column by proposing a reasonable timeframe to remedy each violation. This form must be received by the Fire Prevention Bureau no later than 11/15/2016. The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

YOUR FAILURE TO SUBMIT A PLAN OF ACTION BY THE DATE PROVIDED, OR TO CORRECT ANY VIOLATION WITHIN THE APPLICABLE TIME FRAME, MAY RESULT IN LEGAL ACTION AGAINST YOU, THE IMPOSITION OF CIVIL PENALTIES, AND THE PURSUIT OF OTHER LEGAL REMEDIES.

Violation	Proposed Date of Completion
NFPA 101-31.3.2.1 AND 31.3.2.1.1 PROTECTION OF HAZARDOUS AREAS NOT PROVIDED; Any hazardous area shall be protected in accordance with Section 8.7. The areas described in Table 31.3.2.1.1 shall be protected as indicated. Sprinkler in Laundry room	<u>1 / 1 / 17</u> <i>Need to meet with Fire Prevention Bureau</i>
NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6.	<u>11/15</u> <i>In progress</i> IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. hallway/stairways	<u>1 / 1 / 17</u>
NFPA 70- ARTICLE 110.12 B EXPOSED WIRING CONNECTIONS; Internal parts of electrical equipment, including busbars, wiring terminals, insulators, and other surfaces, shall not be damaged or contaminated by foreign materials such as paint, plaster, cleaners, abrasives, or corrosive residues. There shall be no damaged parts that may adversely affect safe operation or mechanical strength of the equipment such as parts that are broken; bent; cut; or deteriorated by corrosion, chemical reaction, or overheating. Basement	<u> / / </u> <i>Done.</i>

Violation	Proposed Date of Completion
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) water heater	___/___/___ Done
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Laundry room	11/30/16 <i>All stairways done need to clarify with EPB for laundry doors</i>
NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE; Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. hole in laundry room ceiling	11/30/16

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

11-4-16

Date

Robert D. Wellman property manager

Responsible Party

Date

Responsible Party

SEEN AND AGREED

11/2/2016

Date

Carl Peterson

Fire Prevention Bureau