


CITY OF PORTLAND  
 FIRE PREVENTION BUREAU  
 380 Congress Street, Portland, Maine 04101  
 fireprevention@portlandmaine.gov  
 (207) 874-8400

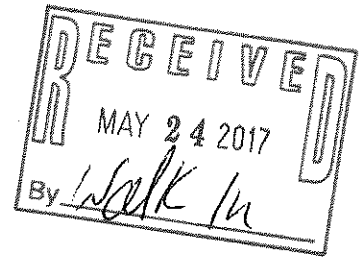

**NOTICE OF VIOLATION AND ORDER TO CORRECT**

May 5, 2017

<b>Responsible Party 1:</b> SCOTT LOMBARDI 38/40 East Kidder St PORTLAND, ME 04103		
<b>Location</b> 40 E KIDDER ST	<b>CBL</b> 163A E009001	<b>Inspection Date</b> 4/21/2017
<b>Inspector</b> Christopher Corey	<b>Inspection Type</b> FP Routine Inspection	<b>Status</b> Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

**You must send this form to the Fire Prevention Bureau no later than 5/30/2017.**

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
<b>PORTLAND FIRE DEPARTMENT CHAPTER 10 4.3.1, 4.3.2 BUILDING ADDRESS NOT MARKED ON BUILDING;</b> 4.3.1 Signs shall be located in a position readily visible as approaching from the main access and approved by the Fire Department. Signs shall be illuminated or retro reflective on a contrasting background and the letter(s) size shall be approved by the Fire Department. 4.3.2 Street Address shall be clearly marked on the front of the building and building sign as approved by the Fire Department. Missing numbers for 40	<u>6 / 24 / 17</u>
<b>NFPA 101- 7.2.1.15.8 FIRE DOOR ASSEMBLY REQ REPAIR;</b> Door openings not in proper operating condition shall be repaired or replaced without delay. fire door trim not installed in stairways	<u>7 / 24 / 17</u>
<b>NFPA 101-7.2.4.3.1 FIRE BARRIER REQUIRES MAINTENANCE;</b> Fire barriers separating buildings or areas between which there are horizontal exits shall have a minimum 2-hour fire resistance rating, unless otherwise provided in 7.2.4.4.1, and shall provide a separation that is continuous to the finished grounded level. Paneling in both stairways	<u>8 / 24 / 17</u>
<b>NFPA 101- 31.3.7 FLOOR/ CEILINGS ASSEMBLY NOT SMOKE-TIGHT;</b> In buildings other than those meeting the requirements of 31.3.7.1, 31.3.7.2, 31.3.7.3, 31.3.7.4, or 31.3.7.5, in addition to the following criteria to be met. stairways needs wall and ceiling repairs	<u>8 / 24 / 17</u>

Violation	Proposed Date of Completion
<p><b>NFPA 101- 7.5.1.1 EXIT OBSTRUCTED;</b> Where exits are not immediately accessible from an open floor area, continuous passageways, aisles, or corridors leading directly to every exit shall be maintained and shall be arranged to provide access for each occupant to not less than two exits by separate ways of travel, unless otherwise provided in 7.5.1.1.3 and 7.5.1.1.4. storage front and rear stairway</p>	<p>IMMEDIATELY remove all obstructions from the exits. Your signature below indicates that all obstructions have been removed and will not be replaced.</p>
<p><b>NFPA 101- 7.2.1.8.1 FIRE DOORS MUST BE SELF- OR AUTO-CLOSING;</b> A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. all fire doors need self closers and rating tags</p>	<p><u>10/24/17</u></p>
<p><b>NFPA 101-7.10.5.1 NORMAL ILLUMINATION FOR EXITS;</b> Every sign required by 7.10.1.2, 7.10.1.5, or 7.10.8.1, other than where operations or processes require low lighting levels, shall be suitably illuminated by a reliable light source. Externally and internally illuminated signs shall be legible in both the normal and emergency lighting mode. Need lighting front and rear stairs</p>	<p><u>6/24/17</u></p>
<p><b>NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED;</b> In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. Smokes needed 1st floor, and 2nd floor</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p><b>NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY;</b> NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OR OTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FT OF ANY STRUCTURE Grill on 3rd floor deck</p>	<p><u>6/24/17</u></p>
<p><b>NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED;</b> Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Need fire doors in stairways, and from basement into living unit</p>	<p><u>10/24/17</u></p>
<p><b>FINAL DATE OF COMPLETED VIOLATION(S)</b></p>	<p><u>10/24/17</u></p>
<p><b>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</b></p>	<p><u>11-1-17</u></p>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

**VIOLATOR CERTIFICATION**

*I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.*

*I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.*

*If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.*

5/24/17                      SCOTT LOMBARDI 749-1635  
Date                              Responsible Party

\_\_\_\_\_  
Date                              Responsible Party

**SEEN AND AGREED**

5/24/17                      CAPT. JRB #17  
Date                              Fire Prevention Bureau

