

CODED NOTES


- 1 EXISTING STEEL COLUMN SET 4" BELOW TOP OF SLAB TO BE REMOVED. PATCH WITH 3500 PSI CONCRETE TO MATCH FINISHED FLOOR ELEVATION.
- 2 DEMOLISH EXISTING WALL FOR DOOR OPENING. COORDINATE DEMOLITION EXTENT WITH ARCH. DRAWINGS.
- 3 EXISTING OPENING TO BE FILLED WITH 2x8 WOOD STUD WALL.
- 4 NEW #6x26 STEEL COLUMN SEE 7/54 FOR DETAIL.
- 5 NEW #6x15 STEEL COLUMN SEE 8/54 FOR DETAIL.
- 6 NEW CONC. PIER, SEE 7/54 FOR DETAIL.
- 7 NEW CONC. FOOTING, SEE 7/54 FOR DETAIL.
- 8 ANCHOR 2x6 INFILL STUDS TO CMU WITH 1/2" DIA. HILTI HY20 ANCHORS AT 16" O.C.

FOUNDATION NOTES

- 1. FIELD VERIFY LOCATIONS OF COLUMNS, WALLS AND OPENING, ETC., WITH ARCHITECTURAL DRAWINGS BEFORE PROCEEDING WITH WORK.
- 2. FOUNDATION WALL IS ASSUMED TO BE IN GOOD CONDITION. NOTIFY STRUCTURAL ENGINEER IF DAMAGED BEFORE PROCEEDING WITH WORK.
- 3. EXISTING CONCRETE SLAB ON GRADE - 4" CONCRETE FLOOR SLAB W/ WIRE MESH OVER 6 MIL POLYTHENE - 6" OF COMPACTED GRAVEL W/ 1" COVERING OF SAND.
- 4. EXISTING FOUNDATION WALL - 12" CONCRETE WALL W/ 4"x8" DEEP BRICK LEDGE, TYP.
- 5. EXISTING STRUCTURE DATA HAS BEEN OBTAINED FROM EXISTING STRUCTURAL DRAWINGS.
- 6. FREEZER AND COOLER SLAB ASSUMED TO BE IN GOOD CONDITION. NOTIFY A/E IF ANY DAMAGE EXISTS BEFORE PROCEEDING WITH WORK.

REVISIONS:

Atlanta
Boston
Chicago
Dallas
Los Angeles
Miami
Sacramento

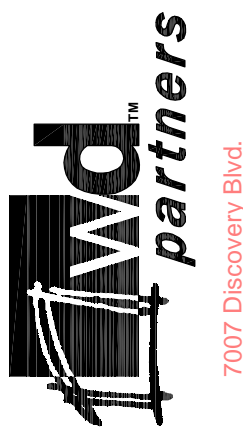

7007 Discovery Blvd.
Dublin, OH 43017
614.834.4000
614.834.7777 F
wppartners.com

Tim Hortons
1408 CONGRESS STREET
PORTLAND, ME 04102

FOUNDATION PLAN

DRAWN BY: DDS CHECKED BY: MLL

SAI # 0838

DRAWING NUMBER:

S1

DATE ISSUED: 07-02-2008

