

SHEET NOTES

- 01 TERMINATE SRC 12" ABOVE FINISHED GRADE WITH DC.
- 02 SEE CO2.01 FOR CONTINUATION.
- 03 SEE CO2.02 FOR CONTINUATION.
- 04 1/2" PEX TUBING FROM TRAP PRIMER BELOW FL TO TRAP.
- 05 1 1/2" SUMP PUMP DISCHARGE UP
- 06 FOR CONTINUATION SEE P02.02.05.
- 07 2" COOLING CONDENSATE INDIRECT WASTE 36" AFF.
- 08 COORDINATE LOCATION OF FLOOR DRAIN W/ AC CONDENSATE DRAIN ON BAGGAGE SCREENING UNIT.
- 09 RUN 1/2" PEX TRAP PRIMER LINE ADJACENT TO C.I. VENT LINE TIGHT TO FOUNDATION WALL. PROVIDE GUARD AROUND BOTH LINES FROM FLOOR LEVEL TO 6'-0" AFF. REFER TO DETAIL 4 ON SHEET P12.23.
- 10 RUN PIPING ON SIDES OF COLUMN. KEEP FACE OF COLUMN CLEAR FOR INSTALLATION OF SECURITY & ALARM EQUIPMENT & APPARATUS.
- 11 TIE 2" FORCE MAIN INTO TOP OF 3" SANITARY LINE W/ 45° WYE.

Portland International Jetport
 1001 Westbrook Street
 Portland, Maine 04102

Gensler

oest ASSOCIATES, INC.
 363 Goshen Road, South Portland, ME 04106 P (207) 741-1770 F (207) 774-2461 www.oest.com
 engineers • architects • surveyors • construction managers


2020 K Street, NW
 Suite 200
 Washington, DC 20006
 Telephone 202.721.5200
 Facsimile 202.872.8587

GENERAL NOTES

A SEE SHEET P00.00 FOR LEGEND AND GENERAL NOTES.

Issue	Date	Issue Description	By	Check
01	12/03/08	75% DESIGN DEVELOPMENT	KLM	JS
02	01/23/09	95% CONSTRUCTION DOCUMENTS	CM	JS
02	10/26/09	ISSUED FOR PERMIT	PWZ	JS

KEY PLAN

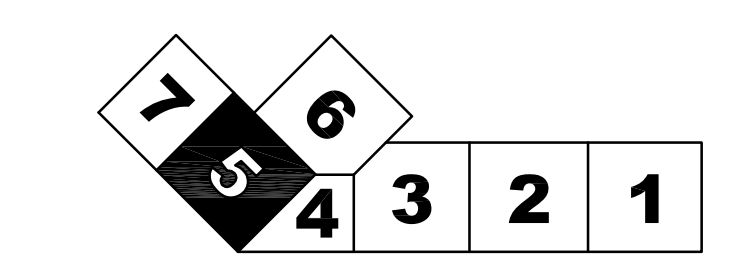

PLUMBING PLAN - LEVEL 1 - ZONE 5
 SCALE: 1/8" = 1'-0"

Project Name
 PWM Terminal Enhancement

Project Number
 09-6395-000

CAD File Name
 T:\6330\101\Sheets\P02.01.05.dwg

Description
 PLUMBING PLAN - LEVEL 1 - ZONE 5

Scale
 1/8" = 1'-0"

Ref. North

P02.01.05

©2009 Gensler