

PLAN KEY NOTES

- 1 INFILL WALL TO EXTENTS REQUIRED WHERE DOOR HAS BEEN REMOVED; FLUSH WITH EXISTING WALL ON BOTH SIDES, MATCH EXISTING WALL CONSTRUCTION.
- 2 MECHANICAL GRILLS CENTERED IN GRID, RE:
- 3 RELOCATE DOORS AND STOREFRONT.
- 4 PROVIDE RUBBER TILE FLOORING TO MATCH
- 5 REINSTALL/NEW STOREFRONT.
- 6 DECORATIVE METAL WALL END CAP, SEE 9/2.AE520.
- 7 COVE LIGHTING
- 8 REMOVE ALL FASTENERS, BOXES OR OTHER ITEMS AND REPAIR CONCRETE FOR PAINT. PAINT TO MATCH.
- 9 REFER TO ELECTRICAL FOR LIGHT FIXTURES. CENTER LIGHT FIXTURES IN RECESS TO MATCH EXISTING.
- 10 REINSTALL CEILING AS SHOWN OR PROVIDE MATCHING PANELS/AS REQUIRED FOR CONSISTENT APPEARANCE.
- 11 LIGHT FIXTURE, RE: ELEC.
- 12 RELOCATED EXISITNG LIGHT FIXTURE, RE: ELEC.
- 13 TEMPORARILY PROVIDE OPENING FOR PUBLIC AT THIS LOCATION. RELOCATE AT COMPLETION.
- 14 PROVIDE NEW CEILING MOUNTED SIGNS "DEPARTURES ALL AIRLINES

TICKETING TSA SCREENING ---->


ARRIVALS BAGGAGE CLAIM <---- GROUND TRANSPORTATION

15 REINSTALL SIGN "RESTROOMS"

- 16 16 PROVIDE NEW CEILING MOUNTED SIGN: BAGGAGE CLAIM GROUND TRANSPORTATION"
- 17 REMOVE "ELEVATOR" SIGN AT COMPLETION & REPAIR WALL
- 18 PROVIDE NEW CEILING MONTE SIGN (2 SIDES) "PARKING RENTAL CARS"
- 19 REINSTALL TOILET ROOM ADA SIGNS
- 20 NEW TILE AREA, ROOM [1200] CIRCULATION
- 21 FLOOR DOOR, LOCATED ABOVE EXISTING [→] CONDUITS
- 22 REMOVE TEMPORARY PARTITION AT WORK COMPLETION
- 23 PROVIDE GYPSUM BOARD AND WOOD WALL CAP TO FINISH CUT RAILING END FLAT.
- 24 REPLACE TILES REMOVED OR DAMAGED BY CONSTRUCTION WITH TILE TO MATCH EXISTING.
- 25 TEMPORARY PARTITION DOOR IS TO HAVE A LOCK WITH A KEY PROVIDED TO THE FACILITY

GENERAL NOTES


- 1. SEE SHEET 2.G-001 FOR GENERAL PROJECT NOTES, LEGENDS, AND ABBREVIATIONS.
- 2. SEE SHEET 2.G-002 FOR WALL TYPES, ROOF TYPES, TOP OF WALL DETAILS, AND GENERAL MOUNTING HEIGHTS.
- 3. CONTRACTOR IS RESPONSIBLE FOR REVIEWING CODE COMPLIANCE PLANS AND NOTIFYING THE ARCHITECT OF CONFLICTS BETWEEN WHAT IS IN THE FIELD AND ON THE CODE DOCUMENTS.
- 4. DIMENSIONS ARE FACE OF CONCRETE, FACE OF MASONRY, AND CENTERLINE OF STUD, UNLESS NOTED OTHERWISE.
- 5. DOOR JAMBS (HINGE SIDE) SHALL BE 6" FROM CORNER IN STUD PARTITIONS AND 8" FROM CORNER IN MASONRY PARTITIONS UNLESS NOTED OTHERWISE.
- 6. REFER TO DETAILS FOR ADDITIONAL DIMENSIONING INFORMATION. REFER TO ENLARGED PLANS FOR PARTITIONS TYPES AND DIMENSINOS IN AREAS WHICH ARE DETAILED AT A LARGER SCALE.
- 7. FURNITURE AND OWNER PROVIDED EQUIPMENT ARE INDICATED BY DASHED LINE TYPE.
- 8. CONTRACTOR IS RESPONSIBLE FOR THE COORDINATION OF OWNER PROVIDED EQUIPMENT INCLUDING BUT NOT LIMITED TO DIMENSIONAL INFORMATION, AND MECHANICAL, ELECTRICAL, AND PLUMBING REQUIREMENTS.

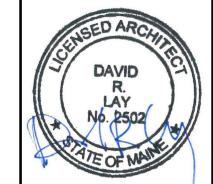

PORTLAND INTERNATIONAL JETPORT
VERTICAL CIRCULATION IMPROVEMENTS
1001 WESTBROOK STREET
1001 WESTBROOK STREET

SCALE 12/21/17 As indicated

2.AE102

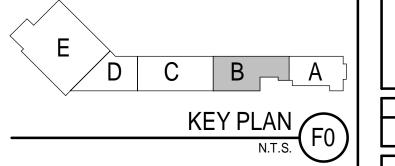

PROJECT NORTH: