





17 LOCATIONS at CREDENZAS or COUNTERS

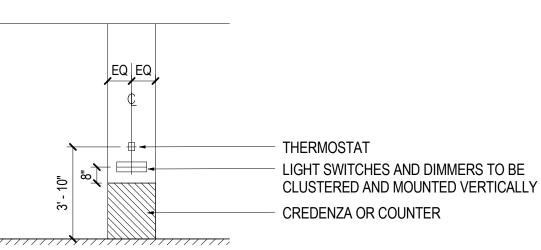



18 LOCATIONS at CREDENZAS or COUNTERS

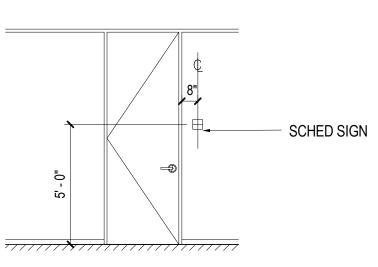

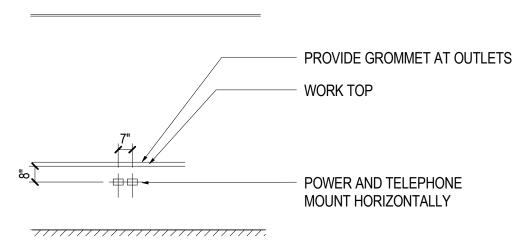


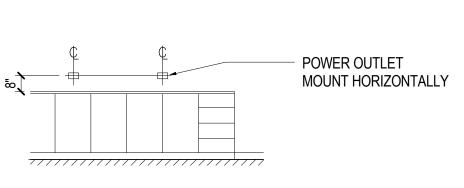

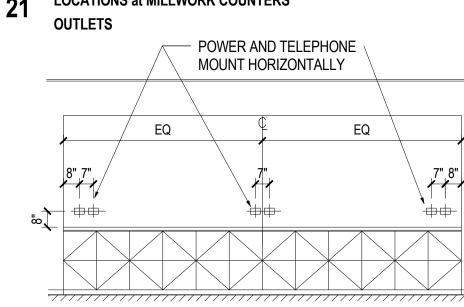


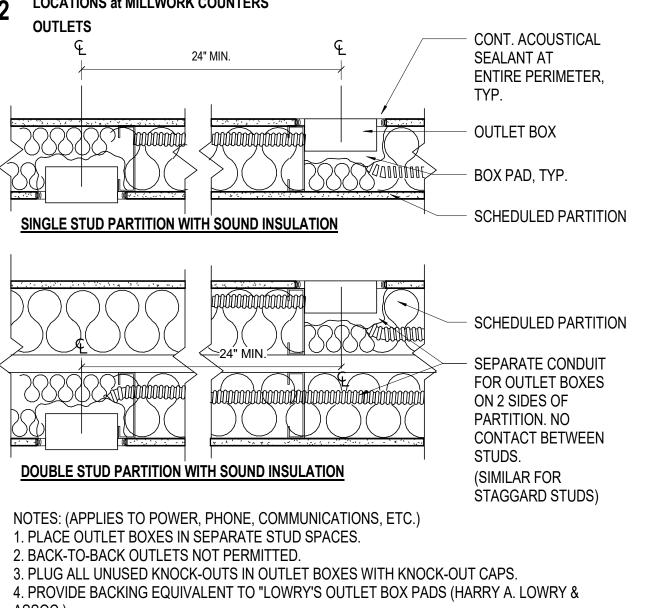


BACK TO BACK OUTLET BOX DETAIL

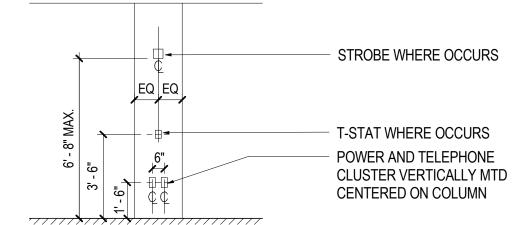


LOCATIONS at COLUMNS, BETWEEN DOORS, ETC. **OUTLET GROUPS, STROBES and THERMOSTATS** 

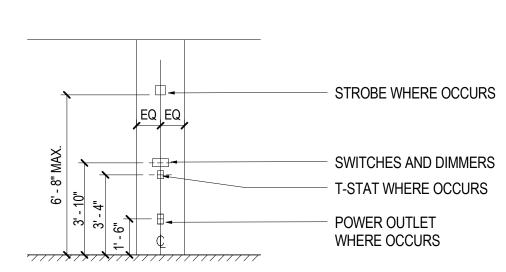


LOCATIONS at COLUMNS, BETWEEN DOORS, ETC. **SWITCHES, STROBES and THERMOSTATS** 

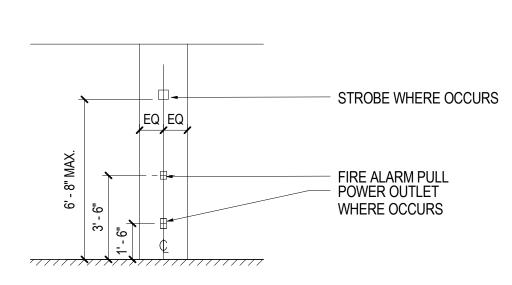


11 LOCATIONS at COLUMNS, BETWEEN DOORS, ETC. **OUTLETS, STROBES and FIRE ALARM PULLS** 

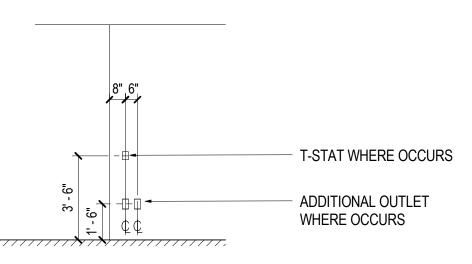


12 LOCATIONS at CORNERS OUTLETS

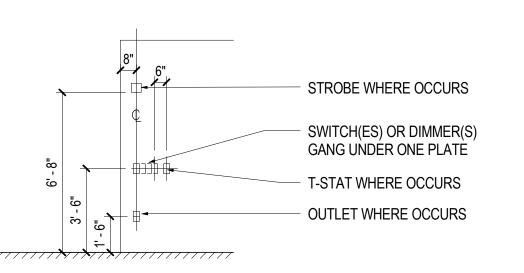


13 LOCATIONS at CORNERS SWITCHES, OUTLETS, STROBES and THERMOSTATS

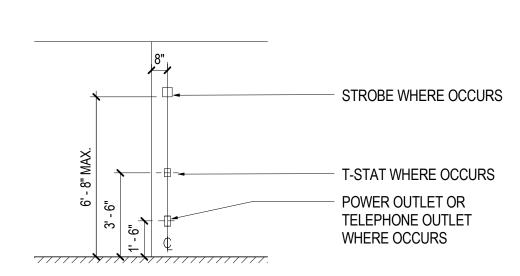


14 LOCATIONS at CORNERS **OUTLETS, STROBES and THERMOSTATS** 

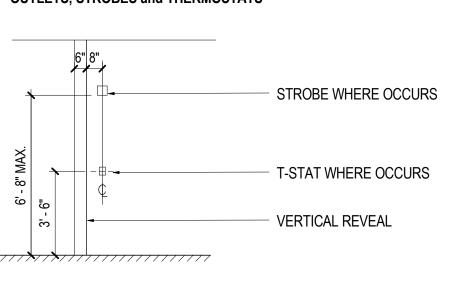


LOCATIONS at CORNERS with REVEALS

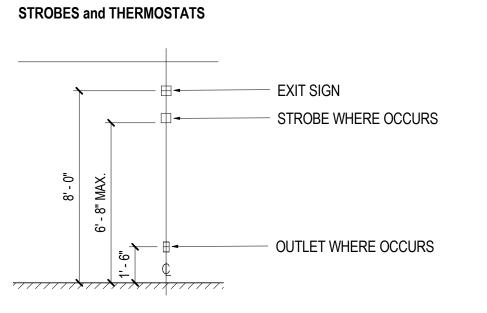


16 LOCATION FOR EXIT SIGNS (WALL MOUNTED)

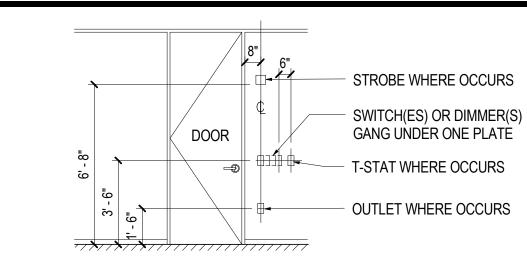


LOCATIONS at DOOR JAMBS **SWITCH and THERMOSTAT** 

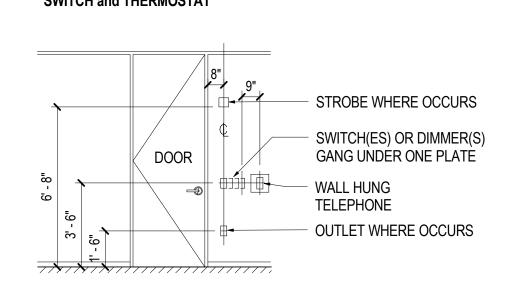


LOCATIONS at DOOR JAMBS SWITCH and TELEPHONE

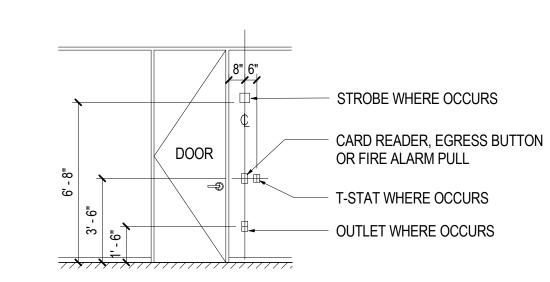


**LOCATIONS at DOOR JAMBS** CARD READER, EGRESS BUTTON or

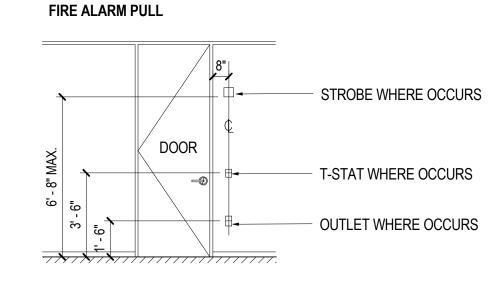


LOCATIONS at DOOR JAMBS THERMOSTAT, STROBE or OUTLET

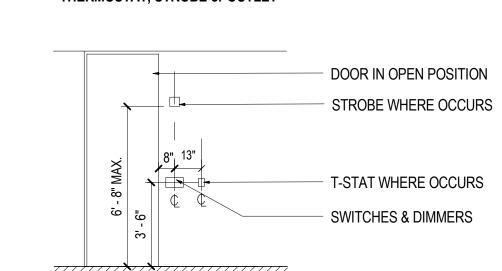


**LOCATIONS at OPEN DOORS** 

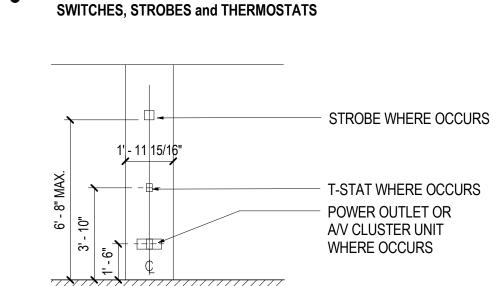

LOCATIONS at COLUMNS, BETWEEN DOORS, ETC.

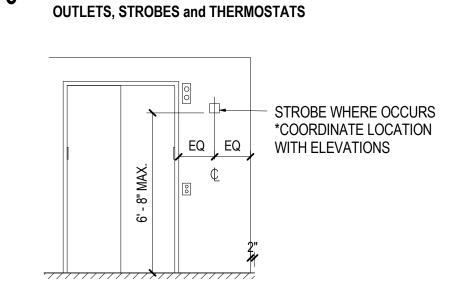

LOCATIONS at FREIGHT ELEVATORS STROBES

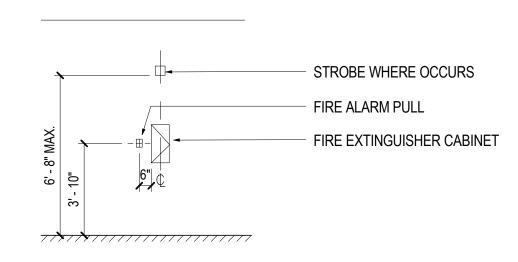

LOCATIONS at FIRE EXTINGUISHER CABINET STROBES and FIRE ALARM PULLS

2211 Congress Street Portland, ME 04122

Gensler

United States

214 North Tryon Street Suite 2320 Charlotte, NC 28202 Tel 704.377.2725 Fax 704.377.2807

Date Description 12/15/17 ISSUE FOR PERMIT & CONSTRUCTION

Seal / Signature

Unum Workplace Transformation - Phase 2 & 3 (HO2 & HO3) Project Number

59.6481.003 Description **ADA INFORMATION & TYPICAL** MOUNTING HEIGHTS

Scale As indicated

G00.003

© 2017 Gensler