


## Frame & Door Schedule (2nd Floor)

DOOR NO.	LOCATION (opens into)	LABEL	FRAME						DOOR						REMARKS	
			MATERIAL	TYPE	JAMB OPENING			DETAIL		MATERIAL	THRESHOLD	UNDERCUT	HARDWARE	SECURITY		
					WIDTH	HEIGHT	DEPTH	HEAD	JAMB							
200	Hall - Rm #201	45 Min	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D2	WD	none	EXIST	X	YES	Fire rated door w/ alarm released magnetic door hold open
201	Bedroom - Rm #209	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	Solid core Masonite (or equiv) door.
202	Bedroom - Rm #208	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	Solid core Masonite (or equiv) door.
203	Bedroom - Rm #207	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	Solid core Masonite (or equiv) door.
204	Study - Rm #206	none	HM	F1	3'-2"	6'-9"	4 1/2"	H3	J04	D2	WD	none	1/2"	D	—	Solid core Masonite (or equiv) door with tempered lite.
205	Bathroom - Rm #205	none	HM	F1	3'-2"	6'-9"	4 1/2"	H2	J02	D1	WD	none	1/2"	C	—	Solid core Masonite (or equiv) door.
206	Office - Rm #204	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	D	—	Solid core Masonite (or equiv) door.
207	Office - Rm #109	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	none	EXIST	D	—	Existing door, replace hardware, add strike cover
208	Hall - Rm #201	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	none	EXIST	D	—	Existing door, replace hardware, add strike cover
209	Sitting - Rm #200	45 Min	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D2	WD	none	1/2"	X	YES	Fire rated door w/ alarm released magnetic door hold open
210	Bathroom - Rm #211	none	HM	F1	3'-2"	6'-9"	4 1/2"	H2	J02	D1	WD	none	1/2"	C	—	none
211	Bedroom - Rm #212	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
212	Bedroom - Rm #214	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
213	Foyer - Rm #116	45 Min	HM	F1	EXIST	EXIST	EXIST	EXIST	EXIST	D1	WD	none	1/2"	I	—	Existing door, replace hardware.
214	Bedroom - Rm #200	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
215	Hall - Rm #216	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	E	—	none
216	Life Space - Rm #217	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D3	WD	none	1/2"	G	—	none
217	Bedroom - Rm #217	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
218	Bedroom - Rm #220	none	HM	F1	2'-8"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
219	Bathroom - Rm #221	none	HM	F1	2'-8"	6'-9"	4 1/2"	H2	J02	D1	WD	none	1/2"	C	—	none


## Frame & Door Schedule (1st Floor)

DOOR NO.	LOCATION (opens into)	LABEL	FRAME						DOOR						REMARKS	
			MATERIAL	TYPE	JAMB OPENING			DETAIL		MATERIAL	THRESHOLD	UNDERCUT	HARDWARE	SECURITY		
					WIDTH	HEIGHT	DEPTH	HEAD	JAMB							
100	Lobby - Room #100	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	Alum	EXIST	A	YES	Replace existing threshold. Replace entry hardware, install new delayed egress locks to existing door.
101	Staff Area - Rm #101	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D2	WD	none	1/2"	B	—	Solid core Masonite (or equiv) door with tempered lite.
102	Staff Area - Rm #101	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	C	—	Privacy hardware on solid core Masonite slab.
103	Office - Rm #104	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	D	—	Solid core Masonite (or equiv) door with tempered lite.
104	Office - Rm #105	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	D	—	Solid core Masonite (or equiv) door with tempered lite.
105	Hall - Rm #107	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	E	—	Solid core Masonite (or equiv) door.
106	Life Space - Rm #108	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D3	WD	none	1/2"	G	—	Solid core Masonite (or equiv) door.
107	Toilet - Rm #109	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	none	EXIST	C	—	Reverse swing of existing door, update hardware.
108	Library - Rm #401	none	HM	F2	6'-2"	6'-9"	4 1/2"	H1	J01	D4	WD	none	1/2"	H	—	Foot bolts in left hand leaf.
109	Lounge - Rm #111	none	HM	F2	6'-2"	6'-9"	4 1/2"	H1	J01	D4	WD	none	1/2"	H	—	Foot bolts in left hand leaf.
110	Staff Station - Rm #114	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	E	—	none
111	Dining Room - Rm #115	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	D2	WD	none	1/2"	I	—	New solid core Masonite door with passage set.
112	Dining Room - Rm #115	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	D1	WD	none	1/2"	B	—	New solid core Masonite door with passage set.
113	Foyer - Rm #116	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D3	WD	none	1/2"	I	—	Glazing kit, passage hardware set
114	Bedroom - Rm #128	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
115	Storage - Rm #124	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	D	—	none
116	Bedroom - Rm #127	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
117	Bathroom - Rm #125	none	HM	F1	3'-2"	6'-9"	4 1/2"	H2	J02	D1	WD	none	1/2"	C	—	none
118	Bathroom - Rm #125	none	HM	F1	3'-2"	6'-9"	4 1/2"	H2	J02	D1	WD	none	1/2"	E	—	none
119	Bedroom - Rm #126	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
120	Bedroom - Rm #129	none	HM	F1	3'-2"	6'-9"	4 1/2"	H1	J01	D1	WD	none	1/2"	I	—	none
121	Building Exterior	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	Alum	EXIST	A	YES	Replace existing threshold. Replace entry hardware, install new delayed egress locks to existing door.
122	Building Exterior	none	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	EXIST	Alum	EXIST	A	YES	Replace existing threshold. Replace entry hardware, install new delayed egress locks to existing door.

### Door & Frame Elevations

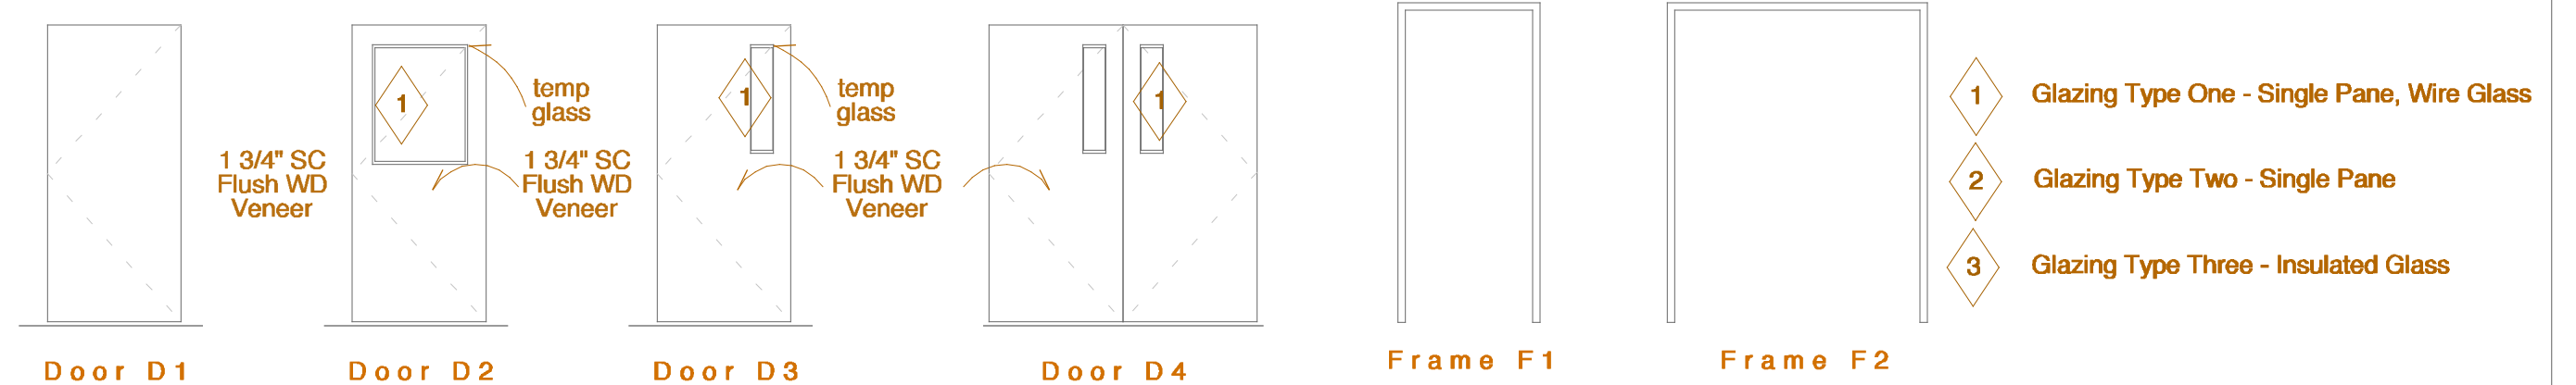

### Transition Strips / Thresholds

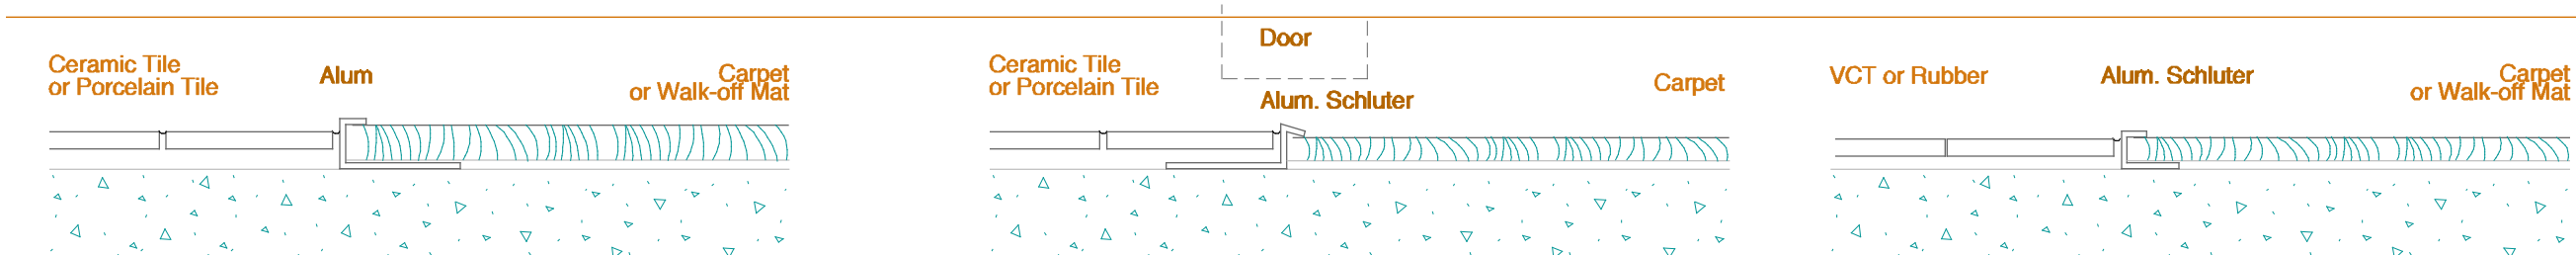

<b>J04</b>	
<b>J03</b>	
<b>J02</b>	
<b>J01</b>	
<b>H3</b>	
<b>H2</b>	
<b>H1</b>	

- All doors in sound insulated partitions shall be sound gasketed, unless noted otherwise.
- All frames in sound insulated partitions shall be sealed with acoustic sealant between the wall sheathing and the frame backend, unless noted otherwise.
- Refer to jamb designation on Door Schedule for details, materials, and dimensions, typ.
- Refer to Door Schedule for additional information.

<b>J1</b>	Jamb detail designation
Max. Rating 45 Minutes	Maximum fire rating for opening
Head Detail D1, D3	Head type references for this detail
Part Types 306-309 301-304	Partition type references for this detail

### Frame / Door Notes

date	revision
04/16/15	Door ratings change

project name  
**Spurwink Services Kaufman House Renovation**

project location  
809 Riverside Street  
Portland, Maine

