


EXHIBIT A

CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

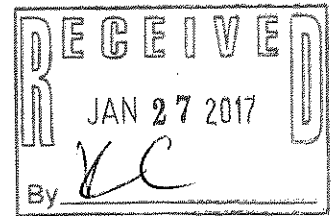

NOTICE OF VIOLATION AND ORDER TO CORRECT

October 5, 2016

Responsible Party 1: Buchholz Larry 46 VESPER ST PORTLAND, ME 04101		
Location 46 VESPER ST	CBL 003 I002001	Inspection Date 9/28/2016
Inspector Philip McGouldrick, Jr	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must complete the proposed date of completion column by proposing a reasonable timeframe to remedy each violation. This form must be received by the Fire Prevention Bureau no later than 10/30/2016. The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

YOUR FAILURE TO SUBMIT A PLAN OF ACTION BY THE DATE PROVIDED, OR TO CORRECT ANY VIOLATION WITHIN THE APPLICABLE TIME FRAME, MAY RESULT IN LEGAL ACTION AGAINST YOU, THE IMPOSITION OF CIVIL PENALTIES, AND THE PURSUIT OF OTHER LEGAL REMEDIES.

Violation	Proposed Date of Completion
NFPA 101- 7.1.8 STAIR GAURDS MUST BE REPAIRED; Guards in accordance with 7.2.2.4 shall be provided at the open sides of means of egress that exceed 30 inches above the floor or the finished ground level below. Banisters missing multiple locations front stairwell	2/1/17
NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. All units <i>Done</i>	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 101- 31.3.3.2 INTERIOR FINISH; Interior wall and ceiling finish materials complying with 10.2 shall be permitted as follows: (1) Exit enclosures- Class A or B (2) Lobbies and corridors- Class A or B (3) Other Spaces- Class A, B, or C. <i>Tongue & groove</i> Panneling in rear hall/means of egress <i>okay according to Capt. Petrucci</i>	<i>1/1/17</i> NIA
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. <i>actual date based on plumber's ability</i> Washer and dryer in front hall floor #2 <i>to relocate to basement</i>	5/1/17 1/25/17
NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY; NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OR OTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FT OF ANY STRUCTURE Gas grill rear deck floor #2 <i>tank has been disconnected</i>	<i>4/1/17</i>

Violation	Proposed Date of Completion
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Rear hall to basement. 3rd floor front hall	<u>5/31/17</u>

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

1/13/17
Date

[Signature]
Responsible Party

Date

Responsible Party

SEEN AND AGREED

27 Jan 2017
Date

Capt. Petrucci
Fire Prevention Bureau

