


CITY OF PORTLAND  
 FIRE PREVENTION BUREAU  
 380 Congress Street, Portland, Maine 04101  
 fireprevention@portlandmaine.gov  
 (207) 874-8400

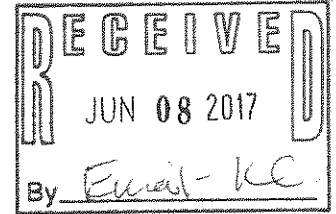

**NOTICE OF VIOLATION AND ORDER TO CORRECT**

May 16, 2017

<b>Responsible Party 1:</b> Gervais Steve 44 Park Ave South Portland, ME 04106		<b>Responsible Party 2:</b> Alexandra Rapaport 478 Central Park West #7A New York, NY 10025
<b>Location</b> 61 WILSON ST	<b>CBL</b> 003 M008001	<b>Inspection Date</b> 4/18/2017
<b>Inspector</b> Justin Bragdon	<b>Inspection Type</b> FP Routine Inspection	<b>Status</b> Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

**You must send this form to the Fire Prevention Bureau no later than 6/15/2017.**

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
<p><b>NFPA 80- ANNEX D.4 1-HOUR FIRE DOORS ASSEMBLIES REQ;</b> Listings are provided for floor fire door assemblies that are installed in fire-rated floor-ceiling or roof-ceiling assemblies that have been tested in accordance with the methods described in NFPA 288. The listing indicates the fire-rated assembly and the hourly rating (3 hours, 2 hours, 1.5 hours, 1 hour, .75 hours) for which the door can be permitted to be used so that access to the space above the ceiling or to the floor above can be provided without adversely affecting the fire resistance rating of the entire assembly. The listing provides limitations on the maximum size of an individual door opening and the total area of all door openings permitted for each 100 square feet of floor or ceiling.</p> <p>Fire doors are required for each basement door and both doors to the second floor apartments.</p>	8/01/2017
<p><b>NFPA 10- 7.1.1 FIRE EXTINGUISHERS NEED ANNUAL SERVICE;</b> The owner or designated agent or occupant of a property in which fire extinguishers are located shall be responsible for inspection, maintenance, and recharging.</p> <p>There are 2 extinguishers in the basement. They are required to be inspected and serviced annually</p>	7/01/2017
<p><b>NFPA 101- 9.6.10.1.1 SMOKE DETECTOR REQUIRED;</b> Where required by another section of this code, single-station and multiple-station smoke alarms shall be in accordance with NFPA 72, National Fire Alarm Code, shall be provided in all occupiable areas in environments that are suitable for proper smoke detector operation.</p> <p>There are detectors in the stairwells to the second floor on the middle landing attached to the baseboard trim. They need to be relocated to a proper height for proper installation/operation.</p>	7/01/2017

Violation	Proposed Date of Completion
<b>NFPA 101- 22.3.1 HOLE IN FLOOR NEEDS REPAIR;</b> Any vertical opening shall be required in accordance with section 8.6. In the basement there is a hole in the subflooring that exposes the 1st floor bathroom shower plumbing. This needs to be enclosed with approved fire rated materials	
<b>FINAL DATE OF COMPLETED VIOLATION(S)</b>	8 / 1 / 17
<b>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</b>	

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.


**VIOLATOR CERTIFICATION**

*I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.*

*I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.*

*If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.*

6/7/17  
 \_\_\_\_\_  
 Date

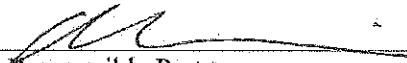  
 \_\_\_\_\_  
 Responsible Party

\_\_\_\_\_  
 Date

\_\_\_\_\_  
 Responsible Party

**SEEN AND AGREED**

6/8/17  
 \_\_\_\_\_  
 Date

Katharine Carlson for Fire Prevention  
 \_\_\_\_\_  
 Fire Prevention Bureau