



| FRAMING PLAN SYMBOLS KEY | |
|--------------------------|--|
| □ | WOOD POST |
| ○ | STEEL COLUMN |
| (X) | NUMBER OF WOOD STUDS IN POST BELOW |
| A | COLUMN ABOVE THIS LEVEL |
| C | COLUMN CONTINUOUS THROUGH THIS LEVEL |
| — | JOIST BEARING |
| — | CONTINUOUS JOIST WITH INTERMEDIATE BEARING |
| — | FLUSH FRAMED JOIST BEARING WITH HANGER |
| — | WOOD STUD BEARING WALL BELOW |
| — | OVER FRAMING BY OTHERS -TYP |
| 2x12 | NUMBER OF TRIM STUDS UNDER HEADER |
| 2x12K | NUMBER OF KING STUDS ADJACENT TO HEADER |

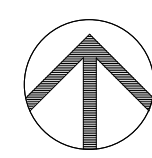

3RD FLOOR FRAMING PLAN

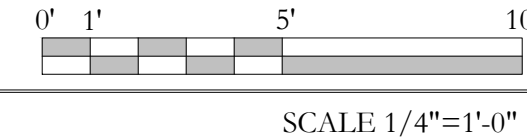


- NOTES:
- SEE SHEET S1.0 FOR GENERAL STRUCTURAL NOTES
 - ALL WOOD COLUMNS IN 2x6 WALLS SHALL BE 3-2x6 AND IN 2x4 WALLS SHALL BE 3-2x4 UNLESS NOTED OTHERWISE ON PLANS
 - ALL BEAMS ARE DROPPED, UNO
 - ALL HEADERS IN 2x6 BEARING WALLS ARE (2) 2x6 NO.1 GRADE SPF MIN, UNO
 - ALL HEADERS IN 2x4 BEARING WALLS ARE (2) 2x6 NO.1 GRADE SPF MIN, UNO
 - ALL FLOOR SHEATHING TO BE 3/4", SEE GENERAL NOTES FOR ADDITIONAL INFORMATION -TYP

Structural Integrity
Consulting Engineers, Inc.

46 Forest Ave.
Portland, ME, 04101
p. 207-774-4614
f. 866-793-7835
www.structuralinteg.com

BUILD WITH CONFIDENCE
© 2017 Structural Integrity Consulting Engineers, Inc.

SI# 17-0043

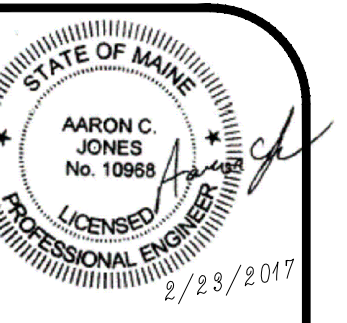

PROJECT NO.
16035
PROJECT NAME
**7 CUMBERLAND
PORTLAND, ME**

REVISIONS

| | |
|---|------------|
| 1 | 3/15/2017 |
| 2 | 12/29/2017 |
| 3 | 1/16/2018 |
| 4 | |
| 5 | |

DRAWN BY
MKL
SHEET TITLE
THIRD FLOOR FRAMING PLAN

ISSUE DATE
8/8/17
SHEET SCALE
AS NOTED

S
S1.4