


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

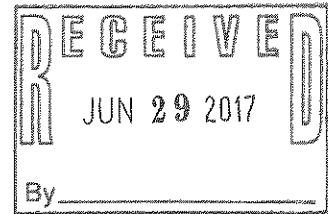

NOTICE OF VIOLATION AND ORDER TO CORRECT

June 7, 2017

Responsible Party 1: Bonarrigo Lisa 118 Washington Ave PORTLAND, ME 04101		
Location 21 QUEBEC ST	CBL 014 G009001	Inspection Date 5/26/2017
Inspector Daniel Small	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 6/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101- 31.3.1.1.1 VERTICAL OPENINGS NOT FIRE RATED; Vertical openings shall be enclosed or protected in accordance with Section 8.6. False door to Apartment 2 not rated from stairway	<u>8 / 31 / 17</u> requirement. Please Advise
NFPA 101- 7.5.1.1 EXIT OBSTRUCTED; Where exits are not immediately accessible from an open floor area, continuous passageways, aisles, or corridors leading directly to every exit shall be maintained and shall be arranged to provide access for each occupant to not less than two exits by separate ways of travel, unless otherwise provided in 7.5.1.1.3 and 7.5.1.1.4. Both stairways & bed blocking door to front stairs - Apt 1	IMMEDIATELY remove all obstructions from the exits. Your signature below indicates that all obstructions have been removed and will not be replaced.
NFPA 101- 31.2.2:1.2 EXIT STAIR REQ. 60-MIN FIRE RATING - NON-HIGH-RISE; In buildings using Option 4, exit enclosures shall have a minimum 1-hour fire resistance rating, and doors shall have a minimum 1-hour fire protection rating. Rear stairway between 2nd and 3rd floor apartments	<u>8 / 31 / 17</u>
NFPA 101- 7.2.1.8.1 FIRE DOORS MUST BE SELF- OR AUTO-CLOSING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. 3rd floor door self closing hinges need adjustment	<u>8 / 31 / 17</u>

Violation	Proposed Date of Completion
<p>NPFA 101- 7.2.2.1.1 STAIRS REQUIRE REPAIR; Stairs shall meet the following criteria: (1) New stairs shall be in accordance with Table 7.2.2.2.1.1(a) (2) Existing stairs shall be permitted to remain in use, provided that they meet the requirements for existing stairs shown in Table 7.2.2.2.1.1(b) (3) Approved existing stairs shall be permitted to be rebuilt in accordance with the following: (a) dimensional criteria of table 7.2.2.2.1.1(b) and other stair requirements of 7.2.2 (4) The requirements for new and existing stairs shall not apply to stairs located in industrial equipment access areas where otherwise provided in 40.2.5.2. Missing handrail to porch of Apartment 1</p>	<p><u>8 / 31 / 17</u></p>
<p>NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. Basement, first and second floors</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p>NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. Apartments 1 and 2</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p>NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. Basement</p>	<p><u>7 / 31 / 17</u></p>
<p>NFPA 70- ARTICLE 110.12 B EXPOSED WIRING CONNECTIONS; Internal parts of electrical equipment, including busbars, wiring terminals, insulators, and other surfaces, shall not be damaged or contaminated by foreign materials such as paint, plaster, cleaners, abrasives, or corrosive residues. There shall be no damaged parts that may adversely affect safe operation or mechanical strength of the equipment such as parts that are broken; bent; cut; or deteriorated by corrosion, chemical reaction, or overheating. Unsecured wiring in basement—some with tape on ends</p>	<p><u>8 / 31 / 17</u></p>
<p>NFPA 70 MISSING BOX COVERS; Refer to NFPA 70, National Electrical Code, on standards for missing box covers.</p>	<p><u>8 / 31 / 17</u></p>
<p>NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) No sprinkler over furnace in basement</p>	<p><u>— / — / —</u></p>
<p>NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY; NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OR OTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FT OF ANY STRUCTURE Remove propane grill from first floor porch to Apartment 1</p>	<p><u>6 / 30 / 17</u></p>
<p>FINAL DATE OF COMPLETED VIOLATION(S)</p>	<p><u>8 / 31 / 17</u></p>
<p>FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)</p>	<p><u>9 / 15 / 17</u></p>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

6/27/17
Date

Lisa Bonamigo
Responsible Party

Date

Responsible Party

SEEN AND AGREED

30 June 2017
Date

Capt. D. Petrucci
Fire Prevention Bureau

