

CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400



NOTICE OF VIOLATION AND ORDER TO CORRECT

April 12, 2017

Responsible Party 1: COHEN RICHARD 389 HENRY ST AMHERST, MA 01002		
Location 31 KELLOGG ST	CBL 017 E025001	Inspection Date 3/22/2017
Inspector Brad James	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 4/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
NFPA 101- 31.3.1.1.1 VERTICLE OPENINGS SHALL BE PROTECTED; Vertical openings shall be enclosed or protected in accordance with Section 8.6. Attic access at top of rear stairwell needs drywall attached for fire rating.	4/19/17
NFPA 101- 7.2.1.8.1 DOORS SHALL BE SELF-CLOSING & SELF-LATCHING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise specified by 7.2.1.8.3. All fire doors need self closures and to latch.	4/19/17
NFPA 10- 7.2.4.4 FIRE EXTINGUISHER INSPECTION TAG; Where manual inspections are conducted, records for manual inspections shall be kept on a tag or label attached to the fire extinguisher, on an inspection checklist maintained on file, or by an electronic method. Second floor front stairwell.	4/19/17
NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. 1st floor apartment.	3/23/17 IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 101- 31.3.3.2 INTERIOR FINISH; Interior wall and ceiling finish materials complying with 10.2 shall be permitted as follows: (1) Exit enclosures- Class A or B (2) Lobbies and corridors- Class A or B (3) Other Spaces- Class A, B, or C. Rear stairwell has wainscoting on bottom half of wall that needs some repair. Some of the pieces are separating from the wall.	4/19/17

Violation	Proposed Date of Completion
NFPA 1 EXCESSIVE/DISORDERLY STORAGE ; Reference NFPA 1 for excessive fuel-load. Basement needs some housekeeping and to remove excess storage.	<u>4 / 19 / 17</u>
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED ; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Over both gas boilers in the basement.	<u>4 / 19 / 17</u>
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED ; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Basement door. 1st floor rear. 2nd floor front.	<u>4 / 19 / 17</u>
NFPA 1- 19.1.2 INSIDE STORAGE NOT ORDERLY ; Persons owning or having control of any property shall not allow any combustible waste material to accumulate in any area or in any manner that creates a fire hazard to life or property. 3rd floor rear has storage at the top in a make shift open closet. Removal of contents and closet recommended. Fire proof materials and doors needed to enclose if it is to stay.	<u>4 / 19 / 17</u>
FINAL DATE OF COMPLETED VIOLATION(S)	<u>4 / 19 / 17</u>
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	<u>4 / 28 / 17</u>

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

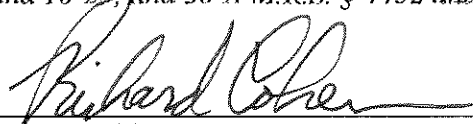
VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

4/20/17
Date


Responsible Party

Date

Responsible Party

SEEN AND AGREED

4/23/17
Date


Fire Prevention Bureau