



GRANITE ENTRY PIER 1 - REPAIR SCHEDULE								(SEE PHOTOS 1-1 THROUGH 1-8)
NO.	FACE	BLOCK	TYPE	AREA	DEPTH	PINS	PHOTO	
1.	WEST	MIDDLE 1	SECTION REPAIR	7 CUBIC INCHES	N/A	0	1-2 WEST	
2.	WEST	MIDDLE 1	DUTCHMAN REPAIR	3" WIDE X 3" TALL	2"	0	1-2 WEST	
3.	EAST	MIDDLE 1	DUTCHMAN REPAIR	2" WIDE X 4" TALL	2"	0	1-5 EAST	
4.	SOUTH	MIDDLE 1	SECTION REPAIR	4 CUBIC INCHES	N/A	0	1-7 SOUTH	
5.	SOUTH	BOTTOM	DUTCHMAN REPAIR	12" WIDE X 9.5" TALL	4"	0	1-8 SOUTH	

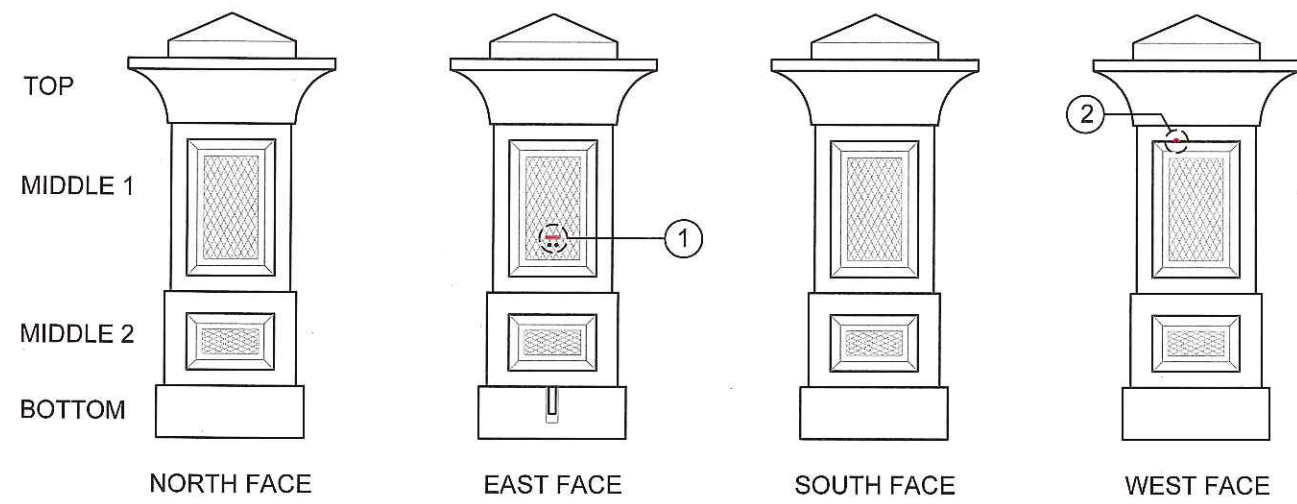

GRANITE ENTRY PIER 2 - REPAIR SCHEDULE								(SEE PHOTOS 2-1 THROUGH 2-9)
NO.	FACE	BLOCK	TYPE	AREA	DEPTH	PINS	PHOTO	
1.	EAST	MIDDLE 1	SECTION REPAIR	2 CUBIC INCHES	N/A	0	2-3 EAST	
2.	WEST	MIDDLE 1	SECTION REPAIR	1 CUBIC INCH	N/A	0	2-8 WEST	


1 BASE BID - GRANITE ENTRY PIER - 1
 S3.1 1/4" = 1'-0" (ON 22 X 34 SHEET) LIFT, SHIM AND REPOSITION ENTIRE PIER ASSEMBLY TO SQUARE AND PLUMB.

2 BASE BID - GRANITE ENTRY PIER - 2
 S3.1 1/4" = 1'-0" (ON 22 X 34 SHEET) LIFT, SHIM AND REPOSITION ENTIRE PIER ASSEMBLY TO SQUARE AND PLUMB.

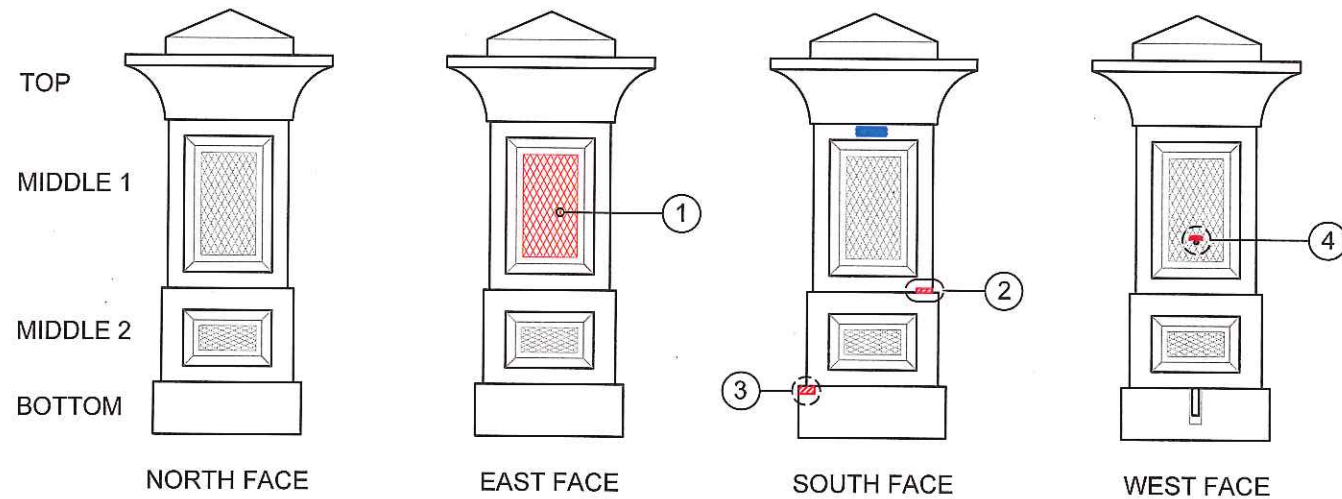

GRANITE ENTRY PIER 3 - REPAIR SCHEDULE								(SEE PHOTOS 3-1 THROUGH 3-9)
NO.	FACE	BLOCK	TYPE	AREA	DEPTH	PINS	PHOTO	
1.	EAST	MIDDLE 1	RETOOL PATTERN	14" WIDE X 26" TALL	3/32"	0	3-3 EAST	
2.	SOUTH	MIDDLE 1	DUTCHMAN REPAIR	4" WIDE X 3" TALL	1"	0	3-6 SOUTH	
3.	SOUTH	BOTTOM	DUTCHMAN REPAIR	4" WIDE X 2" TALL	4"	0	3-6 SOUTH	
4.	WEST	MIDDLE 1	SECTION REPAIR	2 CUBIC INCHES	N/A	0	3-8 WEST	

3 BASE BID - GRANITE ENTRY PIER - 3
 S3.1 1/4" = 1'-0" (ON 22 X 34 SHEET) LIFT, SHIM AND REPOSITION ENTIRE PIER ASSEMBLY TO SQUARE AND PLUMB.

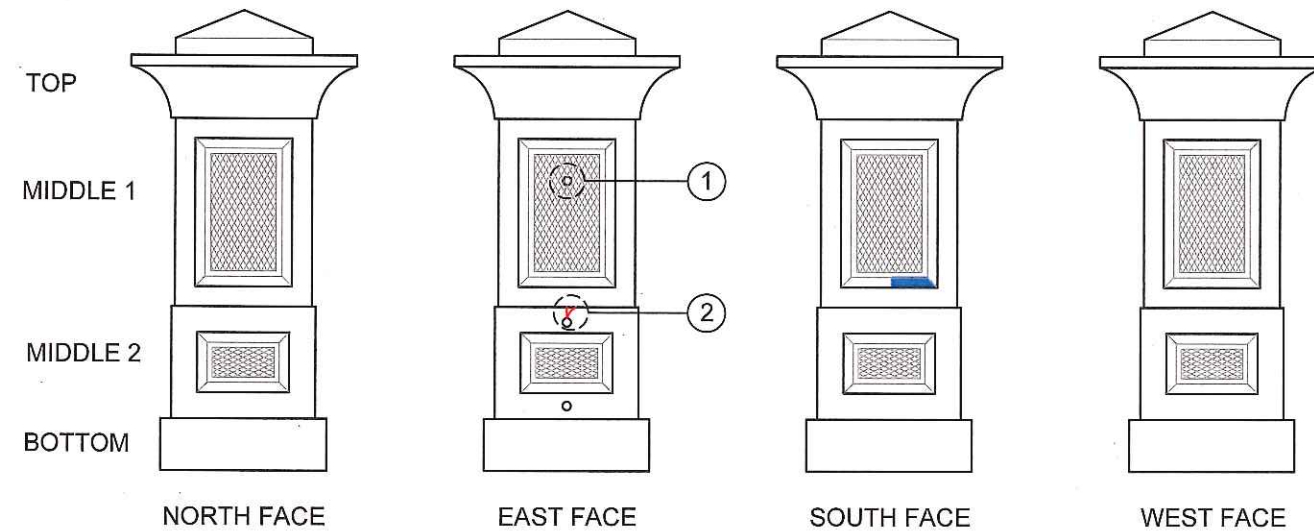

GRANITE ENTRY PIER 4 - REPAIR SCHEDULE								(SEE PHOTOS 4-1 THROUGH 4-11)
NO.	FACE	BLOCK	TYPE	AREA	DEPTH	PINS	PHOTO	
1.	EAST	MIDDLE 1, 2	CLEAN ANCHOR HOLE	(3) - 2" DIAMETER	12"	0	4-4 EAST	
2.	EAST	MIDDLE 2	CRACK REPAIR	4" WIDE X 3" TALL	1"	0	4-5 EAST	

4 BASE BID - GRANITE ENTRY PIER - 4
 S3.1 1/4" = 1'-0" (ON 22 X 34 SHEET) LIFT, SHIM AND REPOSITION ENTIRE PIER ASSEMBLY TO SQUARE AND PLUMB.

NOT FOR CONSTRUCTION

RESURGENCE
 ENGINEERING & PRESERVATION, INC.
 132 BRENTWOOD STREET
 PORTLAND, ME 04103
 207.773.4860

LINCOLN PARK IRON FENCE RESTORATION

GRANITE ENTRY PIER TREATMENTS

Project # 17-019
 Date: 1/29/18
 Issued for: HP REVIEW

REVISIONS
 NO. DATE
 Δ MM-DD-YY
 Δ MM-DD-YY

SHEET
 S-3.1