




SECTION G S2.1 3/4"=1'-0
 TYPICAL CONCRETE STAIR

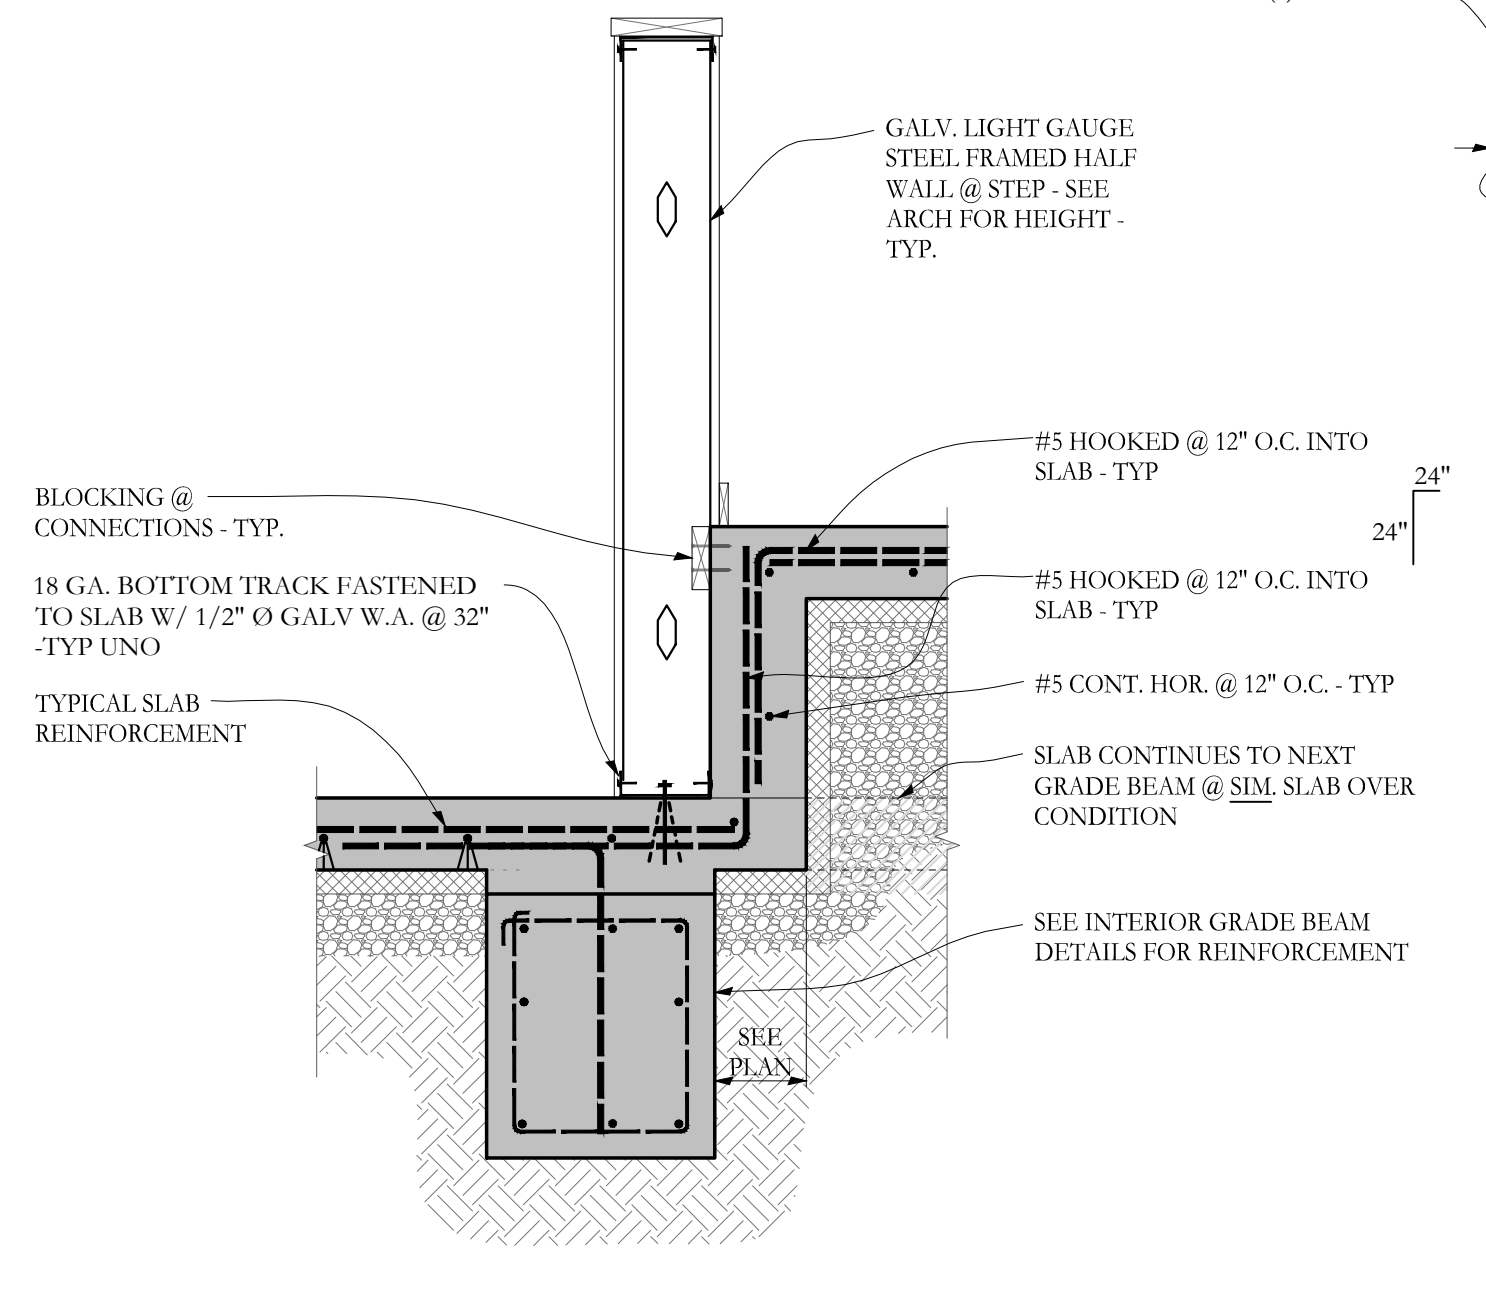


SECTION D S2.1 3/4"=1'-0
 CAST IN PLACE WALL OVER CANTILEVERED SLAB

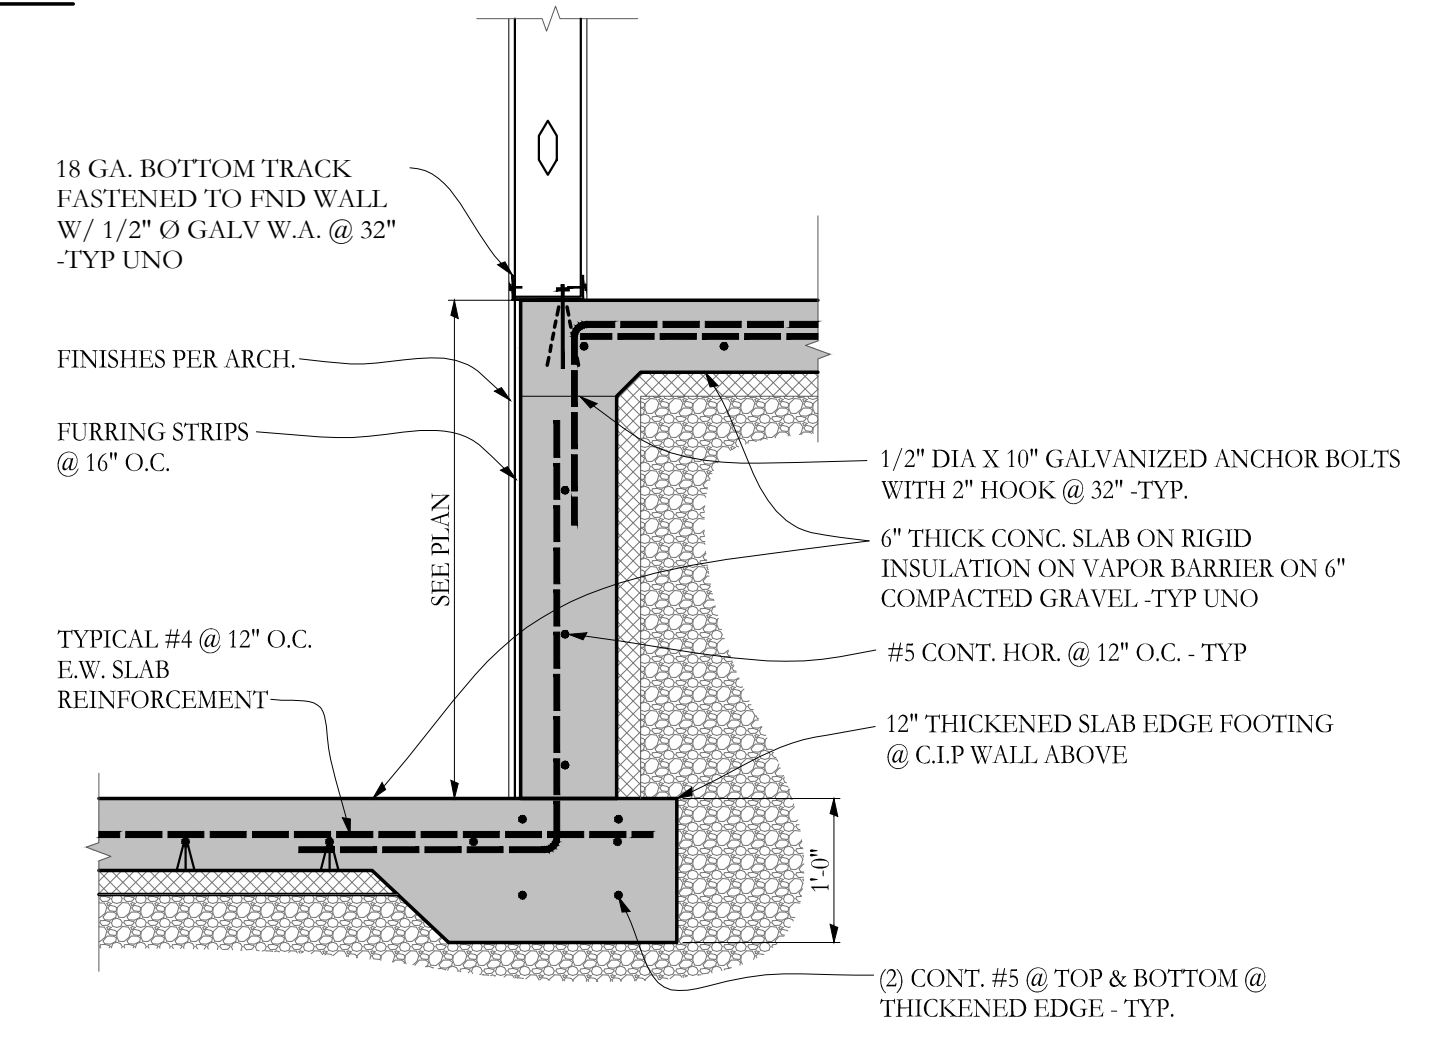


SECTION E S2.1 3/4"=1'-0
 CAST IN PLACE WALL OVER THICKENED SLAB EDGE

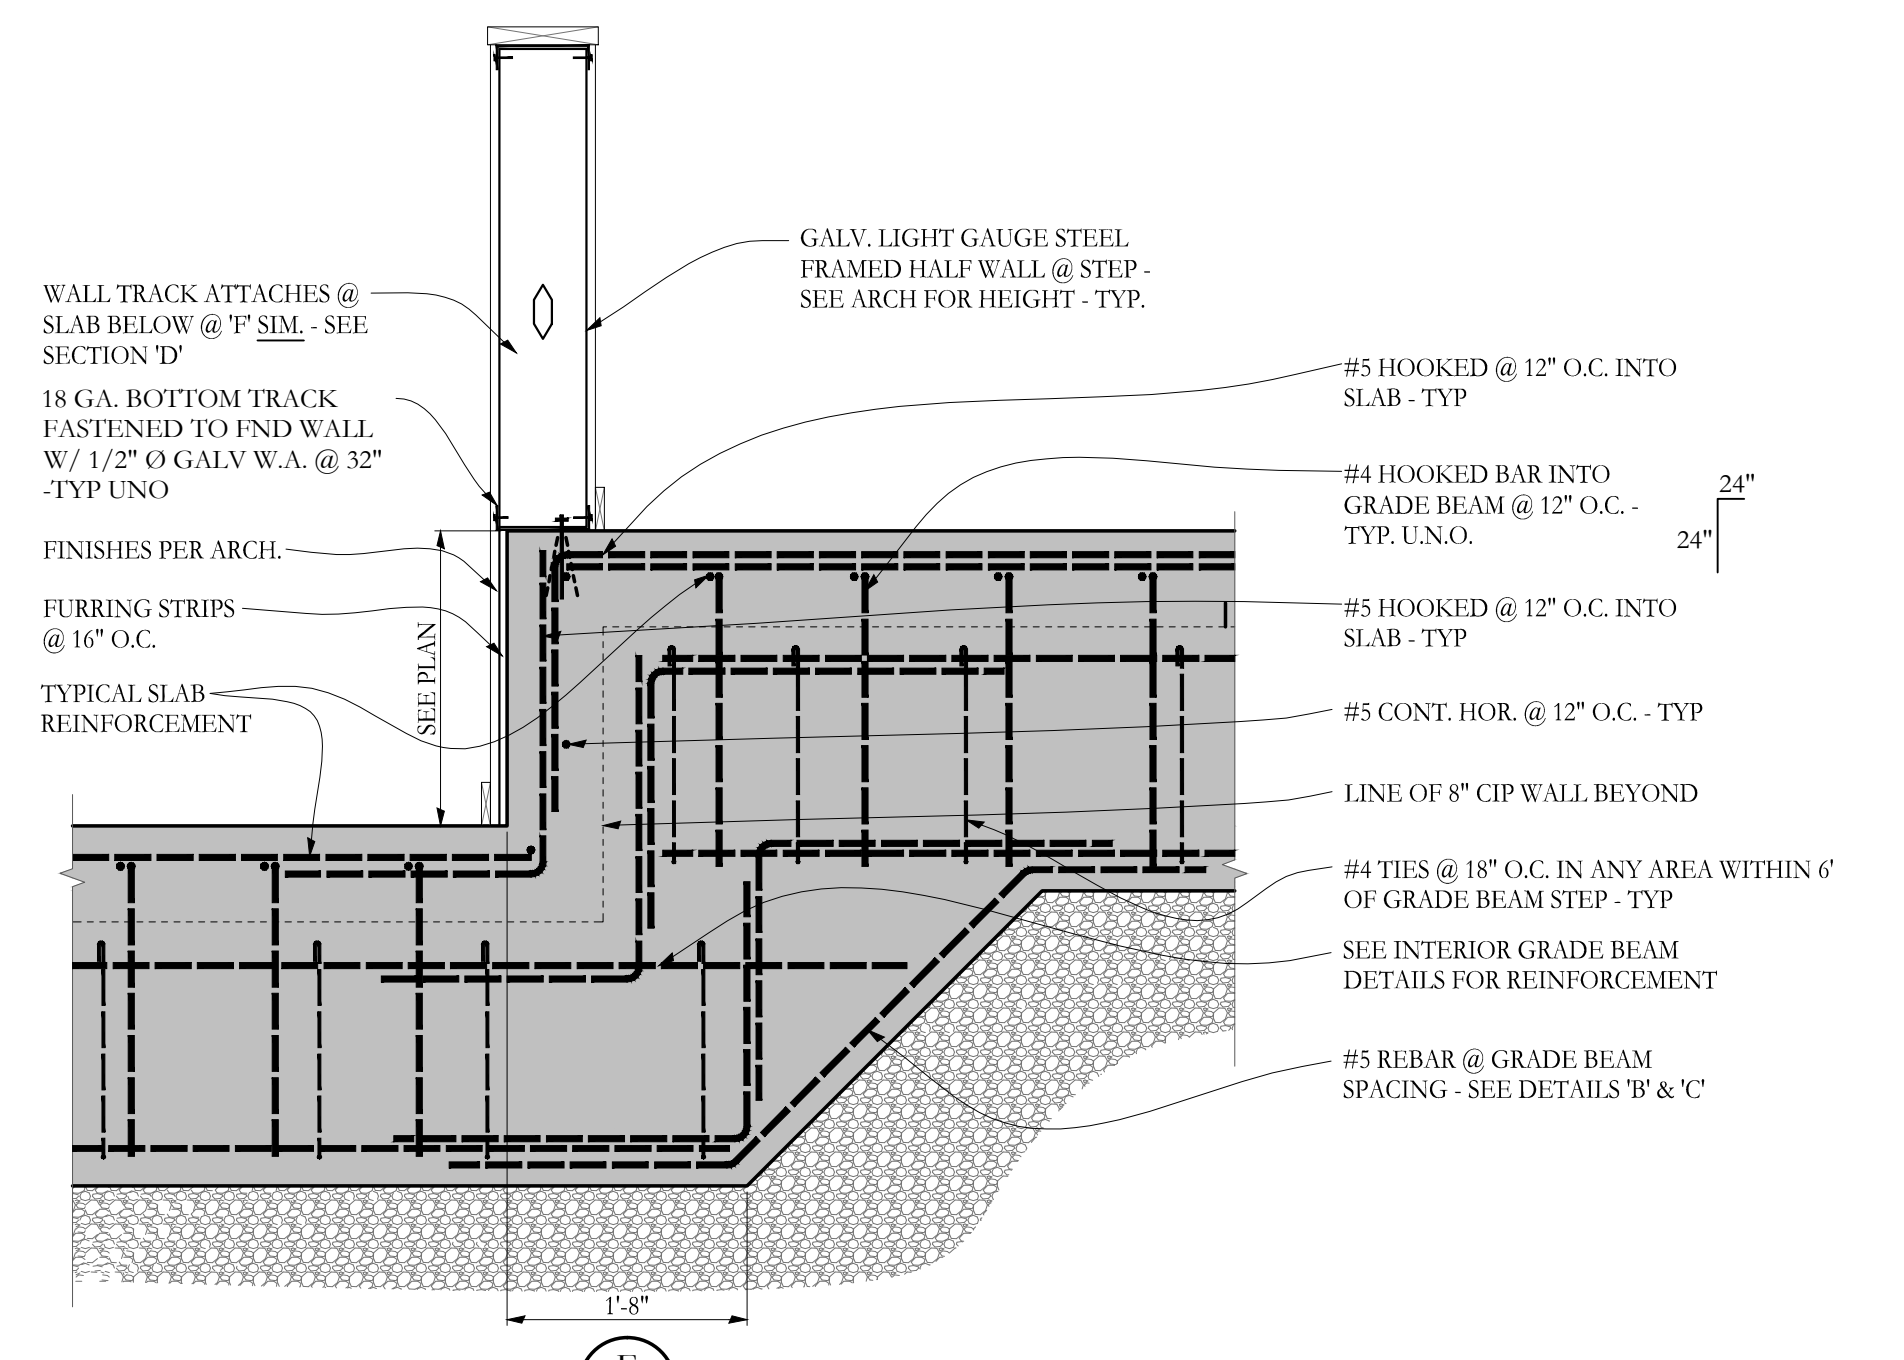


SECTION F S2.1 3/4"=1'-0
 STEPPED GRADE BEAM @ SLAB ELEVATION CHANGE

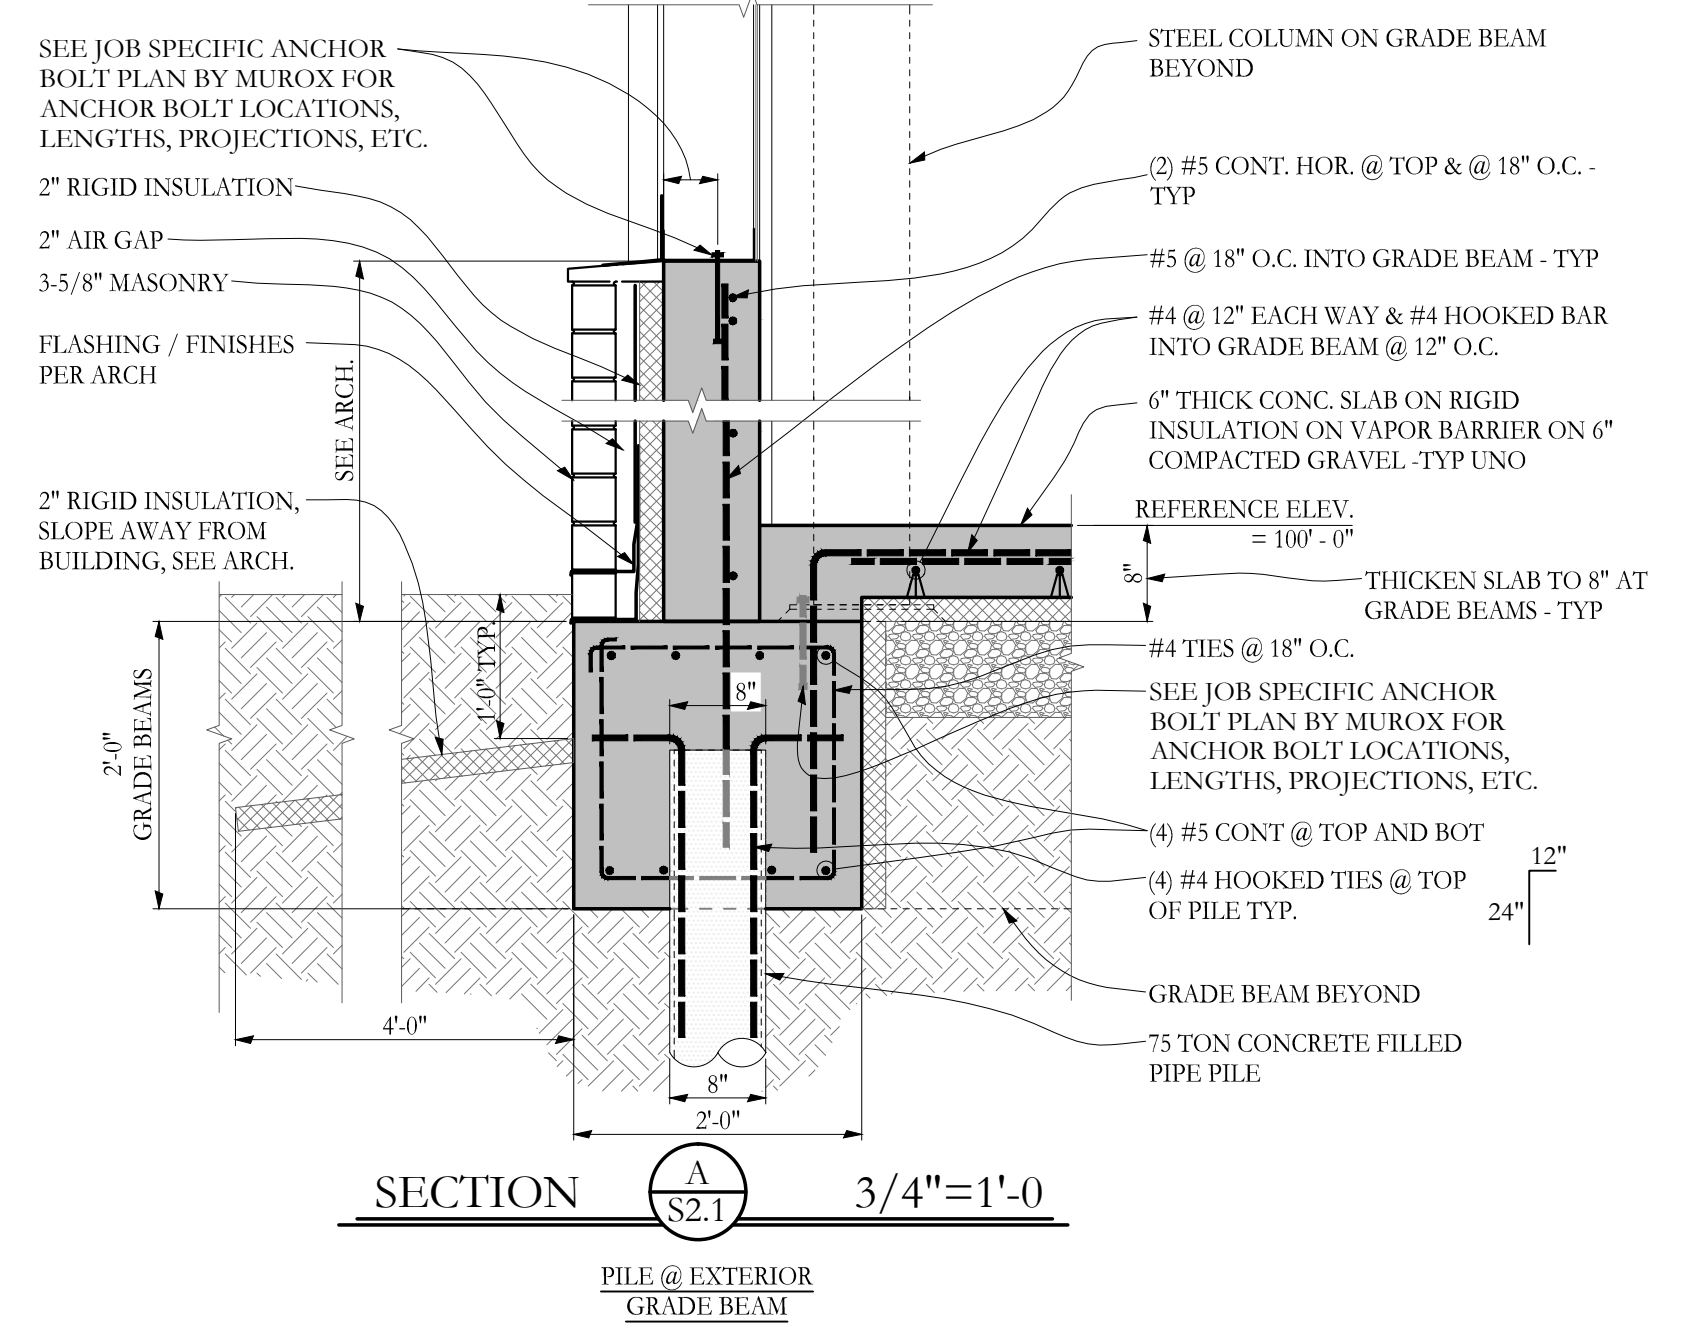

SECTION A S2.1 3/4"=1'-0
 PILE @ EXTERIOR GRADE BEAM

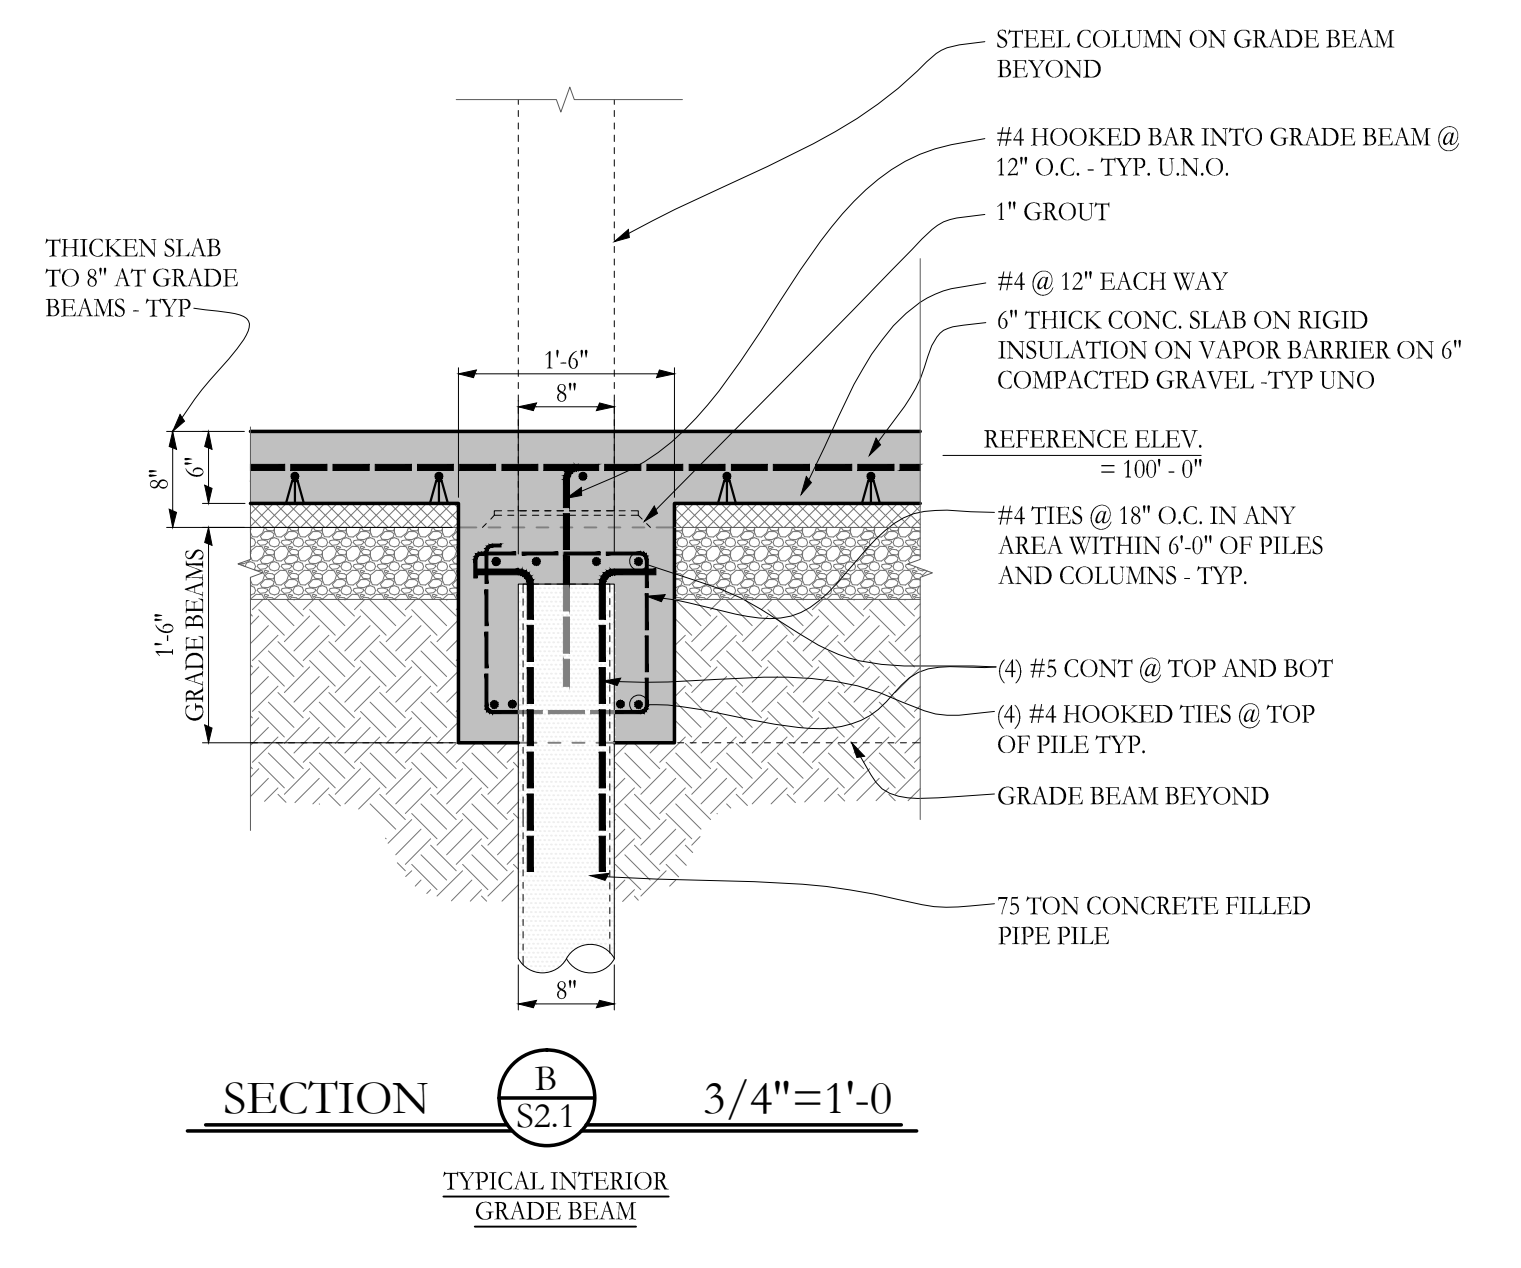


SECTION B S2.1 3/4"=1'-0
 TYPICAL INTERIOR GRADE BEAM

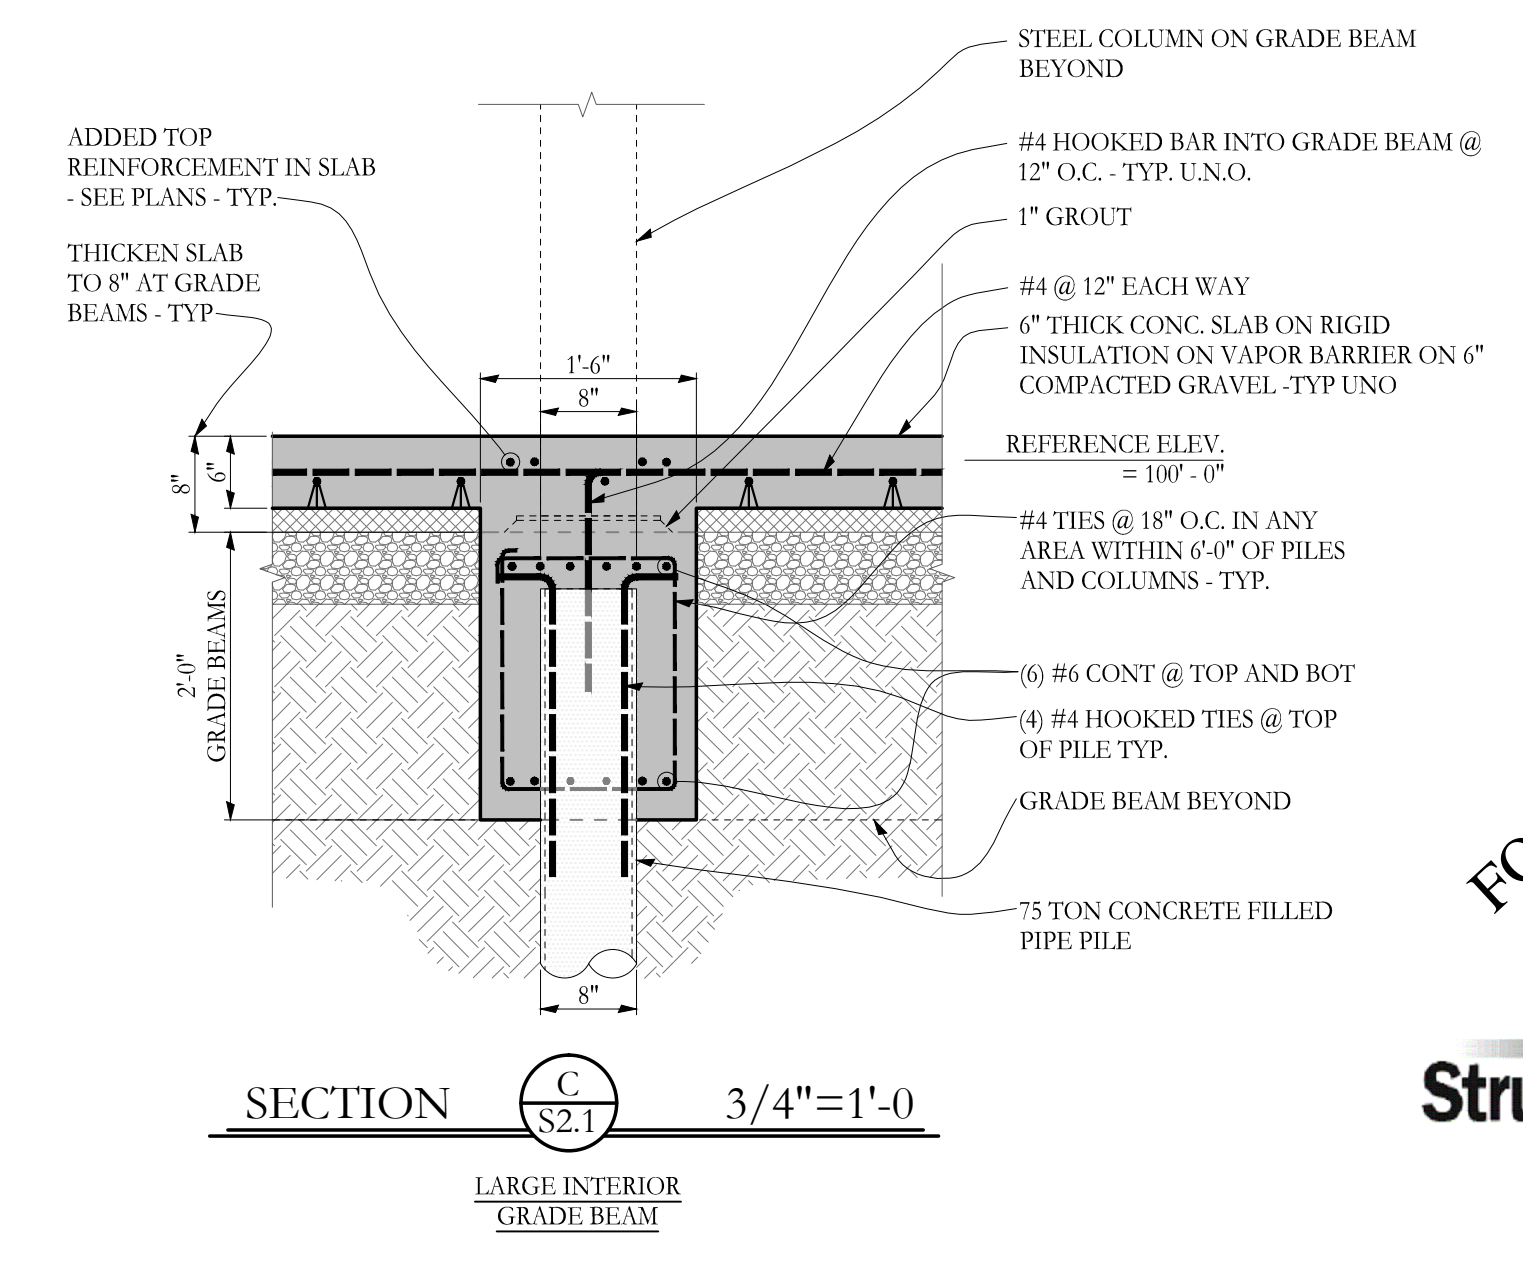

SECTION C S2.1 3/4"=1'-0
 LARGE INTERIOR GRADE BEAM

FOR PERMIT

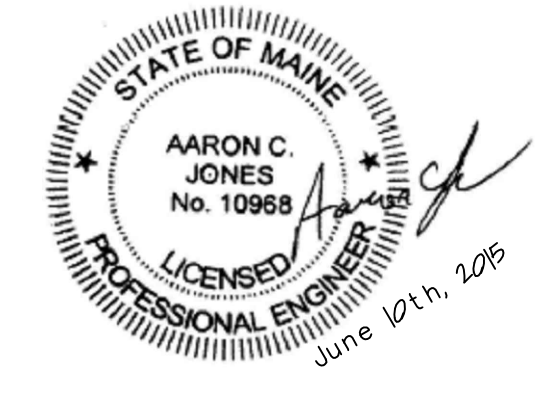

Structural Integrity
 Consulting Engineers, Inc.
 77 Oak Street
 Portland, ME, 04101
 p. 207-774-4614
 f. 866-793-7835
 www.structuralintegrity.com
 BUILD WITH CONFIDENCE
 © 2012 Structural Integrity Consulting Engineers, Inc.
 SI # 15-0058