


CITY OF PORTLAND  
 FIRE PREVENTION BUREAU  
 380 Congress Street, Portland, Maine 04101  
 fireprevention@portlandmaine.gov  
 (207) 874-8400

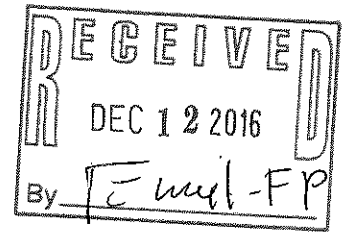

**NOTICE OF VIOLATION AND ORDER TO CORRECT**

December 1, 2016

<b>Responsible Party 1:</b> Theriault Geraldine 156 MUSSEY ST PORTLAND, ME 04106		<b>Responsible Party 2:</b> Theriault Gerladine 99 Grant St #3 Portland, ME 04101	
<b>Location</b> 0097 GRANT ST	<b>CBL</b> 048 A027001	<b>Inspection Date</b> 11/17/2016	
<b>Inspector</b> Angela Calvo	<b>Inspection Type</b> FP Routine Inspection	<b>Status</b> Failed	

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must complete the proposed date of completion column by proposing a reasonable timeframe to remedy each violation. This form must be received by the Fire Prevention Bureau no later than 12/30/2016. The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

**YOUR FAILURE TO SUBMIT A PLAN OF ACTION BY THE DATE PROVIDED, OR TO CORRECT ANY VIOLATION WITHIN THE APPLICABLE TIME FRAME, MAY RESULT IN LEGAL ACTION AGAINST YOU, THE IMPOSITION OF CIVIL PENALTIES, AND THE PURSUIT OF OTHER LEGAL REMEDIES.**

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. Unit numbers needed on all doors	2/17/17
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. excessive basement storage	2/17/17
NFPA 70- ARTICLE 110.12 B EXPOSED WIRING CONNECTIONS; Internal parts of electrical equipment, including busbars, wiring terminals, insulators, and other surfaces, shall not be damaged or contaminated by foreign materials such as paint, plaster, cleaners, abrasives, or corrosive residues. There shall be no damaged parts that may adversely affect safe operation or mechanical strength of the equipment such as parts that are broken; bent; cut; or deteriorated by corrosion, chemical reaction, or overheating. open junction boxes in basement	2/17/17
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Install sprinkler heads over furnace and hot water heaters	2/17/17

**VIOLATOR CERTIFICATION**

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

12/12/16  
Date

[Signature]  
Responsible Party

\_\_\_\_\_  
Date

\_\_\_\_\_  
Responsible Party

**SEEN AND AGREED**

12/30/16  
Date

Katherine Cochran PO Capt. Pedraccelli  
Fire Prevention Bureau